



Expertise

Protocol number: 46678787
Order No. / Reference: 26713361
Inspection date: 23 Jul 2026

Manufacturer: Peugeot

Model: 5008 BlueHDi 180 EAT8 GT

VIN: VF3MJEHZUNS182848



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 5008 BlueHDi 180 EAT8 GT	
Vehicle Identification number	VF3MJEHZUNS182848
Mileage (Read)	57,712 km
First registration	8 Mar 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,997 ccm / 4
Power	130 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Perla Nera Schwarz Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	26,300 km
Last service on / at	04/2026 at 54,034 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG042020
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / AZF 00092		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R19 97V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	205/55 R19 97V	Summer tyres on Light alloy	Michelin	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	225/55 R18 102H	Winter tyres on Light alloy	Dunlop	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS (Anti-lock Braking System)
- Airbag: Front and rear side airbags
- Airbag: Curtain airbags front and rear
- Adaptive Cruise Control (ACC) with Stop & Go function including Lane Positioning Assistant and Active Safety Brake Plus (for night driving and cyclists)
- Exterior mirrors in Perla Nera Black
- Hill start assist
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Chrome trim strips below the side windows
- Black Diamond roof (roof in Perla Nera black) - Exterior mirror caps in Perla Nera black - Rear spoiler in glossy black
- Alcantara "Grevat" decorative inserts for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Misfueling protection
- Electric front and rear windows with comfort operation and anti-pinch protection
- High beam assist
- Follow-me-home function (automatic)
- Front bumper in chrome look
- front and rear floor mats
- Cruise control system with speed limiter
- Cup holder in the center console
- Heated rear window
- rear window wiper
- Interior mirror automatically dimming
- Frameless interior mirror
- Keyless system, keyless access and start system
- Child safety locks on the rear doors
- Automatic climate control (2-zone), with activated carbon filter, separately adjustable for driver and front passenger
- Front headrests (2) Safety optimized
- Chrome-plated loading sill protector
- Blue LED lighting on the door panel
- LED daytime running lights and LED turn signals at the front
- light sensor
- Illuminated makeup mirror for driver and front passenger
- Fatigue warning
- Navigation system: 3D navigation system NAC - 3D navigation including 3D display of buildings and monuments - Voice recognition for navigation, telephone and media - Real-time navigation by TomTom Services - Map display on the digital instrument cluster - Multifunctional touchscreen with 10" color capacitive screen, piano key toggle switches
- Aluminum pedals and stainless steel door sills
- Airbag for driver and front passenger; passenger airbag can be deactivated
- Active Blind Spot Assist
- Electrically folding exterior mirrors with LED approach lighting
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- On-board computer - outside temperature and maintenance indicator - average and current fuel consumption - remaining range - distance traveled - average speed
- Black headliner
- Aluminum roof rails
- Ceiling light - LED at the front, in row 2 and in row 3, 2 LED reading lights at the front, in row 2 and in row 3
- Decorative trim on the dashboard and door panels in satin chrome
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Driving mode selector (Sport - Normal - Eco) Sport mode activates the following functions: - Display of driving dynamics parameters on the instrument cluster - More responsive accelerator pedal response - More responsive power steering - Increased engine sound
- electric parking brake
- Front collision warning
- Full LED headlights with automatic headlight range control, static cornering lights and (Foggy Mode) function
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point seat belts Front seats: - Height-adjustable three-point seat belts with belt locks - Pyrotechnic belt tensioners and electronically controlled belt force limiters - Warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger Rear seats: - 3 three-point seat belts - 3 three-point Isofix child seat anchors in the 2nd row - Belt force limiters on the side seats - Warning light and warning signal when the seat belt is released
- Rear headrests (3) height-adjustable and lowerable
- White LED ambient lighting in the front footwell
- LED taillights with 3D effect
- Steering wheel: Multifunction leather steering wheel
- Steering wheel: small multifunction steering wheel, flattened at the top and bottom
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- Fog light
- Emergency brake assist with automatic activation of the hazard warning lights
- Package: Children's Package (Allure Pack, GT, GT Pack) - Folding tables on the front seatbacks - Map pockets on the front seatbacks - Sunshades in the 2nd row
- Particulate filter: FAP diesel particulate filter



- Upholstery: Fabric/faux leather "Belomka" in black with decorative stitching in copper
- Radio: RCC audio system - Bi-tuner - 6 speakers - MP3-compatible - Bluetooth - Hands-free system with audio streaming via Bluetooth - USB port - Steering wheel and touchscreen controls
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire pressure monitoring system
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Reversing camera with 180° surround view
- paddle shifters on the steering wheel
- Keyless start system
- Electric power steering
- Seats: 2 additional seats for the 3rd row, removable and fully retractable
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Power outlet: Dual USB port (Type A) in row 2
- Traffic sign recognition with display of the speed recommendation in the instrument cluster
- Central locking system with remote control, activatable from inside - doors lock automatically when driving off.

- Peugeot Connect Box with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery
- Radio: Mirror Screen (Transfer of multimedia content and apps from a smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps) - Mirror Link: Mirroring of the smartphone screen on the touchscreen (for compatible smartphone models with Android operating system) - CarPlay (for compatible Apple iPhone models) - Android Auto and Mirror Link (for compatible smartphone models with Android operating system)
- Side windows in the second row and rear window are more heavily tinted.
- Seats: 3 separate individual seats in row 2, foldable, with longitudinal adjustment and backrest angle adjustment
- Seats: Passenger seat foldable
- Seats: Manual lumbar support, for driver's seat - 2-way
- 12-volt socket (3) in the trunk, rows 1 and 2
- Stop&Start system automatic
- Tie-down points in the trunk (4 pieces)
- Immobiliser

Extra equipment

- Alarm system including all-round, interior, towing protection and safe locking
- luggage compartment partition net
- Paint finish: Special metallic paint
- Panoramic tilt/slide sunroof with electric blind - blue LED lighting - exterior mirrors with projection of the PEUGEOT lion onto the ground
- Seats: Heated front seats
- tailgate sensor-controlled

- Detachable towbar with removable ball head, no tools required
- Package: Black Tone - 5008 and GT logo and "PEUGEOT" lettering in satin black - Roof rails in satin black - Front bumper in gloss black - Radiator grille in dark chrome - Loading sill protector in Perla Nera black - 19" two-tone Washington alloy wheels in black - Lion emblem front and rear in dark chrome - Trim inserts on the front fenders in gloss black - Trim strips on the lower part of the doors in black - Side window trim in black - Spare wheel well (not for Blue HDi 180 EAT8)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - rear right side	Door edge - Scratch(es) - Smart repair



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

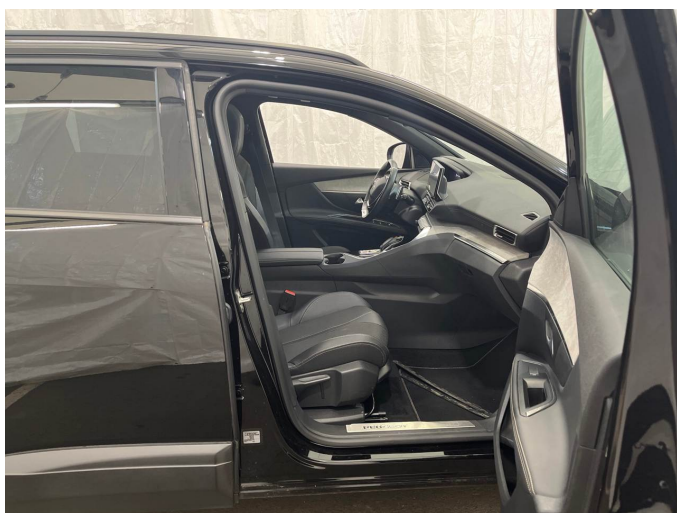


Figure 5: Interior - front

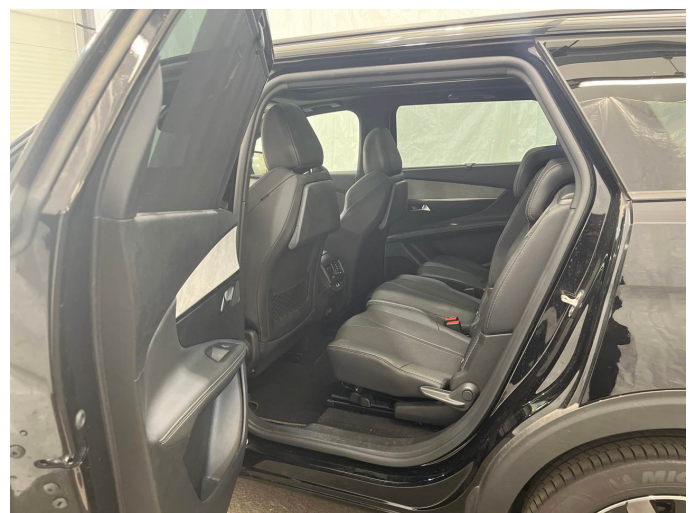


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

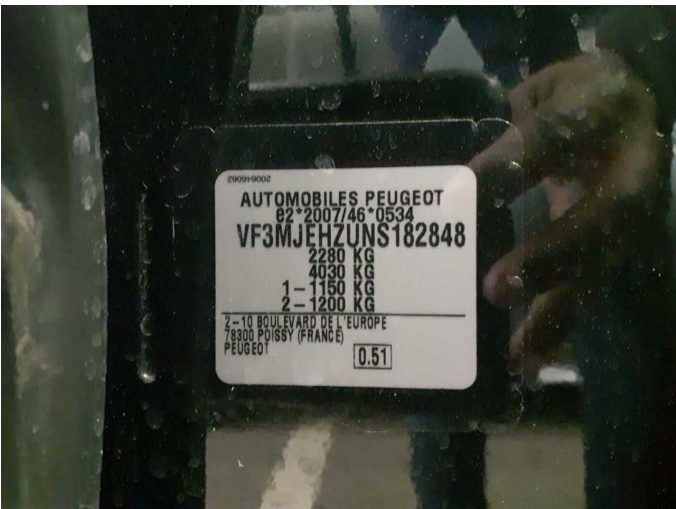


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

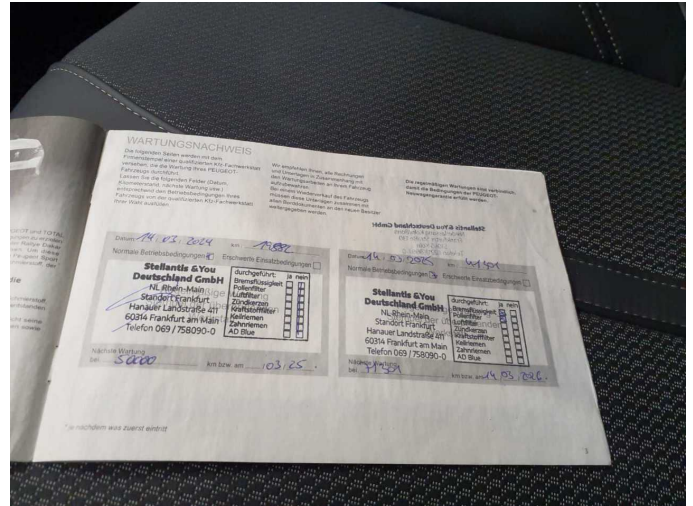


Figure 14: Documents



Figure 15: Documents

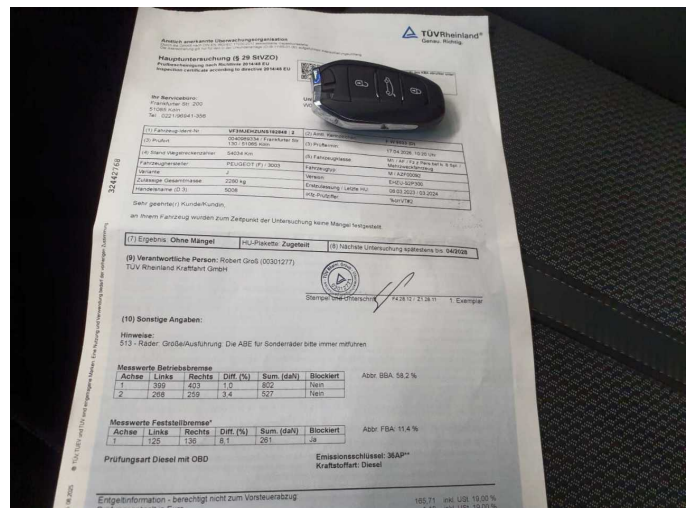


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.

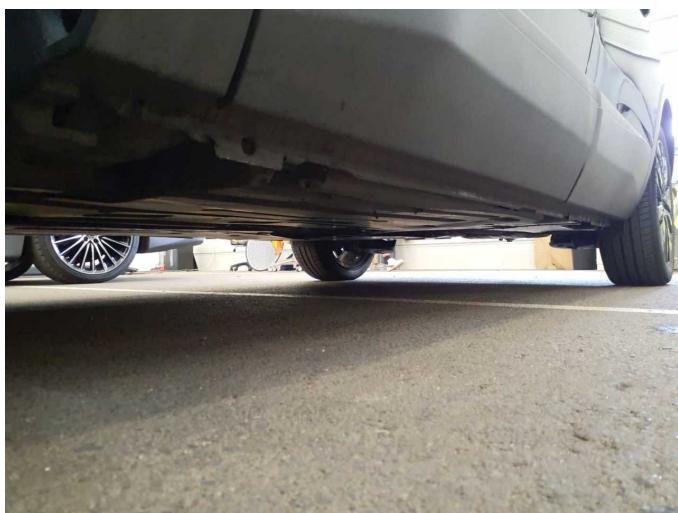


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

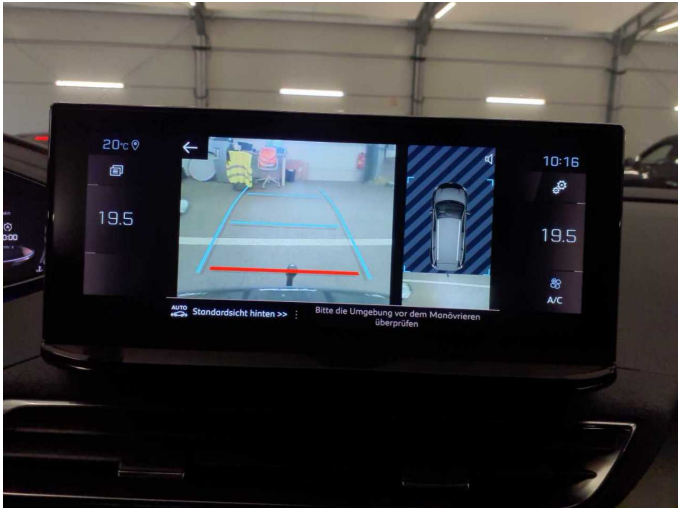


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

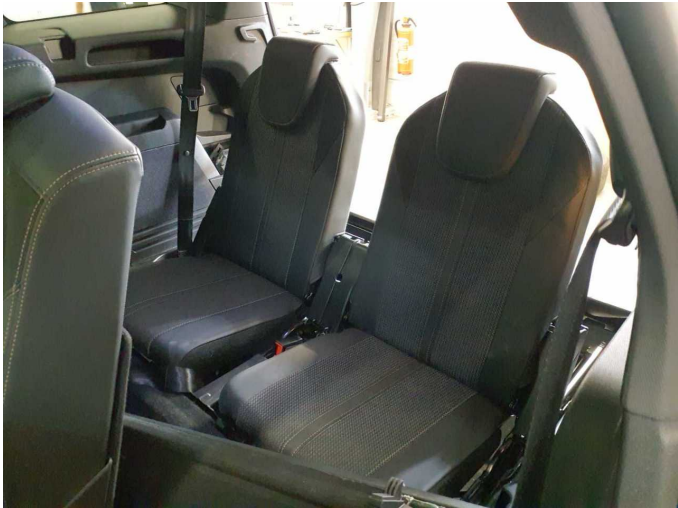


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Damage 1: Door - rear right side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - rear right side: Door edge - Scratch(es) - Smart repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MJEHZUNS182848

Hersteller / Modell: PEUGEOT PEUGEOT 5008 BlueHDi 130 EAT8 GT

Datum	KM-Stand	Beschreibung
20.04.2026	54.034	HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.06.2025	41.930	Bremsinspektion vo + hi; Bremsklötze hinten; Bremsklötze vorne
14.03.2025	41.301	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.03.2024	19.882	Bremse Sonstiges; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges