TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center
Aalen-Essingen
Margarete-Steiff-Str. 7
73457 Aalen-Essingen

Besichtigungsdatum:	20.10.2026
Protokollnummer:	**48288098**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Schittenhelm

VSSZZZKM2PR014813

Angaben zum Fahrzeug

Halter		**Besichtigungszustand**	ausreichend
Kennzeichen		**Laufleistung (abgelesen)**	48.346 km
Hersteller	CUPRA	**Restlauf bis Service**	19.100 km
Typ/Modell	FORMENTOR	**HU (Bericht lag vor)**	11/2027
Fahrgestellnummer	VSSZZZKM2PR014813	**Leistung**	228 kW
Hubraum	1.984 ccm	**Zylinder**	4
Erstzulassung	22.11.2022	**Polster/Farbe**	Stoff/Leder Kombination / Schwarz
Letzte Wartung	10/2026, 48.289 km	**Lackierung**	Grau
Kraftstoffart	Benzin	**Getriebe**	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung
1	Stossfänger vorn	Stossfänger vorn - Kratzer - Smart Repair

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung
Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.		

Fehlteile

Fehlteil

Festgestellte Nachlackierungen

Nr.	Ort
Keine feststellbar	

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	245/40 R19 94W	Bridgestone	Sommerreifen	4mm - 4mm	i.O.	i.O.
2	245/40 R19 94W	Bridgestone	Sommerreifen	4mm - 4mm	i.O.	i.O.

Ersatz

Typ	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Ablaufdatum
Notrad	125/70 R18 99M	Sonstige	Sommerreifen	5	

Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center
Aalen-Essingen
Margarete-Steiff-Str. 7
73457 Aalen-Essingen

Besichtigungsdatum:	20.10.2026
Protokollnummer:	**48288098**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Schittenhelm

Angaben zum Fahrzeug

Hersteller	CUPRA	**Besichtigungszustand**	ausreichend
Typ/Modell	FORMENTOR	**Laufleistung (abgelesen)**	48.346 km
Fahrgestellnummer	VSSZZZKM2PR014813	**Erstzulassung**	22.11.2022

Angaben zum Auftrag:
Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:
Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:
Die Besichtigungsbedingungen waren zur Beurteilung des Fahrzeuges ausreichend.

Allgemeinzustand:
Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Markus Böttcher)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center
Aalen-Essingen
Margarete-Steiff-Str. 7
73457 Aalen-Essingen

Besichtigungsdatum:	20.10.2026
Protokollnummer:	**48288098**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Schittenhelm

Übersichtsfotos



Abbildung 1: FIN


Abbildung 2: Schräg vorne


Abbildung 3: Schräg vorne


Abbildung 4: Schräg hinten


Abbildung 5: Schräg hinten


Abbildung 6: Montierte Bereifung

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
TÜV SÜD Service-Center
Aalen-Essingen
Margarete-Steiff-Str. 7
73457 Aalen-Essingen

Besichtigungsdatum:	20.10.2026
Protokollnummer:	**48288098**
Erstellt durch:	Markus Böttcher
Besichtigt durch:	Schittenhelm



Abbildung 7: Innenraum vorne



Abbildung 8: Laderaum



Abbildung 9: Kombiinstrument



Abbildung 10: Kombiinstrument



Abbildung 11: Instrumententafel



Abbildung 12: Instrumententafel


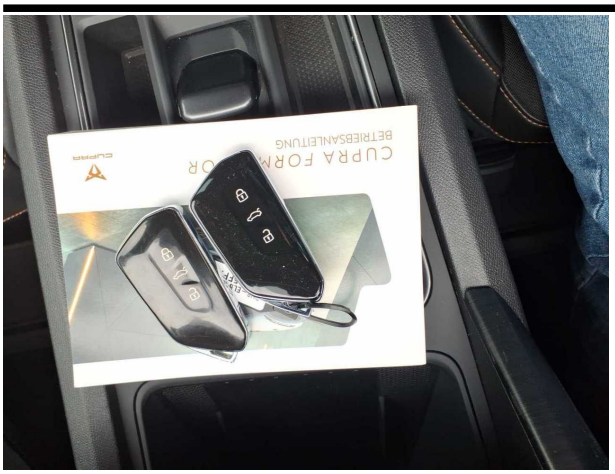


Abbildung 13: Dokumente



Abbildung 14: Sonstiges

Beschädigungsfotos

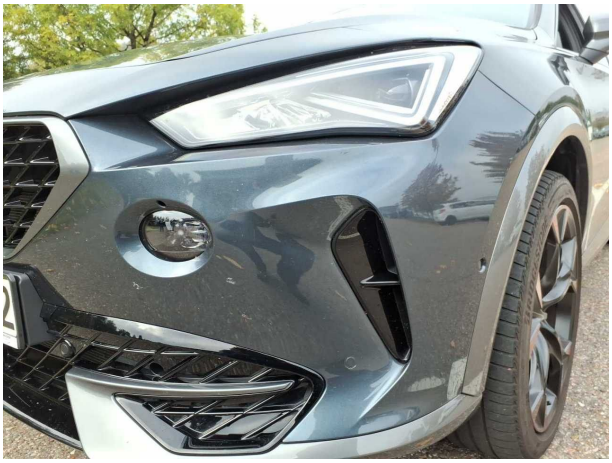

Beschädigung #1: Stossfänger vorn: Stossfänger vorn - Kratzer - Smart Repair



Beschädigung #1: Stossfänger vorn: Stossfänger vorn - Kratzer - Smart Repair

49. CO_2 emissions/fuel consumption/electric energy consumption:

1. All power trains except pure electric vehicles (if applicable):

NEDC values	CO_2 emissions			Fuel consumption [/100 km]		
	Petrol/Diesel g/km	LPG / CNG g/km	Others g/km	Petrol/Diesel [L]	LPG / CNG [L]/[m³]	Others [L]
Urban conditions	219	----	----	9.6	----	----
Extra-urban conditions	150	----	----	6.5	----	----
Combined	175	----	----	7.7	----	----
Weighted, combined	----	----	----	----	----	----

Deviation factor (if applicable): ---------

Verification factor (if applicable): -

2. Pure electric vehicles and OVC hybrid electric vehicles (if applicable)

Electric energy consumption (weighted, combined): [Wh/km] ------

Electric range: [km] ------

3. Vehicle fitted with eco-innovation(s): yes

3.1. General code of the eco-innovation(s): e9 29 37

3.2. Total CO_2 emissions savings due to the eco-innovation(s):

3.2.1. NEDC savings (if applicable)

Diesel / Petrol ----

LPG / NG [g/km] ----

Others [g/km] ----

3.2.2. WLTP savings (if applicable)

Diesel / Petrol 1.96

LPG / NG [g/km] ----

Others [g/km] ----

4. All power trains, except pure electric vehicles (if applicable)

WLTP values	CO_2 emissions			Fuel consumption: [/100 km]		
	Petrol/Diesel g/km	LPG / CNG g/km	Others g/km	Petrol/Diesel [L]	LPG / CNG [L]/[m³]	Others [L]
Low	281	----	----	12.4	----	----
Medium	189	----	----	8.4	----	----
High	166	----	----	7.3	----	----
Extra High	186	----	----	8.2	----	----
Combined	193	----	----	8.5	----	----
Weighted, combined	----	----	----	----	----	----

5.1. Pure electric vehicles (if applicable)

Electric energy consumption [Wh/km]: --------

Electric range [km]: -----

Electric range city [km]: -----

5.2. OVC hybrid electric vehicles (if applicable)

Electric energy consumption ($EC_{AC,weighted}$) [Wh/km]: --------

Electric range (EAER) [km]: -----

Electric range city (EAER city) [km]: -----

51. For special purpose vehicles:

Designation in accordance with Annex II, Section 5: ----------

52. Remarks:

NO 16.2.: with trailer axle 2:+20 kg##NO

35.: alt. to pos 35 with deviating val. in pos 49:##245/40 R19 94W#8,0JX19 ET40 ;##245/40 R19 98Y#8,0JX19 ET40;##225/50 R18 95W M+S#8,0JX18 ET40;##245/45 R18 96 W M+S#8,0JX18 ET40;##

EC Certificate of Conformity

046CC0136408

www.PS-Team.de

Complete vehicles

The undersigned hereby certify that the vehicle:

0.1.	Make (Trade name of manufacturer):	CUPRA
0.2.	Type:	KM
	Variant:	CXDNFBX1
	Version:	AD7CAD7GC0064BI1CAC
0.2.1.	Commercial name:	FORMENTOR
0.2.3.1.	Interpolation family's identifier:	IP-MQB37WZ_A0_0862-VSS-1
0.2.3.2.	ATCT family's identifier:	AT-5Q0_0V_0258_000-VSS-1
0.2.3.3.	PEMS family's identifier:	09-VSS-715W_KM_DNFB_AD7_A-000
0.2.3.4.	Roadload family's identifier:	RL-DQ381_7A_19_002-WVW-1
0.2.3.5.	Roadload matrix family's identifier (if applicable):	----------
0.2.3.6.	Periodic regeneration family's identifier:	PR-AU_00109_00_000-WVW-1
0.2.3.7.	Evaporative test family's identifier:	EV-A1_DGW_D_AYAAXX-WVW-1
0.4.	Vehicle category:	M1
0.5.	Company name and address of manufacturer:	SEAT, S.A. Autovía A-2, Km. 585 ES-08760 Martorell
0.6.	Location and method of attachment of the statutory plates:	On the right A-pillar, glued or bonded
	Location of the vehicle identification number:	In the engine compartment, right
0.10.	Vehicle identification number:	VSSZZZKM2PR014813
0.11.	Date of manufacture of the vehicle:	2022-09-17

conforms in all respects to the type described in approval e9*2007/46*4008*13 issued on 2022-05-27 and can be permanently registered in Member States having right hand traffic and using metric units for the speedometer and metric units for the odometer.

Martorell, 2022-09-17

Daniel Cortina Munuera
Director Quality Assurance

Martorell, 2022-09-17

Robin Christoph Bräutigam
Head of Technical Conformity

Internal Manufacturer Data

VSSZZZKM2PR014813

1.	Number of axles / wheels:	2 / 4
3.	Powered axles (number, position):	2 Axle 1/2
	Interconnection of powered axles:	cardan shaft
3.1.	Specify if the vehicle is non-automated/automated/fully automated:	non-automated
4.	Wheelbase[mm]:	2679
4.1.	Axle spacing [mm]:	2679
5.	Length [mm]:	4450
6.	Width [mm]:	1839
7.	Height [mm]:	1528
13.	Mass in running order [kg]:	1626
13.2.	Actual mass of the vehicle [kg]:	1686
16.	Technically permissible maximum masses:	
16.1.	Technically permissible maximum laden mass [kg]:	2140
16.2.	Technically permissible mass on each axle (1./2.) [kg]:	1110 / 1080
16.4.	Technically permissible maximum mass of the combination [kg]:	3940
18.	Technically permissible maximum towable mass in case of:	
18.1.	Drawbar trailer [kg]:	-----
18.3.	Centre-axle trailer [kg]:	1800
18.4.	Unbraked trailer [kg]:	750
19.	Technically permissible maximum static vertical mass at the coupling point [kg]:	80
20.	Manufacturer of the engine:	Audi AG
21.	Engine code as marked on the engine:	DNF
22.	Working principle:	Positive ignition / 4 stroke
23.	Pure electric:	no
23.1.	Class of Hybrid (electric) vehicle:	----------
24.	Number and arrangement of cylinders:	4; in Line
25.	Engine capacity [cm³]:	1984
26.	Fuel:	petrol
26.1.	Mono fuel/Bi fuel/Flex fuel/Dual fuel:	mono fuel vehicle
26.2.	Type of dual fuel engine:	----------
27.	Maximum power	
27.1.	Maximum net power [kW at min^{-1}] (internal combustion engine):	228.00 / 5450
27.2.	Maximum hourly output [kW] (electric motor):	-------
27.3.	Maximum net power [kW] (electric motor):	-------
27.4.	Maximum 30 minutes power [kW] (electric motor):	-------

28. Gearbox (type): automatic

Gear	-----	-----	-----	-----	-----	-----	-----	-----	-----
28.1. Gearbox ratios:	------	------	------	------	------	------	------	------	------
28.1.2. Final drive ratio:	------	------	------	------	------	------	------	------	------
Total gear ratios:	------	------	------	------	------	------	------	------	------

29.	Maximum speed [km/h]:	250
30.	Axle(s) track (1./2.) [mm]:	1585 / 1559
35.	Fitted tyre/wheel combination/energyefficiency class of RRC/type category used for CO_2 determination:	
	Axle 1:	245/40 R19 94W / 8,0JX19 ET40 / C / C1
	Axle 2:	245/40 R19 94W / 8,0JX19 ET40 / C / C1
36.	Trailer brake connections:	----------
38.	Code for bodywork:	AC
40.	Colour of vehicle:	GREY
41.	Number and configuration of doors:	5 / le. 2, ri. 2, ba. 1
42.	Number of seating positions (including the driver):	5
42.1.	Seat(s) designated for use only when the vehicle is stationary:	---
42.3.	Number of wheelchair user accessible position:	---
46.	Sound level	
	Stationary [dB(A) at min^{-1}]:	81.00 / 3750
	Drive-by [dB(A)]:	70.00
47.	Exhaust emission level:	EURO 6 AP
47.1.	Parameters for emission testing of Vind:	
47.1.1.	Test mass [kg]:	1765
47.1.2.	Frontal area [m²]:	---------

47.1.3. Road load coefficients

47.1.3.0. f0 [N]	47.1.3.1. f1 [N/(km/h)]	47.1.3.2. f2: [N/(km/h)²]
186.562171	0.115000	0.041114

47.2.	Driving cycle:	
47.2.1.	Driving cycle class:	3b
47.2.2.	Downscaling factor (f_{dsc}):	-----
47.2.3.	Capped speed:	no
48.	Exhaust emissions:	715/2007*2018/1832AP

1.2. Test procedure: Type 1 (NEDC average values, WLTP highest values) [mg/km] or WHSC (EURO VI)

Petrol / Diesel	CO	THC	NMHC	NO_x	THC + NO_x	NH_3	Particles	Particles #
	398.3	36.3	30.6	11.9	--------	--------	0.2100	0.18E11
LPG/CNG	--------	--------	--------	--------	--------	--------	--------	--
Other	--------	--------	--------	--------	--------	--------	--------	--

2.2. Test procedure: WHTC (EURO VI) [mg/kWh]

Petrol / Diesel	CO	THC	NMHC	CH_4	NO_x	NH_3	Particles	Particles #
	--------	--------	--------	--------	--------	--------	--------	--
LPG/CNG	--------	--------	--------	--------	--------	--------	--------	--
Other	--------	--------	--------	--------	--------	--------	--------	--

48.1.	Smoke corrected absorption coefficient [m^{-1}]:		--------
48.2.	Declared maximum RDE values (if	NO_x [mg/km]	Particles (number) with exponent (#/km)
	Complete RDE trip:	60.0	6.00 E11
	Urban RDE trip:	60.0	6.00 E11