



Expertise

Protocol number: 46466053
Order No. / Reference: 26603398
Inspection date: 13 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N1673541A607956

Model: GLE-Coupe 350 e 4Matic 9G-TRONIC AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLE-Coupe 350 e 4Matic 9G-TRONIC AMG Line	
Vehicle Identification number	W1N1673541A607956
Mileage (Read)	173,559 km
First registration	27 Jan 2022
Number of holders	2
Next periodical technical inspection	01/2027
(Report on hand)	
Power / Engine displacement	155 kw / 1,991 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Iridiumsilber metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	136 Tag(e)
Last service on / at	11/2025 at 157,145 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF764071
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / BAO 00069		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,210 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113W	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	275/50 R20 113W	Summer tyres on Light alloy	Continental	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113V	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	275/50 R20 113V	Winter tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Exhaust system with 2 chrome-plated tailpipe trims
- Storage compartment in center console
- Adaptive Highbeam Assist Plus
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- 4MATIC permanent all-wheel drive
- AMG floor mats in black velour with "AMG" lettering
- AMG sports pedal assembly made of brushed stainless steel with black rubber studs
- Foldable armrest for driver and front passenger
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Cup holder
- Tachometer
- EASY-Pack tailgate with electric operation for opening and closing
- Electronic Stability Program
- Electronic traction system for all-wheel drive (4ETS)
- Vehicle Setup
- electric parking brake
- Transmission: 9G-TRONIC
- Rear window heated
- Instrument panel upper section in ARTICO man-made leather
- Climate: THERMATIC automatic climate control
- Headrests 5-way
- Radiator grille with 2 chrome-plated louvers in SUV design
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for navigation services
- Otto particulate filter
- Package: Chrome Interior Package
- Package: Public Charging
- PRE-SAFE system
- Radio accessories: 2 USB ports
- Radio accessories: Additional USB ports
- Remote Services Plus
- Power steering
- Seats: 4-way lumbar support for driver
- Seats: Heated seats for driver and front passenger seats
- Seats: Sports seats for driver and front passenger with specific seat graphics
- Phone accessories: Smartphone integration
- Cruise control with variable speed limiter
- Immobiliser
- Heat-insulating glass, all around
- Decorative elements: Brushed aluminum with light longitudinal grain
- Storage compartment in the doors
- ADAPTIVE BRAKE
- Adaptive brake light
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Acoustic environmental protection
- Ambient lighting
- AMG side skirts painted in body color
- Anti-lock braking system
- Traction control (ASR)
- Rear armrest
- Automatic passenger airbag deactivation
- Brake Assist BAS
- Downhill Speed Regulation (DSR)
- Third brake light
- ECO start/stop function
- Front door sills with "Mercedes-Benz" lettering illuminated in white
- Chassis with steel springs and lowered suspension
- Electric windows, front and rear
- Speed Limit Assistant
- Lockable, air-conditioned and illuminated glove compartment
- KEYLESS-GO start function
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- Charging cable for household socket, 5m, smooth
- Foldable cargo cover with magnetic locking mechanism
- Charging system: AC on-board charger 7.4 kW
- Steering column mechanically adjustable lengthwise and heightwise.
- MULTIBEAM LED
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Chrome
- Package: Parking package with reversing camera
- Package: Mirror Package
- Radio: MBUX multimedia system
- Radio accessories: Digital radio (DAB)
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: i-Size child seat attachment on the outer rear seats
- Seats: Rear seat backrests foldable
- 12V sockets
- Phone accessories: Wireless charging system for mobile devices
- High-visibility vest for drivers
- Widescreen Cockpit
- Central locking with interior switch

Extra equipment

- Brake system with larger brake discs on the front axle
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Heat-insulating dark tinted glass
- Heated windshield washer system (including washer fluid reservoir, washer nozzles and washer fluid hoses)
- Illuminated running boards in aluminum look with rubber studs
- Package: AMG Line Exterior (diamond grille with chrome pins, integrated Mercedes star and one louvre painted in matte iridium silver with chrome inserts - AMG Styling: AMG front apron with chrome trim strip, sporty and distinctive air intakes in the wheel arch trims, fender flares front and rear in body paint, AMG side sill trims, AMG rear apron with diffuser-look insert in black and chrome trim strip - AMG light-alloy wheels in 5-twin-spoke design, painted tremolite grey and polished with front axle 275/50 R 20 on 9 J x 20 ET 57, rear axle 275/50 R 20 on 9 J x 20 ET 44)
- Package: KEYLESS-GO Comfort Package (vehicle key with KEYLESS-GO functionality - KEYLESS-GO access and drive authorization system - start/stop button - comfort opening and closing - door handles with chrome inlay - HANDS-FREE ACCESS - handle recess lighting - remote trunk lid closing - EASY-PACK tailgate)
- Package: Memory Package in conjunction with leather upholstery (driver and front passenger seats, steering column and exterior mirrors electrically adjustable and storable - seat longitudinal position and headrest height additionally electrically adjustable - 4-way lumbar support for driver and front passenger - seat cushion depth adjustment with gapless cushion - PRE-SAFE positioning function for the front passenger seat - front passenger seat controls for driver)
- Radio accessories: Burmester surround sound system (with 13 speakers and 590 watts system power. Experience enhanced performance and exclusivity with legendary Burmester sound. The high-performance speakers create a first-class surround sound experience. This can be specifically optimized for the front and rear seats, intensifying the listening experience. A quality that is also visible thanks to the high-quality Burmester logos.)
- Seats: Seat climate control for driver and front passenger (seat heating and seat ventilation - for ideal comfort all year round)
- Towbar with ESP trailer stabilization
- Upholstery: Nappa leather (for AMG Line interior)
- 230V power outlet in the rear
- Black fabric headliner
- Package: AIRMATIC package (air suspension system with adaptive damping system ADS+ - automatic level control, depending on - payload: load detection for a constant chassis level - driving speed: lowering for higher driving speeds - DYNAMIC SELECT driving program: lowering in the "Sport"/"Sport plus" program or raising in the "Offroad"/"Offroad plus" program - demand-based level control: - rear lowering for loading and unloading - individual selection of the chassis level)
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart, Route-Based Speed Adaptation with Traffic Jam Definition, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist with SOS Radio, Emergency Lane Radio, Active Brake Assist, Turn and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Radio, PRE-SAFE PLUS Pedestrian Warning Function, Traffic Sign Assist, Active Traffic Jam Assist, PRE-SAFE Impulse Side)
- Package: Parking Package with 360° camera (12 sensors: four front, four rear, two on the sides in the front/rear bumper; detects parking spaces up to 35 km/h; steering control; in conjunction with automatic transmission, assists with acceleration, braking, and gear changes; 360° camera; visual/audible warning of detected obstacles in front of/behind the vehicle up to approx. 10 km/h; Rear Cross Traffic Alert warns of detected cross traffic; Drive Away Assist (only in conjunction with automatic transmission); button on the center console or on the control panel for the assistance systems)
- Paint finish: Metallic
- Partition net for luggage compartment separation and occupant protection
- Roof rack for roof-mounted accessories, including storage bag (roof boxes, bicycle or ski carriers - the base carrier can be combined with a wide variety of Mercedes-Benz roof-mounted accessories. It is precisely matched to the body and offers the best possible safety and aerodynamics.)
- Seats: Heated rear seats
- Steering wheel: Steering wheel heating
- Wheel lock set (for alloy wheels, with 4 wheel locks and 1 key)
- Wheels: 50.8 cm (20") AMG light-alloy wheels in 5-twin-spoke design (tremolite grey painted and high-sheen finish with front axle 275/50 R 20 on 9.0 J x 20 ET 57, rear axle 275/50 R 20 on 9.0 J x 20 ET 44)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door - Scratched - Paint
2	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 18 Sept 2023	2.121,10 €
2	Side right, Provided by user / customer, from 24 Aug 2024	5.198,52 €
3	Roof, Rear, Side - left, Side right, Professionally repaired, Invoice of repair done Non-existent	

Repainting

No.	Repainting
1	Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	189 µm	Boot lid / rear door	238 µm
Mudguard - left side	203 µm	Bonnet	333 µm
Side panel - rear left side	211 µm	Side panel - rear right side	263 µm
Door - rear left side	203 µm	Door - rear right side	237 µm
Door - front left side	176 µm	Door - front right side	190 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

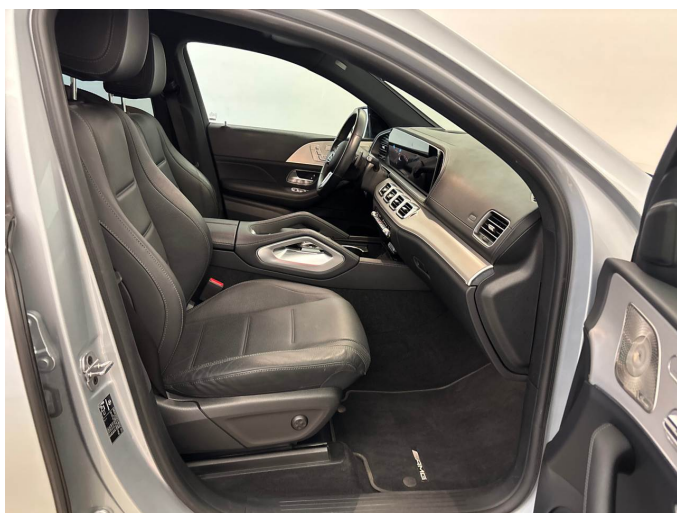


Figure 5: Interior - front

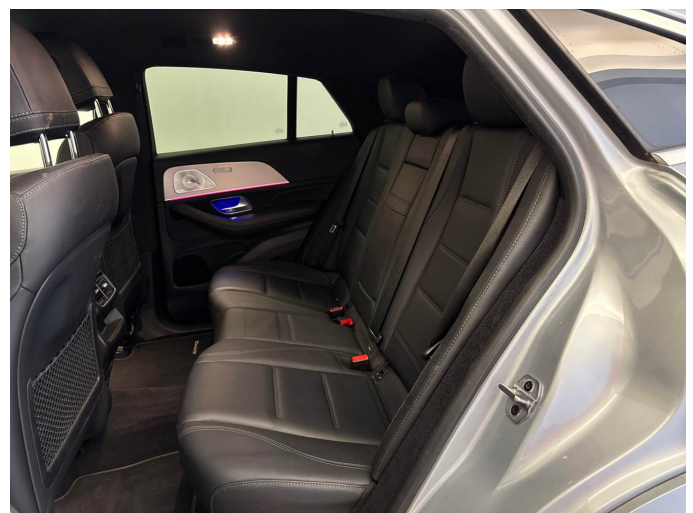


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

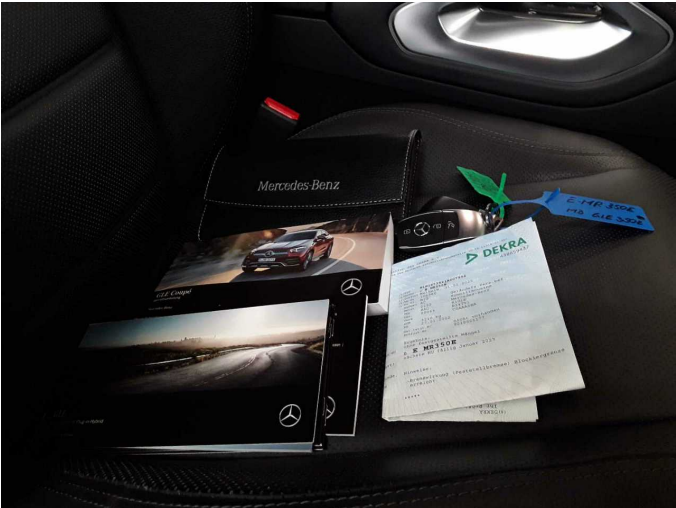


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

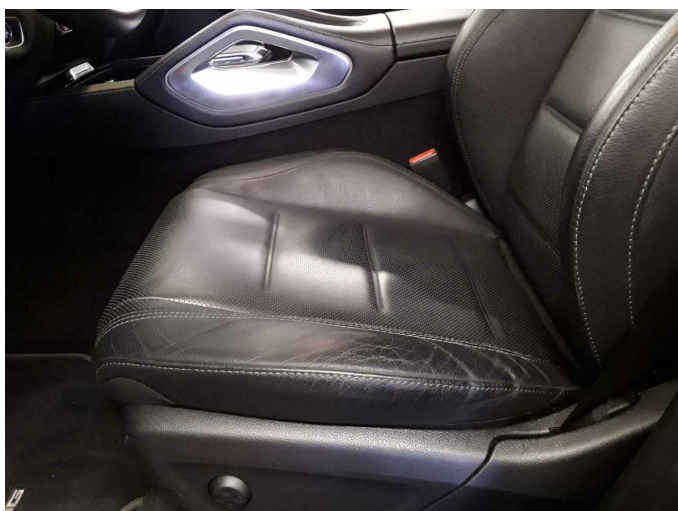


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

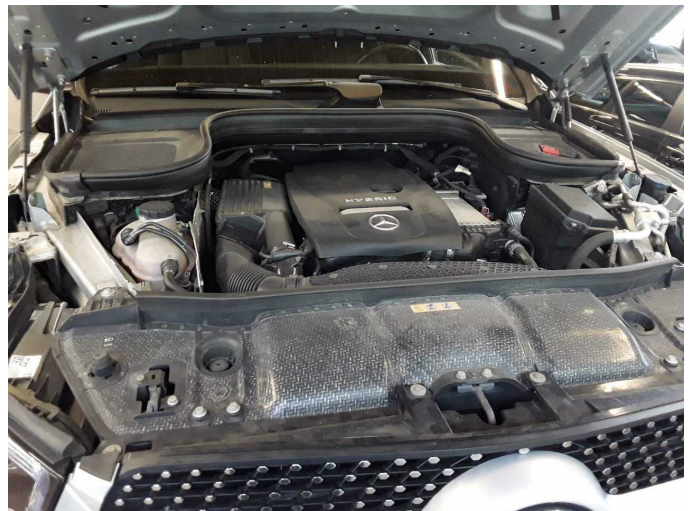


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.

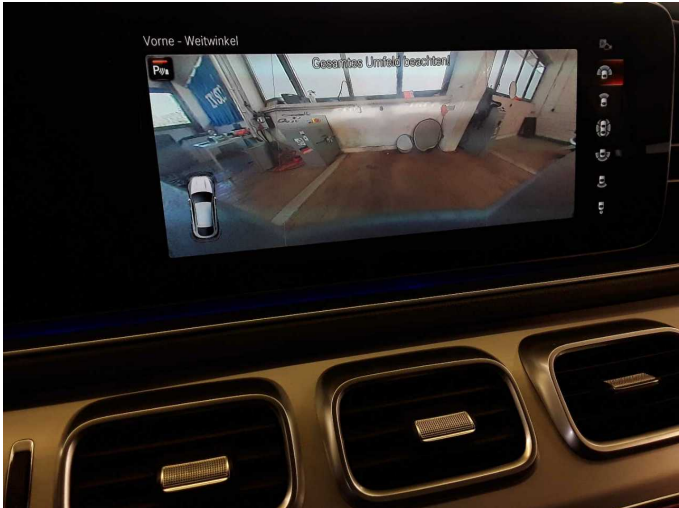


Figure 38: Misc.

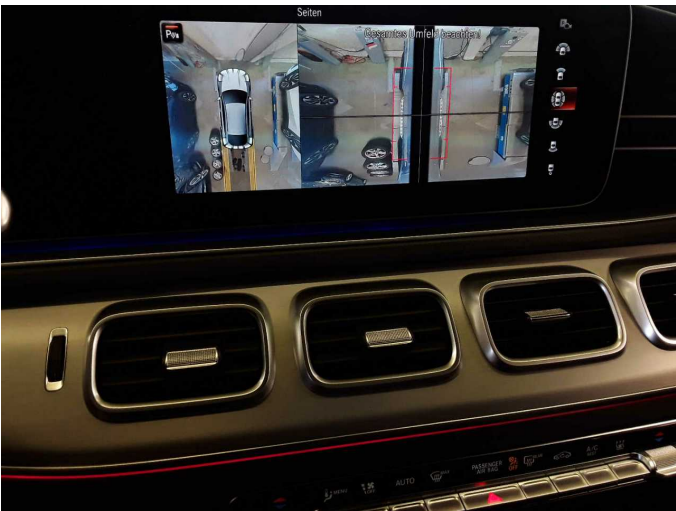


Figure 39: Misc.

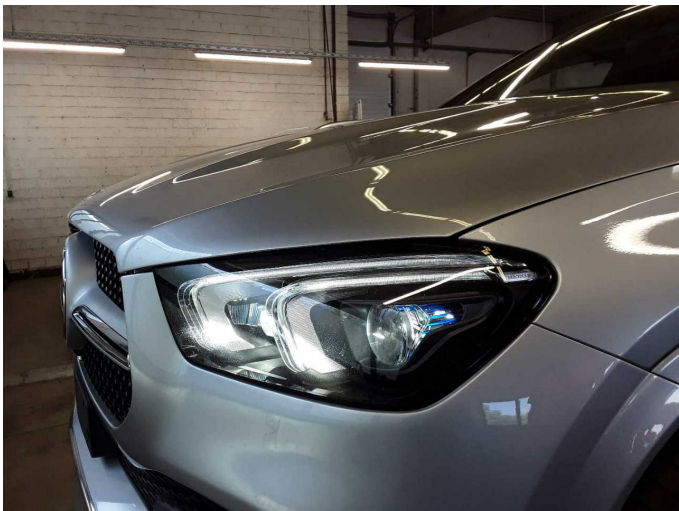


Figure 40: Misc.




Damage 1: Door - front left side: Door - Scratched - Paint



Damage 1: Door - front left side: Door - Scratched - Paint




Damage 1: Door - front left side: Door - Scratched - Paint

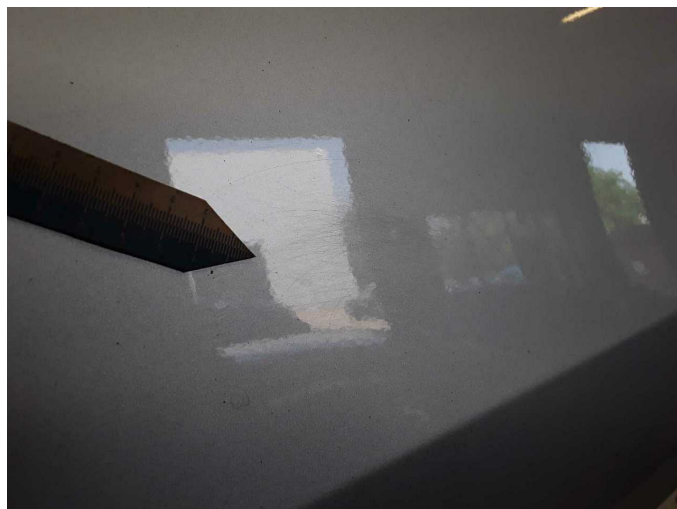

Damage 1: Door - front left side: Door - Scratched - Paint



Damage 2: Vehicle glazing: Windscreen - Stone chips - Replace

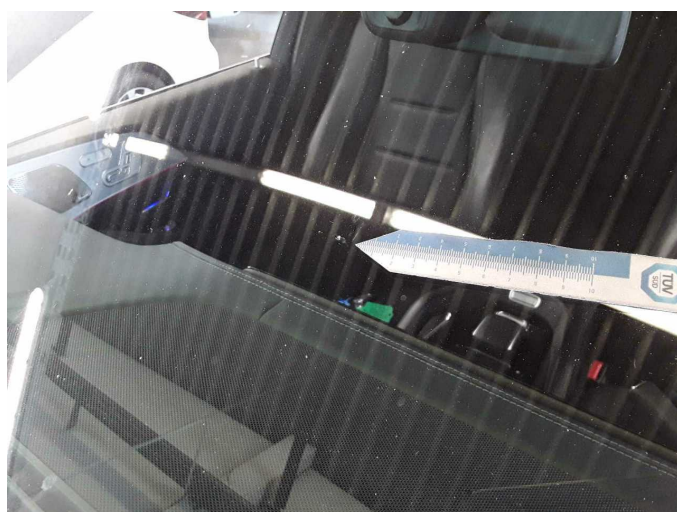

Damage 2: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 2: Vehicle glazing: Windscreen - Stone chips - Replace



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Roof, Boot lid / rear door, Mudguard - left side, Bonnet, Side panel - rear left side, Side panel - rear right side, Door - rear left side, Door - rear right side, Door - front left side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N1673541A607956

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLE-Coupe 350 e 4Matic
9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
11.11.2025	157.145	Regelwartungsdienst
12.09.2025	146.263	Reparatur Sonstiges; Systemtest/Eigendiagnose
30.07.2025	140.076	Kompression prüfen; Reparatur Sonstiges; Systemtest/Eigendiagnose; Zündkerzen ern
02.07.2025	135.552	Systemtest/Eigendiagnose; Zündkerzen ern
16.05.2025	128.986	Regelwartungsdienst
31.01.2025	106.980	AU
19.12.2024	102.535	Bremsscheiben vorne; Regelwartungsdienst
29.05.2024	75.765	Regelwartungsdienst
05.10.2023	51.889	Regelwartungsdienst
27.01.2023	23.479	Regelwartungsdienst