



PEUGEOT 3008: FZ-900-FH

Vinnumber:	VF3M45GFUMS070338	Versionname:	PEUGEOT 3008 PureTech 180 S&S EAT8 GT VP [5P] bva 8-181CH-10cv (SUV)
First Registrationdate:	12/05/2021	Fiscalpower:	
Expertise Mileage:	119847	Power Kw:	133
Bodytype:	SUV	Body colour:	Grey
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
GPS storage		Headlights Xenon/LED/Laser	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Rear view camera	
Cruise Control		Seat cover lining	Lining Leather
Steering wheel multifunctional			Lining Alcantara
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres

	225/55/18/98 V			
Summer tyres:	Fr.L.	Continental: 55%	Fr.R.	Continental: 55%
	Re.L.	Continental: 60%	Re.R.	Continental: 70%
Tyre profile depth FL				4.5
Tyre profile depth FR				4.7
Tyre profile depth RL				4.3
Tyre profile depth RR				3.8
Tyre size FL				225/55 R 18 98 V
Tyre size FR				225/55 R 18 98 V
Tyre size RL				225/55 R 18 98 V
Tyre size RR				225/55 R 18 98 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Seat cover FL, Tear, Repair/replace (lump sum)			




Tyre RR, Out of tolerance, Replace



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)

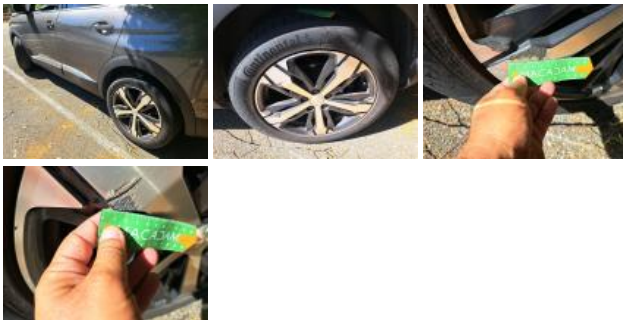

Tyre RL, Flat, Replace



Windscreen, Stone chip(s), Windscreen repair



Bumper moulding FL, Unclamped, Dismount/Mount



Bumper F, Scratch(es), Paint



Door RR, Rust, Paint



Historique Maintenance

Immatriculation: FZ-900-FH Date de 1ère immatriculation: 12/05/2021

Modèle: Peugeot 3008 PureTech 180 S&S EAT8 GT VP [5P] bva 8-181CH-10cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
20/04/2026	113.955	FLEET SOLUTIONS FRANCE	PERMUTATIONS PNEUS
	0		PERMUTATIONS PNEUS
	0		PERMUTATIONS PNEUS
	0		PERMUTATIONS PNEUS
24/11/2025	106.180	FLEET SOLUTIONS FRANCE	PERMUTATIONS PNEUS
	0		GARDIENNAGE
05/08/2025	98.316	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
18/07/2025	98.195	GARAGE BENJAMIN MICOUD	BOITIER D ALLUMAGE RPLT
	0		REVISION
	0		LIQUIDE DE FREIN
	0		FILTRE CLIM RPLT
	0		DIVERS CLIM
	0		RECYCLAGE
26/05/2025	93.592	FLEET SOLUTIONS FRANCE	GARDIENNAGE
	0		PERMUTATIONS PNEUS
19/12/2024	82.403	FLEET SOLUTIONS FRANCE	PERMUTATIONS PNEUS
	0		GARDIENNAGE
18/12/2024	82.333	GARAGE BENJAMIN MICOUD	RECYCLAGE
	0		DISQUES PLAQUETTES AV RPLT
	0		DIVERS FREIN
	0		REVISION
	0		BALAIS ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
19/04/2024	67.017	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS ETE
19/04/2024	67.017	FLEET SOLUTIONS FRANCE	GARDIENNAGE
05/12/2023	57.702	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS HIVER
18/09/2023	53.588	GARAGE BENJAMIN MICOUD	LIQUIDE DE FREIN
	0		FILTRE A AIR RPLT
	0		FILTRE CLIM RPLT
	0		BALAIS ESSUIE GLACE AV
	0		BOITIER D ALLUMAGE RPLT
	0		RECYCLAGE

Historique Maintenance

Immatriculation: **FZ-900-FH**

Date de 1ère immatriculation: **12/05/2021**

Modèle: **Peugeot 3008 PureTech 180 S&S EAT8 GT VP [5P] bva 8-181CH-10cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
	0		REVISION
19/07/2022	30.189	GARAGE BENJAMIN MICOUD	ADBLUE
	0		BALAIS ESSUIE GLACE AV
	0		REVISION