



BMW 3 TOURING			
Vinnumber:	WBA71DZ090FN24179	Versionname:	BMW 3 TOURING (G21) 318iA (115 kW) 156PK 5d/p AUT (7ADZ)
First Registrationdate:	6/07/2022	Fiscalpower:	
Expertise Mileage:	69727	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	2513
Fueltype:	Petrol		
Maintenance	OK		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		


Options			
Number of keys total	1	Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		
Adaptive cruise control			
Type of GPS storage	HD		

Limited Technical Inspection

Tyres

225/50/17/98 V			
Winter tyres:	Fr.L.	Pirelli: 7 mm	Fr.R.
	Re.L.	Pirelli: 7 mm	Re.R.
Tyre profile depth FL			7.0
Tyre profile depth FR			7.0
Tyre profile depth RL			7.0
Tyre profile depth RR			7.0
Tyre size FL			225/50 R 17 98 V
Tyre size FR			225/50 R 17 98 V
Tyre size RL			225/50 R 17 98 V
Tyre size RR			225/50 R 17 98 V
Tyre type FL			Winter
Tyre type FR			Winter
Tyre type RL			Winter
Tyre type RR			Winter
Tyre make FL			264
Tyre make FR			264
Tyre make RL			264
Tyre make RR			264

Assistance equipment			
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		
Total cost ex VAT			1397,14
Ignition key, Missing, Replace			350,09

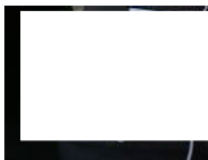

Seat cover FL, Stain, Cleaning	29,16
--------------------------------	-------



Bumper F, Scratch(es), Acceptable	0,00
-----------------------------------	------



Central pillar L, Dent(s) and scratch(es), Acceptable	0,00
---	------



Alloy rim FL, Scratch(es), Repair and paint (complete)	133,03
--	--------



Door FL, Dent(s) and scratch(es), Acceptable	0,00
--	------



Wing RL, Scratch(es), Acceptable	0,00
----------------------------------	------



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)	296,58
--	--------



Bumper moulding R, Broken, Replace

142,49



Alloy rim RR, Scratch(es), Acceptable

0,00



Door RR, Dent(s) and scratch(es), Repair and paint (complete)

445,79



Alloy rim FR, Scratch(es), Acceptable

0,00



Door FR, Scratch(es), Acceptable

0,00

