



Expertise

Protocol number: 46014102
Order No. / Reference: 26478683
Inspection date: 16 Jun 2026

Manufacturer: Volvo	Model: XC90 B5 B AWD Plus Bright
VIN: YV1LFM1V7S1391278	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 B5 B AWD Plus Bright	
Vehicle Identification number	YV1LFM1V7S1391278
Mileage (Read)	14,319 km
First registration	30 Apr 2025
Number of holders	1
Next periodical technical inspection	04/2028
(Report not on hand)	
Power / Engine displacement	184 kw / 1,969 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Black Metallic
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	0 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HJ988230
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BRA 00067		
Emission standard	EURO6;WLTP;EB;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	2,790 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/45 R20 110V	Winter tyres on Light alloy	Pirelli	7mm / 7mm
2)	275/45 R20 110V	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/40 R21 107V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	275/40 R21 107V	Summer tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Front passenger airbag can be deactivated
- Active safety belts with belt tensioners
- All-wheel drive (AWD) (via electronically controlled multi-plate clutch (5th generation) with Instant Traction)
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Illuminated door pockets and door handles front and rear - Ambient lighting on the front and rear doors - Door sills with illuminated Volvo lettering - Exit lights in the rear doors - Ambient lighting on the dashboard - Rear footwell lighting - Work light on the tailgate)
- Dashboard and door trim in leather look with contrasting stitching
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Outdoor temperature display
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- Brake energy recuperation
- Chrome applications on the rear of the vehicle
- Roof edge spoiler
- Digital Services (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, alerting the Volvo On Call service center at the touch of a button as well as additional convenience services via the Volvo CarsApp, such as locking and unlocking the vehicle, displaying the vehicle position and digital manual))
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles including steering intervention if warning signals are ignored - Cross Traffic Alert (CTA) - Cross traffic warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Electric windows front and rear (with auto-down and auto-up function)
- Bottle holder in the luggage compartment
- Front grille in Volvo Iron Mark Bright design
- Luggage compartment partition net
- Seat belt height adjustment front and rear (2nd row of seats)
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and floor lights)
- Comfort opening/closing of the side windows via radio remote control
- Headrests of the 2nd row of seats can be folded down (electrically)
- Front headrests
- Stainless steel loading sill protector in the luggage compartment
- Airbags (airbags for driver and front passenger with two-stage deployment system - knee airbag for driver - side airbags for driver and front passenger - head/shoulder airbags for all occupants)
- Android infotainment system (11.2" touchscreen (28.5cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad))
- Anti-lock braking system (ABS)
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Electrically adjustable exterior mirrors
- Exterior mirror caps in car color
- Attachment system for carrier bags in the luggage compartment
- Fog sensor for automatic activation of the defroster function
- On-board computer (with vehicle control functions)
- third brake light
- Chrome trim strip in the door sill area
- Aluminum roof rails (integrated)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Assistance (Emergency Stop Assist (automatic emergency stopping system in case of failure to heed warnings due to lack of steering, braking and acceleration activity by the driver, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h) - Adaptive cruise control)
- Front and rear parking sensors with automatic braking intervention (rear)
- Electronic differential lock
- Electronic stability control
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Chrome window surround
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Transmission: 8-speed automatic transmission
- Automatic tailgate (electric)
- Rear window wiper with intermittent function
- Intelligent Speed Assist (Intelligent speed assistant - warning when exceeding the maximum permitted speed)
- ISOFIX mounting for the outer rear seats
- Keyless Start (electronic engine start system)
- Child safety lock (manual for the rear doors)
- Automatic climate control with separate temperature control for driver and front passenger (and additional air vents for the 2nd row of seats including pre-ventilation and reheating of the interior when the engine is switched off via menu)
- Charging box under the cargo floor



- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Air purification system with multi-filter
- Front center armrest with integrated storage compartment and cup holders
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- Electric parking brake
- Upholstery: Nordico vinyl/imitation leather (incl. rear center armrest (2nd row of seats))
- Radio accessories: Smartphone integration Apple CarPlay
- Radio accessories: Subwoofer
- Rain sensor with automatic light function
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Safety Assistance (only with HUP) (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic; Connected Safety; Distance warning; Driver Alert; Variable speed limiter; Cruise control; Lane Keeping Aid (LKA); Oncoming Lane Mitigation; Ready to Drive notification; Road Edge Detection; Road Sign Information (RSI); Run-off Road Protection)
- Seats: Child seat integrated in the middle rear seat (2nd row).
- Seats: Memory function for passenger seat
- Start/Stop technology
- Phone: Inductive smartphone charging system (Qi standard)
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- WHIPS whiplash protection system

Extra equipment

- Paint finish: Metallic paint

- Cargo area roller blind (semi-automatic)
- LED headlight matrix "Thor's Hammer" (high beam assist and integrated LED daytime running lights - cornering lights - welcome sequence)
- Illuminated makeup mirror for driver and front passenger
- Model emblem on the rear of the vehicle
- Engine emblem on the rear of the vehicle
- Otto particulate filter
- Package: Winter (Rear seat heating (outer seats of the 2nd row) - Steering wheel heating)
- Pollen filter
- Radio: Premium Sound audio system by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Radio accessories: Two USB-C ports on the back of the center console
- Wheels: 21" 5-multi-spoke alloy wheels, diamond cut/high-gloss black (tires 275/40 R21 with rims 9.0 x 21")
- Rear view camera
- Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable (incl. individual backrest angle adjustment)
- Gearshift lever made of Swedish crystal glass by Orrefors
- Headlight cleaning system
- Speed-sensitive power steering
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Adjustable leg rest for driver and passenger seats
- Seats: Third row of seats (7-seater)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Seats: Heated front seats
- Power socket
- Textile floor mats for the 3rd row of seats
- Textile floor mats front and rear
- Glazing: Colored glazing
- Volvo On Call
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Central locking system with two remote controls and integrated emergency key

- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
2	Misc.	Inspection / maintenance - Due - Perform
3	Door - rear right side	Door - Scratch(es) - Paint
4	Door - front right side	Door - Scratch(es) - Paint
5	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - repair according to calculation

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 3 Dec 2025	6.772,05 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	193 µm	Door - rear left side	182 µm
-----------------------------	--------	-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

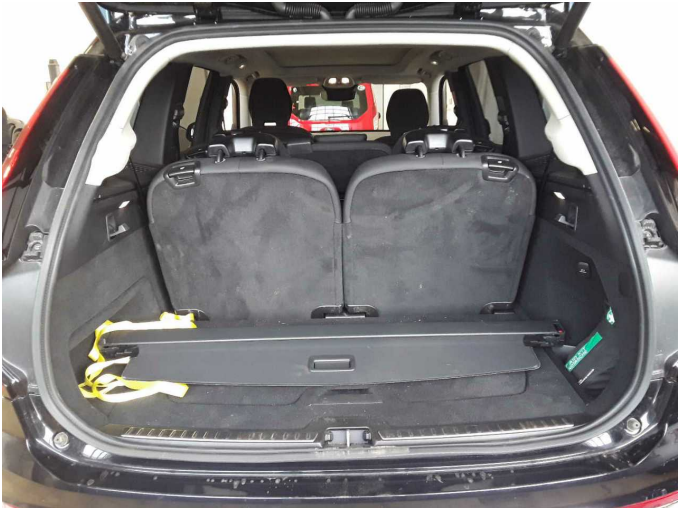


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

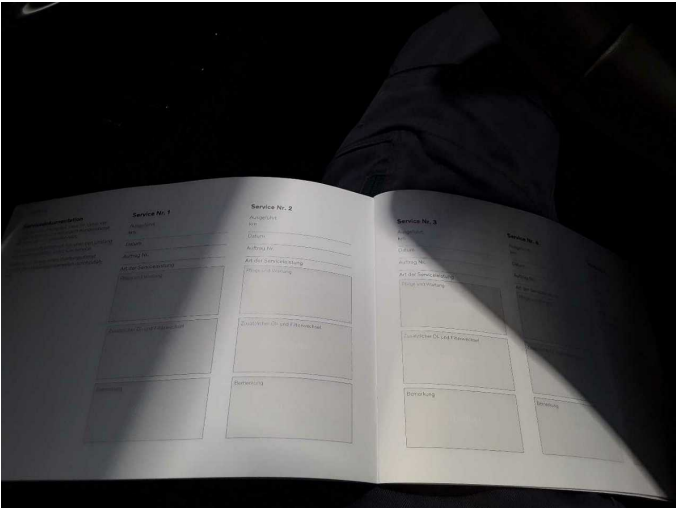


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

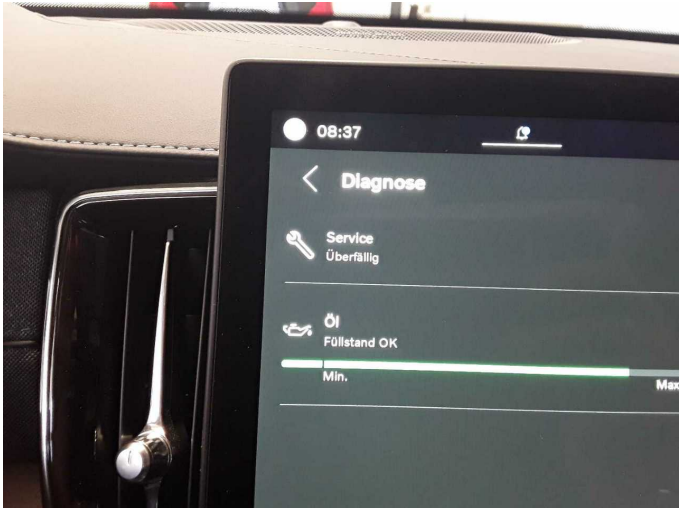


Figure 16: Documents



Figure 17: Additional tyres

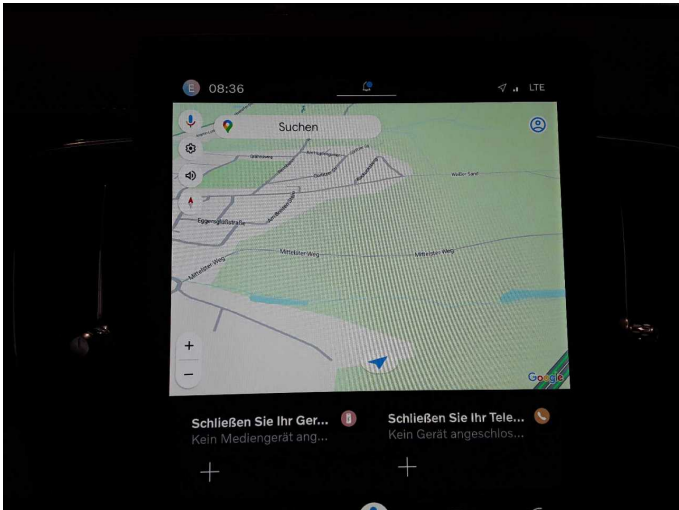


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Damage 1: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 1: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value

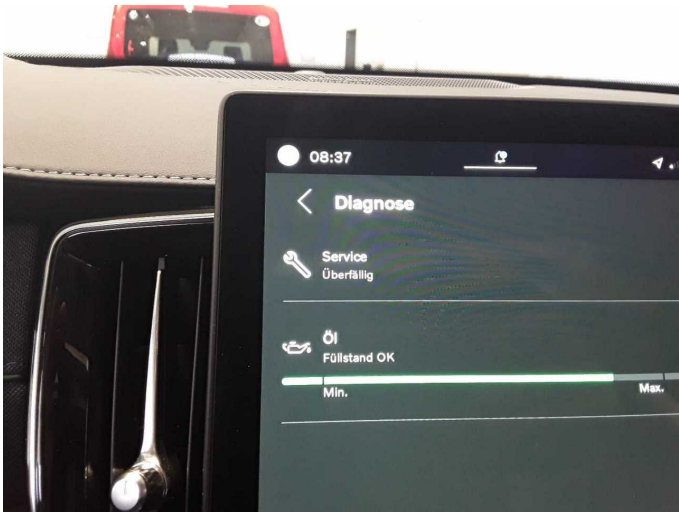

Damage 2: Misc.: Inspection / maintenance - Due - Perform



Damage 3: Door - rear right side: Door - Scratch(es) - Paint

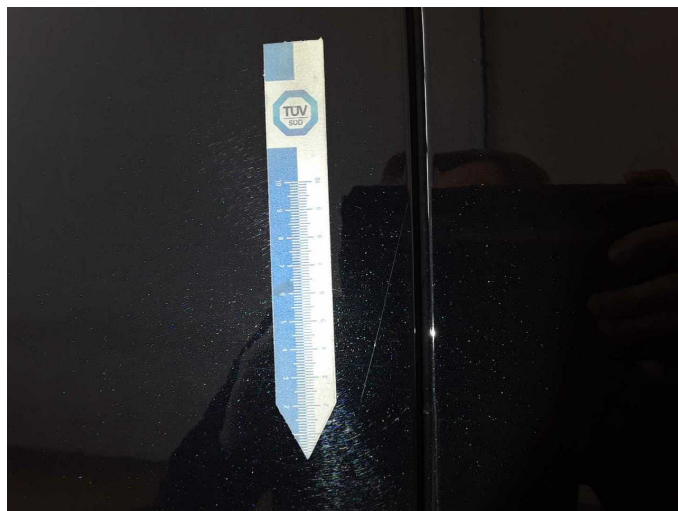

Damage 3: Door - rear right side: Door - Scratch(es) - Paint




Damage 4: Door - front right side: Door - Scratch(es) - Paint



Damage 4: Door - front right side: Door - Scratch(es) - Paint



Damage 5: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - repair according to calculation

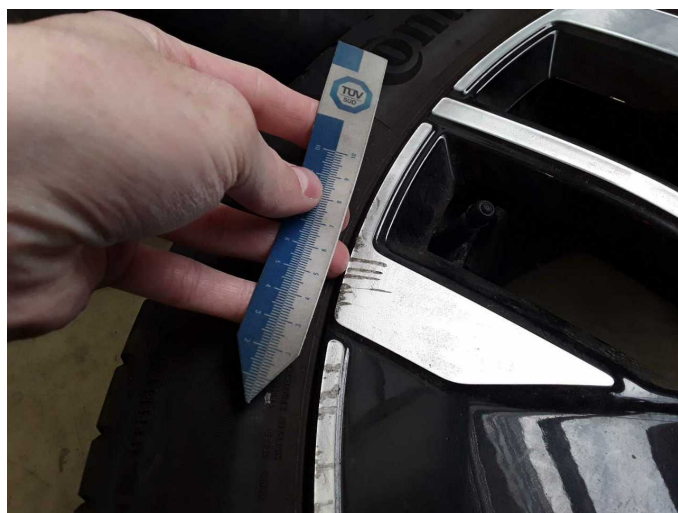


Damage 5: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - repair according to calculation



Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side

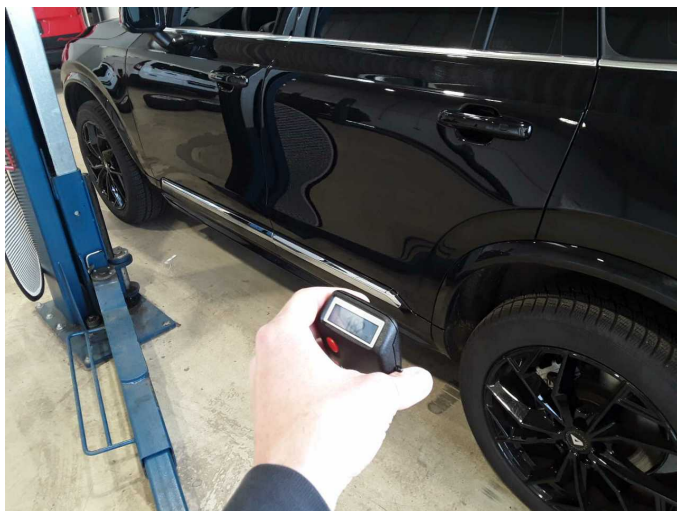

Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side