
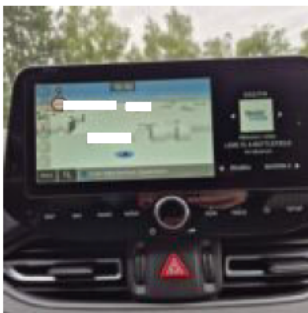
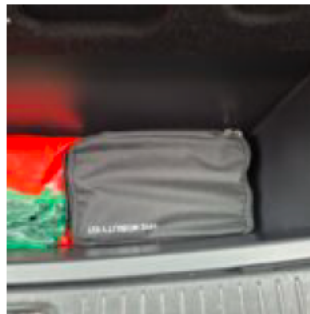
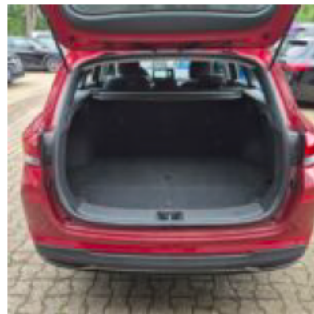
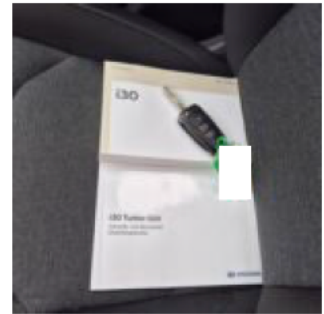



· Kombi 1.5 T-GDI DCT · 15 June 2026 · Bochum (D)

Specifications

		Fuel Type	Gasoline
		VIN	TMAH381DGPJ138975
Manufacturer	HYUNDAI	Cylinder Capacity	1.499 ^{cm3}
Model	I30	Transmission Type	Automatisch geschakelde Transmissie
Model Versions	Kombi 1.5 T-GDI DCT	First Admission	19-06-2023
Body Type	5 door hatchback	Odometer	70.271 ^{Km}
Color	Red	Numer Of Keys	1
Paint Type	Metallic	Interior	Grey
Production Year	2023	Number Headrests	5
KW	118		

Images

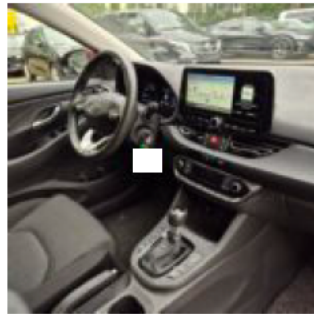

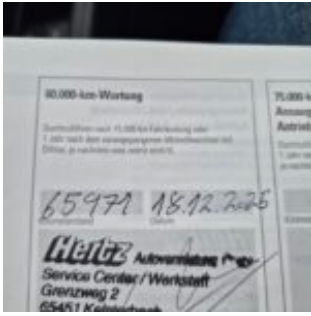

Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Fog lights

Front & rear parking sensors

Leather steering wheel

Navigation system

Rear view camera

Roller cover / parcel shelf

Seat heating

Steering wheel multifunction

Steeringwheel – Heated

Condition

Condition exterior Adequate

Condition interior Adequate

Last Maintenance 18-12-2025

Last maintenance odometer 65.971

Previous Repairs Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	4 ^{mm}	Goodyear	225 ^{mm}	45 ^{mm}	17 ^{inch}	All Season
Rear Left	7 ^{mm}	Fulda	225 ^{mm}	45 ^{mm}	17 ^{inch}	All Season
Front Right	4 ^{mm}	Goodyear	225 ^{mm}	45 ^{mm}	17 ^{inch}	All Season
Rear Right	7 ^{mm}	Fulda	225 ^{mm}	45 ^{mm}	17 ^{inch}	All Season
Spare Tire Type	Compressor					

Damages



Damage Part

Skirt – Left



Damage Type

Scratch(es)

Repair Type

Spray

Acceptable

No



Damage Part

Fender – Rear Left



Damage Type

Scratch(es)

Repair Type

Spray


Acceptable

No



Damage Part

Reardoor – Left

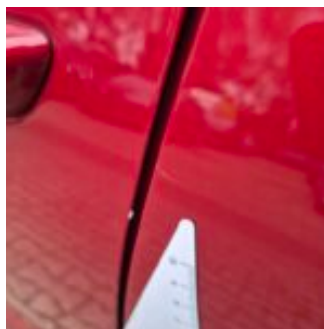

Damage Type

Small scratch(es)

Repair Type

Polish

Acceptable

No



Damage Part
Frontdoor - Left



Damage Type
Door-edge chipped

Repair Type
Acceptable

Acceptable
Yes



Damage Part
Alloy - Left Front




Damage Type
Damaged

Repair Type
Rim repair

Acceptable
No



Damage Part
Hood

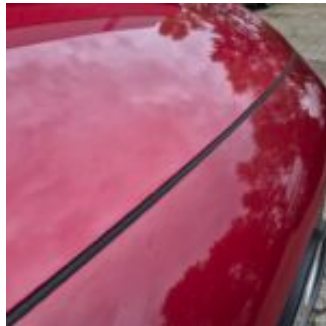

Damage Type
Stonechipping

Repair Type
Acceptable

Acceptable
Yes



Damage Part
Bumper – Front



Damage Type
Scratch(es)

Repair Type
Spray

Acceptable
No




Damage Part
Alloy – Right Front



Damage Type
Damaged

Repair Type
Rim repair

Acceptable
No

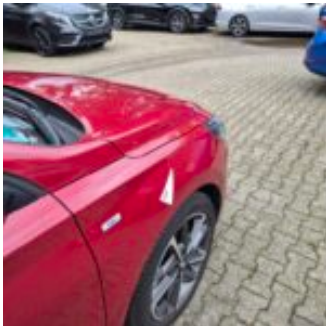

Damage Part
Fender – Front Right




Damage Type
Small scratch(es)

Repair Type
Cleaning

Acceptable
No



Damage Part
Reardoor – Right

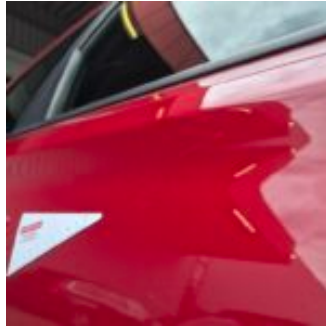

Damage Type
Scratch(es)



Repair Type
Spray
Acceptable
No



Damage Part
Alloy – Right Rear



Damage Type
Damaged



Repair Type
Rim repair
Acceptable
No



Damage Part
Fender – Rear Right



Damage Type
Small dent(s)



Repair Type
Restyle / Polish
Acceptable
No



Damage Part
Bumper – Rear



Damage Type
Scratch(es)

Repair Type
Spray

Acceptable
No



Damage Part
Tailgate



Damage Type
Small dent(s)

Repair Type
Restyle

Acceptable
No