



BMW X3 (KLL): 2BBF382

Vinnumber:	WBAUZ15010N109900	Versionname:	X3 (G01) 2.0d sDrive 18d 136pk/cv 5p Aut.
First Registrationdate:	17/09/2021	Fiscalpower:	
Expertise Mileage:	160225	Power Kw:	100
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:	Hybrid Diesel		
Maintenance	OK		
Maintenance	over 20000 km		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	Tow bar collapsible
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

225/60/18/104 Y				
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Firestone: 4 mm	Re.R.	Firestone: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				225/60 R 18 104 Y
Tyre size FR				225/60 R 18 104 Y
Tyre size RL				225/60 R 18 100 H
Tyre size RR				225/60 R 18 100 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				258
Tyre make RR				258

Assistance equipment

Repair kit	No
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Door panel FL, Worn, Acceptable




Ignition key, Not functioning (well), Acceptable



Windscreen, Stone chip(s), Acceptable



Bonnet, Scratch(es), Acceptable

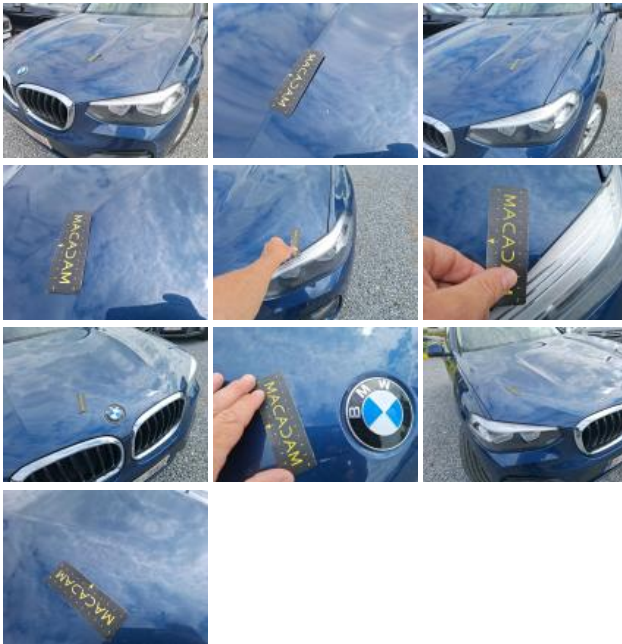

Bumper F, Scratch(es), Repair and paint (complete)



Step L, Dent(s) and scratch(es), Acceptable





Door FL, Scratch(es), Acceptable



Door RL, Scratch(es), Acceptable



Charging cable (normal), Missing, Check



Charging cable (fast), Missing, Check



Tyre repair kit, Missing, Check



Boot lid covering R, Scratch(es), Acceptable



Bumper trim R, Scratch(es), Acceptable



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)



Rear light L, Scratch(es), Replace



Door FR, Scratch(es), Acceptable



Outer door handle FR, Scratch(es), Repair and paint (complete)



Bodywork, Paint measurement, Acceptable



Kenteken	2BBF382
Merk Model	BMW X3 (G01) 2.0d sDrive 18d 136pk/cv 5p Aut.
Brandstofsoort	Diesel
Datum deel1	9/17/21

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
5/27/26	151,854	BMW/MINI service standaard omvang	Uitvoeren
5/27/26	151,854	BMW/MINI service voertuig-check	Uitvoeren
5/27/26	151,854	klein materiaal	
5/27/26	151,854	koelwatervloeistof	Bijvullen/-laden
5/27/26	151,854	ruitenwisserrubber achter	Vervangen
5/27/26	151,854	ruitenwisserrubber vooraan	Vervangen
5/27/26	151,854	ruitenwisservloeistof	Bijvullen/-laden
5/27/26	151,854	service brandstoffilter	Uitvoeren
5/27/26	151,854	service luchtfilter	Uitvoeren
5/27/26	151,854	service microfilter	Uitvoeren
5/27/26	151,854	service motorolie	Uitvoeren
8/5/25	129,843	BMW/MINI service standaard omvang	Uitvoeren
8/5/25	129,843	BMW/MINI voertuigcontrole	Uitvoeren
8/5/25	129,843	nazicht technische keuring	Uitvoeren
8/5/25	129,843	service microfilter	Uitvoeren
8/5/25	129,843	service motorolie	Uitvoeren
4/7/25	119,085	BMW/MINI service standaard omvang	Uitvoeren
4/7/25	119,085	remblokken achter	Vervangen
4/7/25	119,085	temperatuur sensor roetfilter/DPF	Vervangen
11/7/24	104,924	BMW/MINI service standaard omvang	Uitvoeren
11/7/24	104,924	BMW/MINI service voertuig-check	Uitvoeren
11/7/24	104,924	klein materiaal	
11/7/24	104,924	service luchtfilter	Uitvoeren
11/7/24	104,924	service microfilter	Uitvoeren
11/7/24	104,924	service motorolie	Uitvoeren
7/31/24	95,458	BMW/MINI service standaard omvang	Uitvoeren
7/31/24	95,458	remvloeistof	Vervangen
2/7/24	78,804	BMW/MINI service standaard omvang	Uitvoeren
2/7/24	78,804	klein materiaal	Uitvoeren
2/7/24	78,804	ruitenwisserrubber achter	Vervangen
2/7/24	78,804	service brandstoffilter	Uitvoeren
2/7/24	78,804	service microfilter	Uitvoeren
2/7/24	78,804	service motorolie	Uitvoeren
4/6/23	50,663	klein materiaal	Uitvoeren
4/6/23	50,663	ruitenwisserrubber achter	Vervangen
4/6/23	50,663	ruitenwisserrubber vooraan	Vervangen
4/6/23	50,663	service luchtfilter	Uitvoeren
4/6/23	50,663	service microfilter	Uitvoeren
4/6/23	50,663	service motorolie	Uitvoeren
7/18/22	24,921	service microfilter	Uitvoeren

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
7/18/22	24,921	service motorolie	Uitvoeren