



Expertise

Protocol number: 46571851
Order No. / Reference: 26622270
Inspection date: 17 Jul 2026

Manufacturer: Seat

Model: Alhambra 1.4 TSI S&S DSG OPF FR-LINE

VIN: VSSZZZ7NZNV502201



Vehicle details	
Manufacturer / Type / Model / Equipment	
Seat Alhambra 1.4 TSI S&S DSG OPF FR-LINE	
Vehicle Identification number	VSSZZZ7NZNV502201
Mileage (Read)	108,391 km
First registration	7 Apr 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,395 ccm
Fuel type / Cylinder	Petrol / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Weiß
Doors / Seats	5 / 7
Upholstery type	Alcantara / Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8 Tag(e)
Last service on / at	12/2025 at 98,238 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG171448
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	7593 / AFJ 00230		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Barum	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Barum	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95W	Summer tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm
2)	225/45 R18 95W	Summer tires (with run-flat tires) on Light alloy	Falken	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag: Driver's side knee airbag system
- Airbag: Side airbag for driver and front passenger
- Exterior mirrors in Atom Grey
- Outdoor temperature display
- LED turn signals integrated into the side of the exterior mirrors
- Roof rails in silver
- Electronic Stability Program (ESP) with counter-steering support
- Electric windows front and rear
- Luggage compartment floor
- Transmission: 6-speed DSG
- Heated rear window
- Interior lights front and rear with delayed shut-off
- Instrument lighting
- ISOFIX child seat restraint system, triple in the 2nd row of seats
- Comfort turn signals
- Rear headrests (3)
- Steering column with height and reach adjustment
- Illuminated makeup mirrors in the sun visors
- Multifunction display with color screen
- Navigation system
- Otto particulate filter
- Package: Chrome Package
- Package: Winter Package
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Rear view camera
- Side and rear windows with heat-insulating glazing
- Sliding doors at the rear left and right
- Side windows from the 2nd row of seats and rear window are dark tinted.
- Seat belts: Three-point automatic front belts, height-adjustable
- Seats: Driver's seat with electric backrest adjustment
- Seats: Sport comfort seats in the front
- Sunshade roller blind on the rear door windows
- Lane departure warning system
- 12V socket
- Bag hooks in the luggage compartment
- Front door sill trims
- Front Assist area monitoring system with City Emergency Braking function
- Automatic hazard warning lights during emergency braking
- Electronic immobilizer
- Xenon lights: Bi-xenon with cornering lights
- Driver and passenger side airbags
- Airbag: Head airbag system for front and rear passengers
- Electrically adjustable, heated and folding exterior mirrors with ambient lighting,
- Lighting
- Third brake light
- Chrome interior applications
- Electronic parking brake
- Automatic headlight control
- Chassis: Sport chassis
- Luggage compartment cover
- Cruise control system
- LED taillights
- Rear window wiper
- Interior mirror automatically dimming
- Use of instruments
- Electric child safety lock for the rear doors
- "Climatronic" air conditioning system with 3 climate zones
- Front headrests (2) are height adjustable
- Steering wheel: Three-spoke leather steering wheel with multifunction controls
- Front center armrest with storage box
- Fatigue detection
- Fog lights with cornering light function
- Package: Alcantara
- Package: Smoker's Package
- Upholstery: Seat covers in Alcantara/leather look
- Rain sensor
- Wheels: Alloy wheels (4) 7.5 J x 18 "Akira" in Atom Grey (With mobility tires 225/45 R 18)
- Headlight cleaning system
- Keyless locking and starting system Kessy
- Power steering
- Seat belts: 3 three-point automatic in the rear
- Seats: 3 individual seats in the 2nd row
- Seats: Front passenger seat backrest can be folded down completely
- Seats: Front seats with height adjustment and lumbar support
- Start-stop system with brake energy recuperation
- Daytime running light
- Blind spot assist
- Ultrasonic parking aid, front and rear
- Traffic sign recognition
- Lashing eyes in the luggage compartment
- Warning light for unclosed doors and luggage compartment
- Central locking including tailgate with remote control



Extra equipment

- Airbag: Rear side airbags
- Roof console, comfort storage tray in the headliner
- Package: Business COMFORT PLUS (Seat package - driver and front passenger seats electrically adjustable, driver's seat with memory function - lumbar support in driver and front passenger seats electrically adjustable - massage function for driver's seat - exterior mirrors with memory function, sliding doors left and right electrically operated with closing aid, tailgate electrically operated incl. sensor-controlled opening)
- Adaptive Cruise Control (ACC) up to 210 km/h
- Paint finish: White
- Package: Luggage compartment package (luggage net - net partition - rails on side walls with tension strap (fixable))
- Radio accessories: FullLink (Android Auto - Apple CarPlay)
- Seats: 7 seats (3 individual seats in the 2nd row - 2 individual seats in the 3rd row - Easy-Entry access aid - warning tone for unfastened seat belts)
- Auxiliary heater, with remote control

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	2nd wheel set	1 tyre - Porous / cracked - Replace
3	2nd wheel set	1 tyre - Porous / cracked - Replace
4	Body	Body (Flugrost) - Soiled - Clean
5	2nd wheel set	1 alloy rim - Scratched - Loss in value
6	2nd wheel set	1 alloy rim - Scratched - Loss in value
7	2nd wheel set	1 alloy rim - Scratched - Replace
8	2nd wheel set	1 alloy rim - Scratched - Replace

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 4 Mar 2026	3.272,45 €
2	Front, Side right, Provided by user / customer, from 28 Jan 2024	3.288,01 €
3	Side - left, Provided by user / customer, from 10 Apr 2026	4.450,42 €
4	Side right, Provided by user / customer, from 4 Mar 2026	5.811,56 €

Repainting

No.	Repainting
1	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
3	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Side panel - rear left side	238 µm	Door - rear left side	225 µm
Door - rear right side	214 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

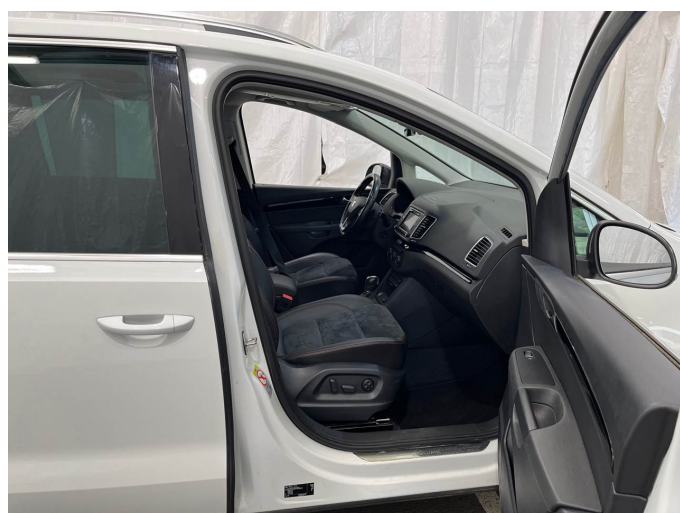


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

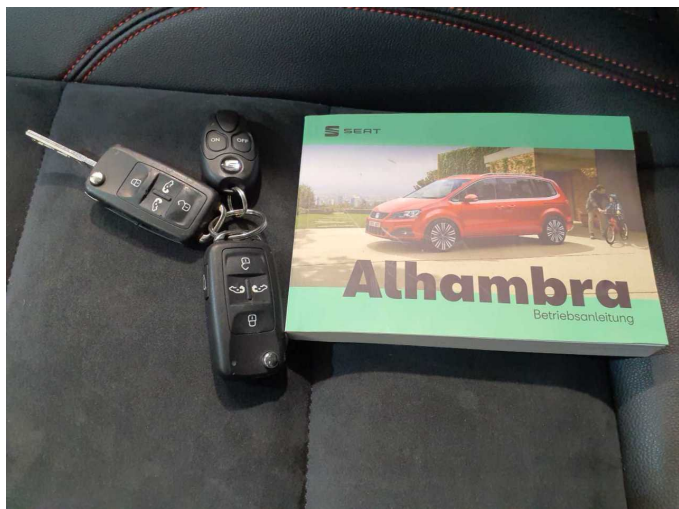


Figure 13: Documents

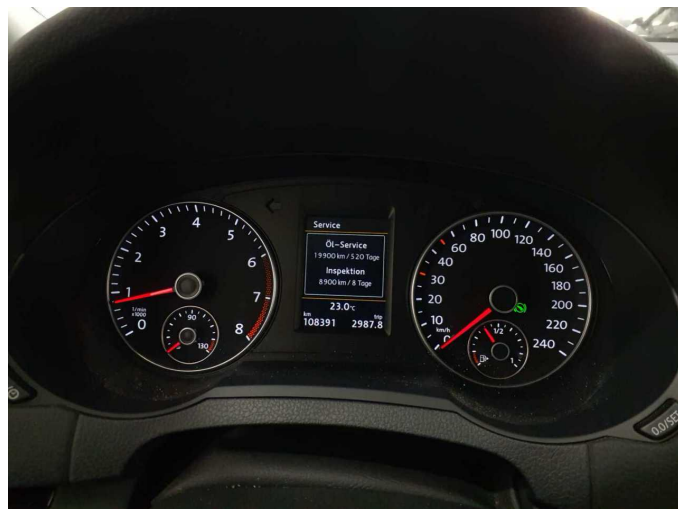


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

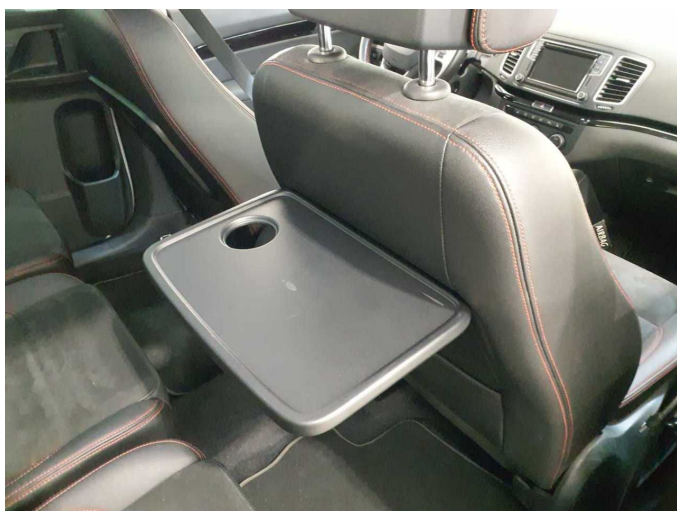


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

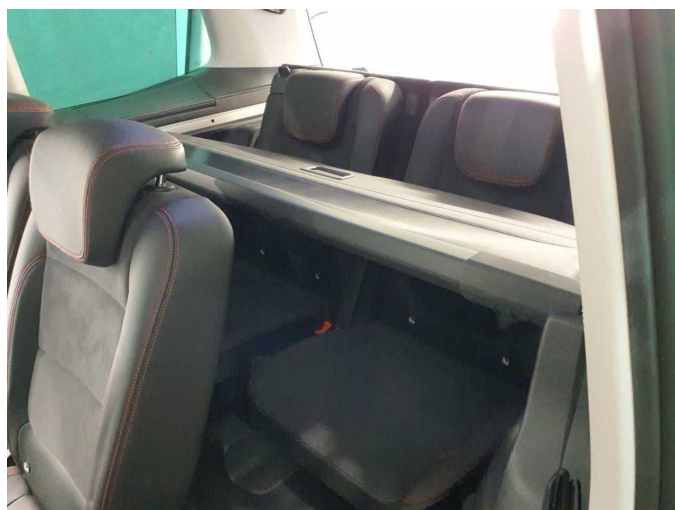


Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Damage 2: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 2: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 2: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 2: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 3: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 3: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 3: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 3: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 3: 2nd wheel set: 1 tyre - Porous / cracked - Replace



Damage 4: Body: Body (Flugrost) - Soiled - Clean



Damage 4: Body: Body (Flugrost) - Soiled - Clean



Damage 4: Body: Body (Flugrost) - Soiled - Clean



Damage 4: Body: Body (Flugrost) - Soiled - Clean



Damage 4: Body: Body (Flugrost) - Soiled - Clean



Damage 4: Body: Body (Flugrost) - Soiled - Clean



Damage 5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 8: 2nd wheel set: 1 alloy rim - Scratched - Replace




Damage 8: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage 8: 2nd wheel set: 1 alloy rim - Scratched - Replace




Damage 8: 2nd wheel set: 1 alloy rim - Scratched - Replace

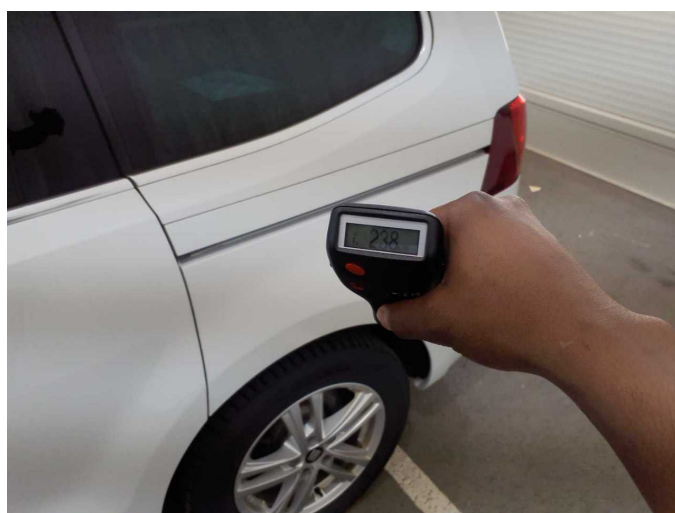

Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side

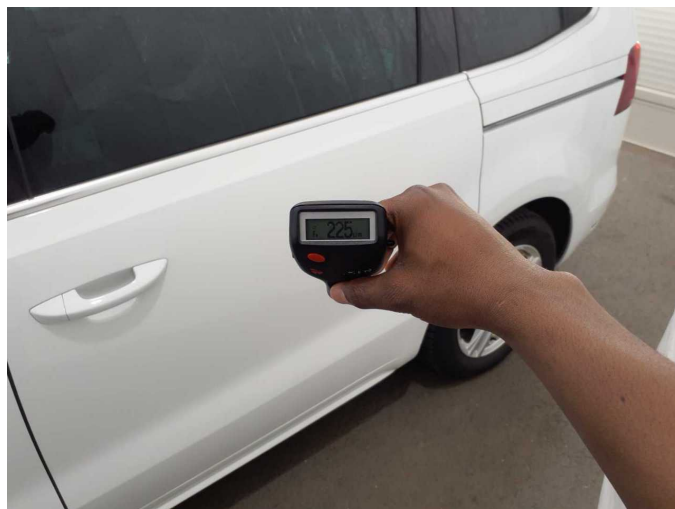

Repainting 2: Door - rear left side



Repainting 2: Door - rear left side



Repainting 3: Door - rear right side



Repainting 3: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VSSZZZ7NZNV502201

Hersteller / Modell: SEAT SEAT Alhambra 1.4 TSI S&S DSG OPF FR-LINE

Datum	KM-Stand	Beschreibung
18.12.2025	98.238	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.07.2025	87.193	Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges; Zündkerzen ern
16.04.2025	79.074	AU; Reparatur Sonstiges
28.03.2025	77.851	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.06.2024	57.748	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges