



Expertise

Protocol number: 46312123
Order No. / Reference: 26656821
Inspection date: 2 Jul 2026

Manufacturer: Audi

Model: Q3 35 TDI Sportback S tronic S line

VIN: WAUZZZF30P1123267



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q3 35 TDI Sportback S tronic S line	
Vehicle Identification number	WAUZZZF30P1123267
Mileage (Read)	81,982 km
First registration	8 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic /
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Gletscherweiss Metallic (S9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,100 km
Last service on / at	11/2025 at 61,339 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS581956
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BQU 05273		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,155 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 104Y	Summer tyres on Light alloy	Continental	2mm / 2mm
2)	255/45 R19 104Y	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	3mm / 2mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Audi connect Remote & Control
- Audi pre sense basic
- Electrically adjustable and heated exterior mirrors
- third brake light
- Diesel particulate filter (DPF)
- Rear parking sensors
- Door sills with aluminum inlay
- Electronic Stability Control (ESC)
- Electric windows front and rear
- Adjustable speed limiter
- Transmission: S tronic 7-speed
- rear window wiper
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- LED headlights
- Light/rain sensor
- Package Gloss
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus
- Fabric seat covers Argument
- Lane Departure Warning
- Start-stop system with recuperation
- Phone: Bluetooth interface
- Electronic immobilizer
- Central locking
- Airbag: Front side airbags and head airbag system
- Audi connect Emergency Call & Service
- Audi drive select
- Audi pre sense front
- Hill start assist
- Decorative inlays Micrometallic silver
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches
- Electromechanical parking brake
- Chassis: Sport chassis
- front and rear floor mats
- Legal emergency number
- Heated rear window
- Electrically operated child safety lock
- Manual air conditioning
- Headrests (5) front and rear
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Progressive steering
- Wheel: Tire repair kit
- rear seat plus
- Seats: Standard front seats
- Lane change warning
- Front/rear bumpers and underride protection
- Glazing: Windscreen in heat-insulating and acoustic glazing



Extra equipment

- Aluminum look in the interior (elements on the mirror adjustment switch, the window regulator switches, the parking brake control button and door trim strips in aluminum look)
- Hill Descent Control (maintains the preset speed when driving downhill)
- Decorative aluminum inlays, dark
- Decorative inlays aluminum dimension silver
- Decorative inlays, dark brushed matt aluminum
- Deletion of model designation and performance/technology lettering
- Hold assist (holds the vehicle indefinitely after stopping on inclines and declines typical in road traffic.)
- Automatically dimming, frameless interior mirror (can increase safety, as reduced glare improves the perception of following traffic at night - less glare at night, among other factors, can help to recognize other vehicles in the interior mirror more quickly and better - reduced glare can help to prevent eye fatigue)
- Comfort center armrest in front (adjustable in tilt, movable in length)
- Comfort key in conjunction with anti-theft alarm system (Comfort key - anti-theft alarm system monitors doors, hood, and trunk lid. The deadbolt prevents opening via the interior door handle once the vehicle has been locked with the key (country-specific availability). The anti-theft alarm system also offers: switchable ultrasonic interior monitoring, theft warning via tilt sensor, and a battery-powered siren to prevent tampering).
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus
- Storage and luggage compartment package (flexible transport of items and comfort while traveling, consisting of: - storage net on the back of the front seats - storage compartment under the passenger seat - luggage compartment light (LED) in the tailgate for lighting the trunk - luggage compartment net - 12-volt socket in the trunk tray in the left side panel)
- Business package in conjunction with interior S line or design selection (MMI Navigation plus - leather steering wheel in 3-spoke design with multifunction plus - Audi virtual cockpit plus - Audi phone box - Audi connect Navigation & Infotainment plus - cruise control)
- Dynamic package (Sportback) (Adaptive suspension - Sound actuator - Decorative foil Audi rings on the sides in platinum grey - Brake calipers painted red (only for Q3 40 TDI and 45 TFSI))
- Wheel: Audi new car tire warranty
- Wheel: Audi Sport light alloy wheels in 7-spoke rotor in anthracite black (8.5 J × 19 with tires 255/45 R 19 gloss turned)
- Wheel: Winter alloy wheels in 5-arm Secare black (6.5 J × 17 with winter tires 215/65 R17)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides, with memory function (with integrated LED turn signals and curb view function for the passenger-side exterior mirror, including heated windshield washer nozzles - the curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, giving the driver a better view of the curb)
- Parking assistance plus
- High beam assist
- Electrically opening and closing tailgate (The tailgate can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the tailgate handle. Closing the tailgate is just as easy and convenient: simply press the button on the inside of the tailgate, the button in the driver's door, or the button on the optional comfort key. A soft-close mechanism makes manual closing easier when necessary.)
- 2-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver and front passenger side - sun position-dependent control - automatic recirculation control via air quality sensor - dust and odor separating allergen filter - air vents in the rear center console - separate defroster button for faster defrosting of the front and side windows)
- Paint finish: Metallic
- LED headlights with LED taillights with dynamic turn signals (functions include: daytime running lights, low beam, high beam (from MY20), position lights, turn signals, cornering lights, all-weather lights, motorway lights (extended range at high speeds), maneuvering lights (illumination of the swivel area when reversing), static cornering lights, automatic dynamic headlight range control, intersection lights (only with MMI Navigation plus), turn signals, brake lights, tail lights, reversing lights and rear license plate lights in LED technology)
- Assistance package in conjunction with Business (Adaptive Cruise Control (combines adaptive cruise control with lane keeping assist) - Emergency Assist (Lane Departure Warning. If the driver does not react, the system takes over control of the vehicle and automatically brings it to a stop in its lane; the hazard warning lights are activated.) - High Beam Assist - Parking Assist Plus)
- S line interior package (sports seats with S embossing - seat upholstery in Puls fabric/mono.pur 550 synthetic leather combination - leather steering wheel in 3-spoke design with multifunction plus including steering wheel grips and gear selector knob in perforated leather, S line emblem - decorative inlay in matt brushed dark aluminum - accent surfaces in fine lacquer slate grey - headliner in black fabric - door sill trims with aluminum inlays, illuminated, with S lettering - loading sill protection in stainless steel - pedals and footrest in stainless steel - floor mats front/rear - rear bench seat plus with center armrest)



- Seat covers in leather/artificial leather mono.pur 550 combination S line (seat center section of the front and both outer rear seats in leather - inner and outer seat side bolsters, middle rear seat and comfort center armrest in front (if ordered) in artificial leather mono.pur 550 - contrast stitching on black seats in rock grey, contrast stitching on rotor grey seats in anthracite - with S embossing in the backrests of the front seats)
- Front seat heating (heats seat and backrest center section for standard seats, otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Seats: Electrically adjustable front seats with memory function for the driver's seat (with electric adjustment of seat height, seat longitudinal position, seat and backrest tilt; with memory function for the driver's side.)
- Surround view cameras (The four wide-angle surround view cameras cover the entire area immediately around the vehicle and offer a variety of different views for even more convenient maneuvering. The driver can select different views on the MMI display, making it easier to position the vehicle in the parking space. Virtual top view, reversing camera view, panoramic front and rear view, curb view)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Seat - front	Seat cover - left side (Sitze) - Soiled - Clean
3	Door - rear right side	Brightware - lower - Scratch(es) - Smart repair
4	Interior	Interior - Odour - Ozone treatment
5	Roof	Roof - dent(s) - Smart repair
6	Mudguard - right side	Wheel well extension - Scratch(es) - Smart repair
7	2nd wheel set	2 tyres - does not meet manufacturer specifications - Replace
8	Wheel / tyres	Tyre - front - does not meet manufacturer specifications - Replace
9	Front bumper	Front bumper (Rechts) - Scratched - Repair and paint
10	Braking system	Brake discs and pads - rear - Worn - Replace
11	Braking system	Brake discs and brake pads - front (Scheiben sind stark eingelaufen) - Worn - Replace
12	Rear bumper	Rear bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

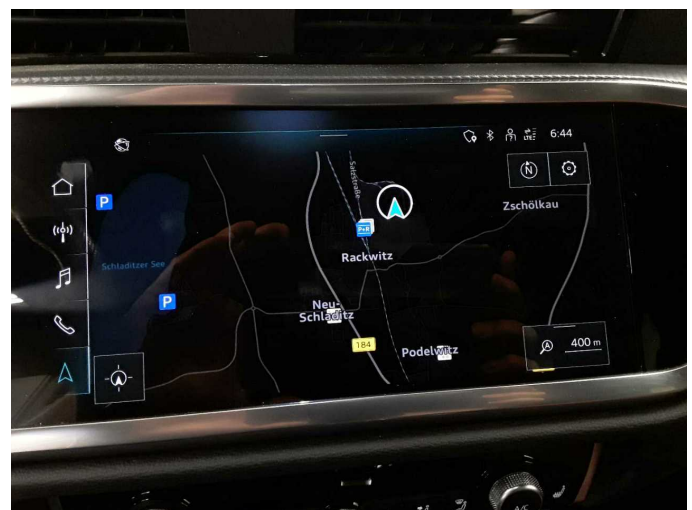


Figure 16: Navigation



Figure 17: Misc.

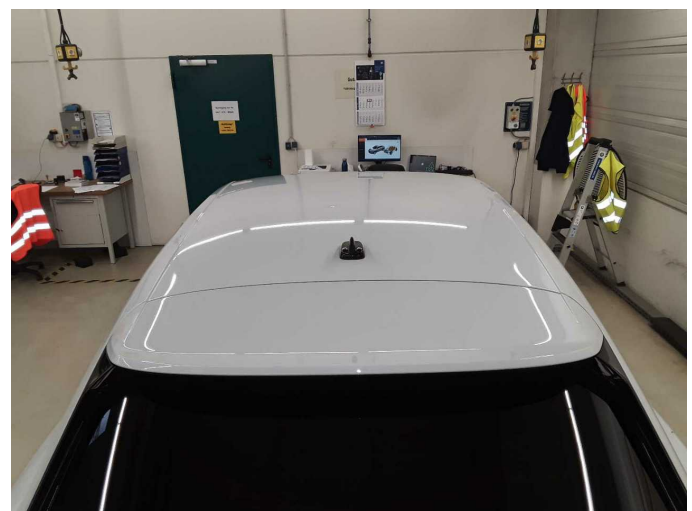


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

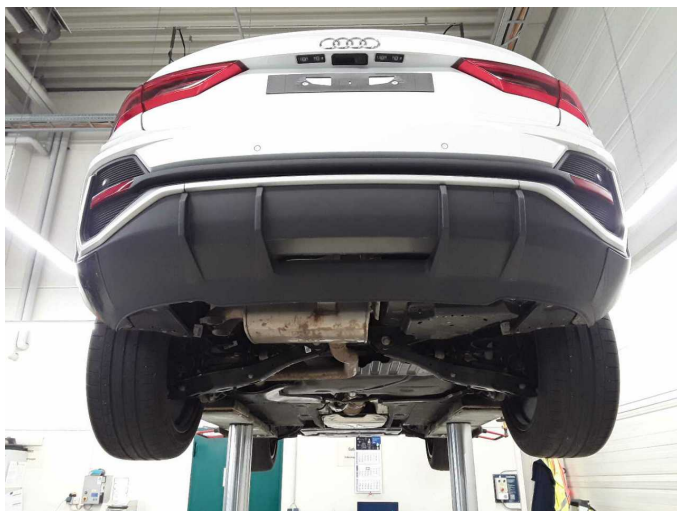


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.

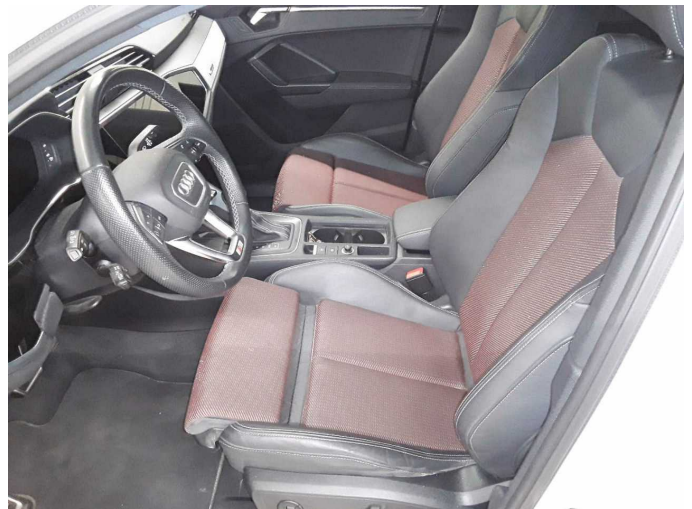


Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean

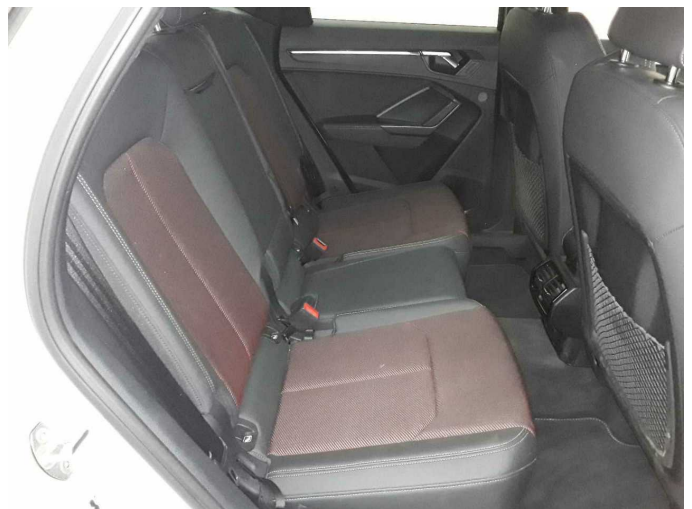

Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean

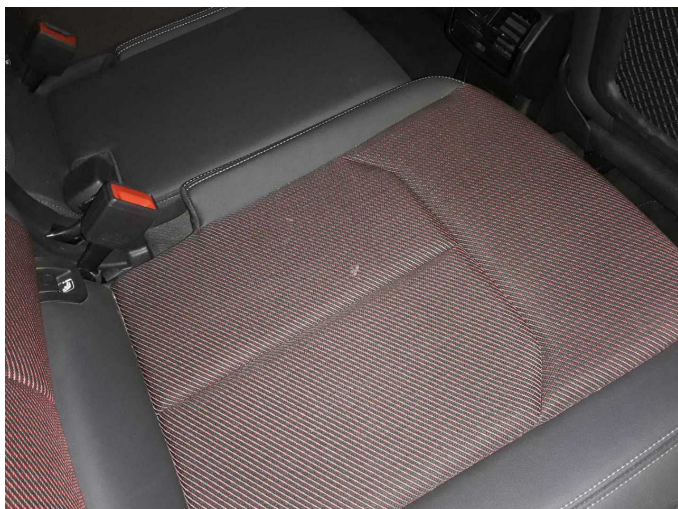


Damage 2: Seat - front: Seat cover - left side (Sitze) - Soiled - Clean



Damage 3: Door - rear right side: Brightware - lower - Scratch(es) - Smart repair



Damage 3: Door - rear right side: Brightware - lower - Scratch(es) - Smart repair

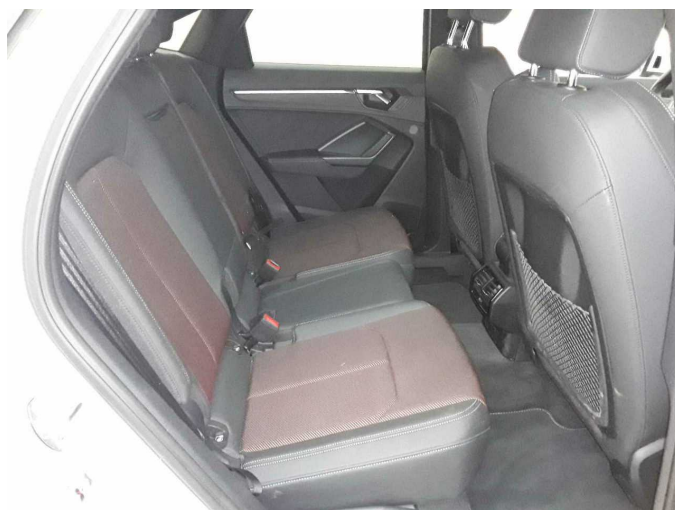

Damage 4: Interior: Interior - Odour - Ozone treatment




Damage 4: Interior: Interior - Odour - Ozone treatment



Damage 5: Roof: Roof - dent(s) - Smart repair



Damage 5: Roof: Roof - dent(s) - Smart repair

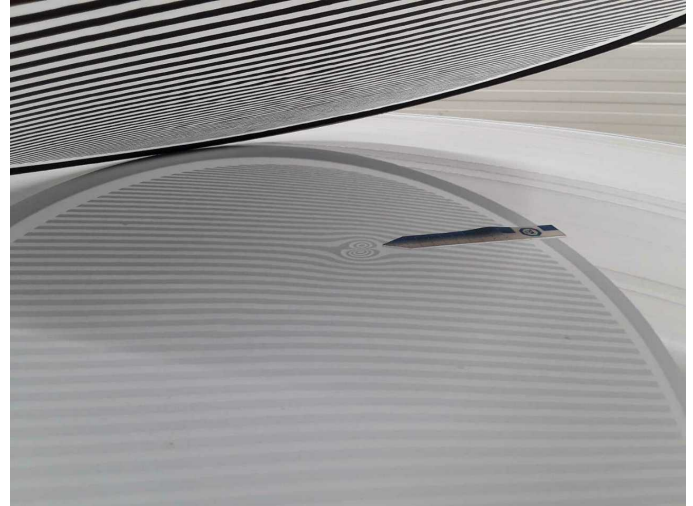

Damage 5: Roof: Roof - dent(s) - Smart repair



Damage 6: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair



Damage 6: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair



Damage 7: 2nd wheel set: 2 tyres - does not meet manufacturer specifications - Replace



Damage 7: 2nd wheel set: 2 tyres - does not meet manufacturer specifications - Replace




Damage 7: 2nd wheel set: 2 tyres - does not meet manufacturer specifications - Replace




Damage 7: 2nd wheel set: 2 tyres - does not meet manufacturer specifications - Replace




Damage 8: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

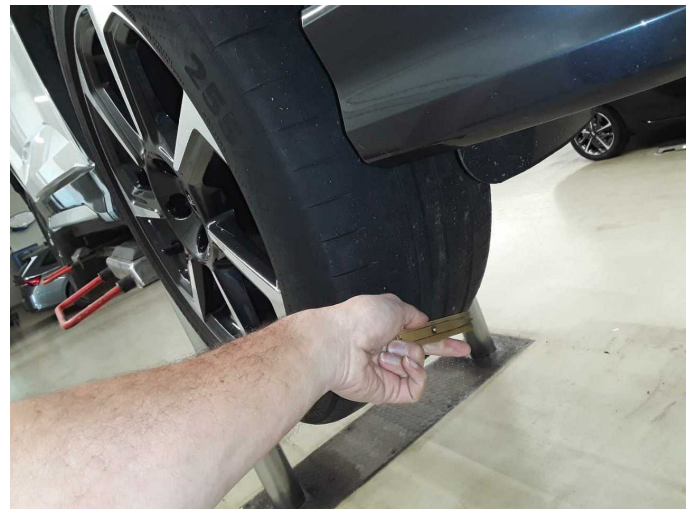

Damage 8: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

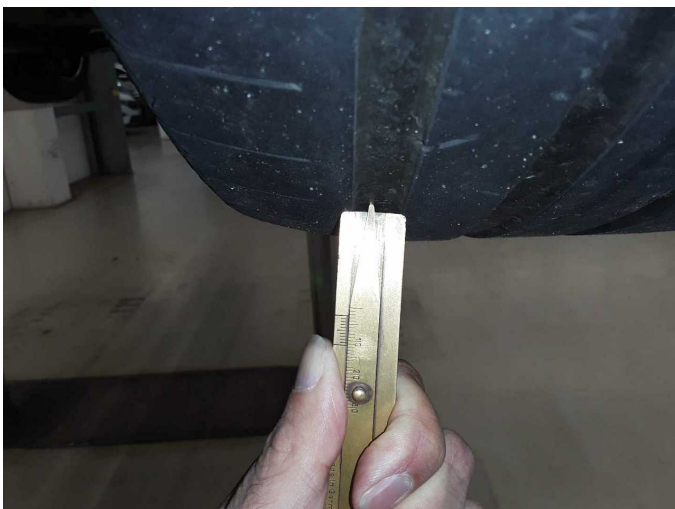

Damage 8: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

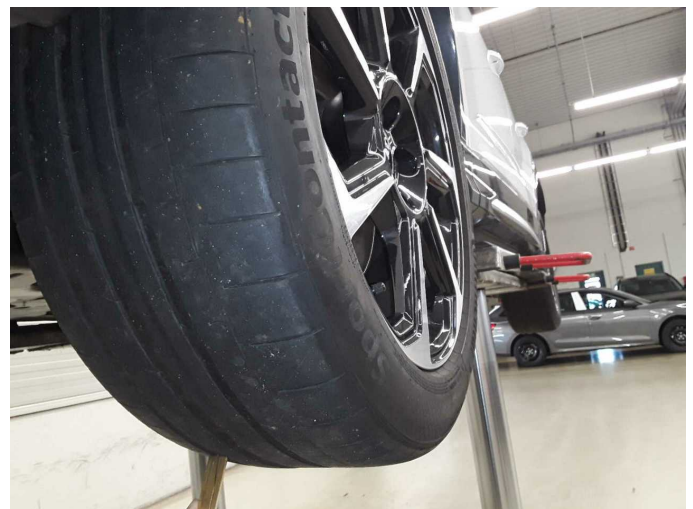

Damage 8: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace



Damage 8: Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace



Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint



Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint



Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint




Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint



Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint




Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint

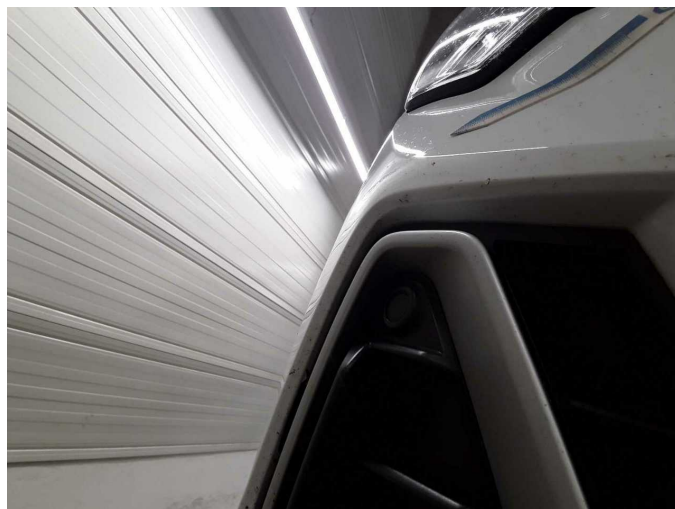

Damage 9: Front bumper: Front bumper (Rechts) - Scratched - Repair and paint



Damage 10: Braking system: Brake discs and pads - rear - Worn - Replace

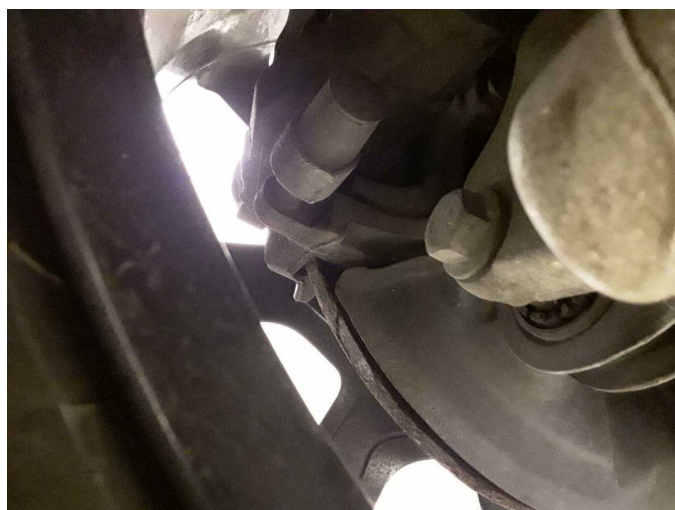

Damage 10: Braking system: Brake discs and pads - rear - Worn - Replace



Damage 10: Braking system: Brake discs and pads - rear - Worn - Replace




Damage 10: Braking system: Brake discs and pads - rear - Worn - Replace




Damage 10: Braking system: Brake discs and pads - rear - Worn - Replace




Damage 11: Braking system: Brake discs and brake pads - front (Scheiben sind stark eingelaufen) - Worn - Replace

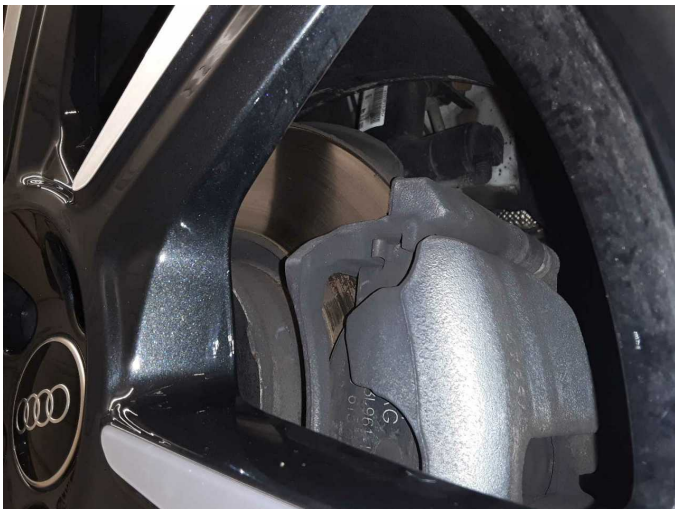

Damage 11: Braking system: Brake discs and brake pads - front (Scheiben sind stark eingelaufen) - Worn - Replace

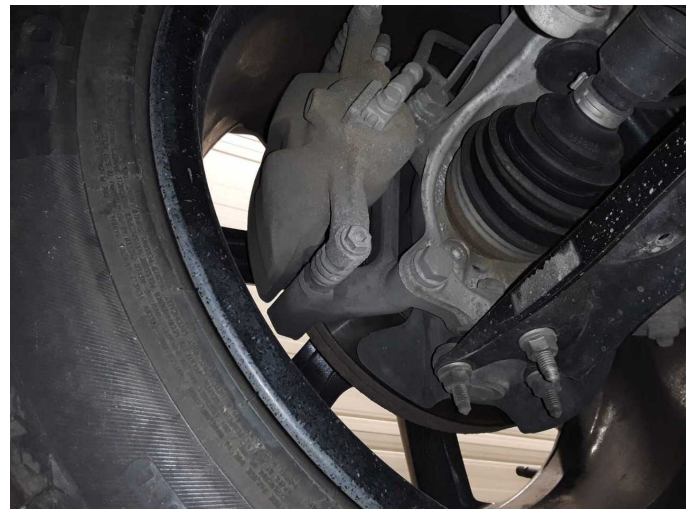

Damage 11: Braking system: Brake discs and brake pads - front (Scheiben sind stark eingelaufen) - Worn - Replace

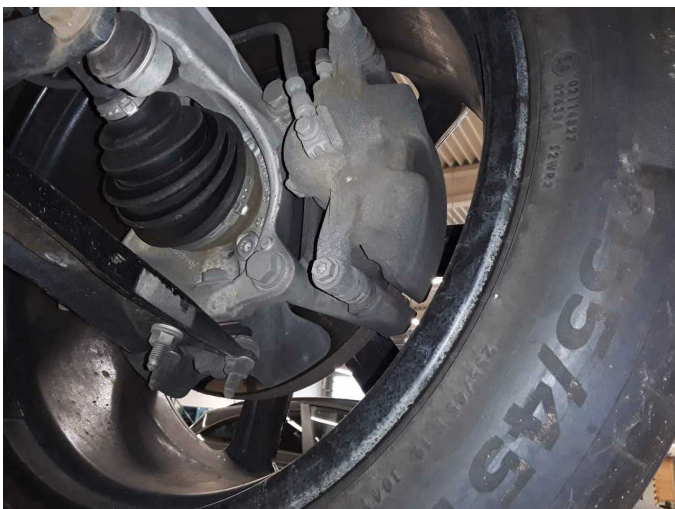


Damage 11: Braking system: Brake discs and brake pads - front (Scheiben sind stark eingelaufen) - Worn - Replace




Damage 11: Braking system: Brake discs and brake pads - front (Scheiben sind stark eingelaufen) - Worn - Replace



Damage 12: Rear bumper: Rear bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint

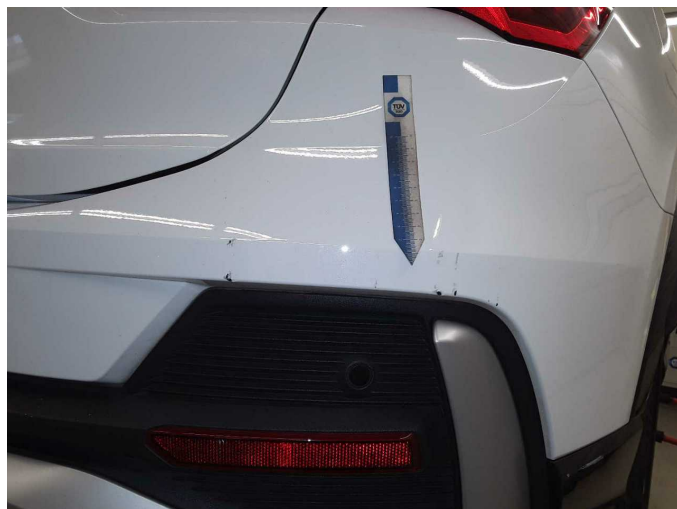

Damage 12: Rear bumper: Rear bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint

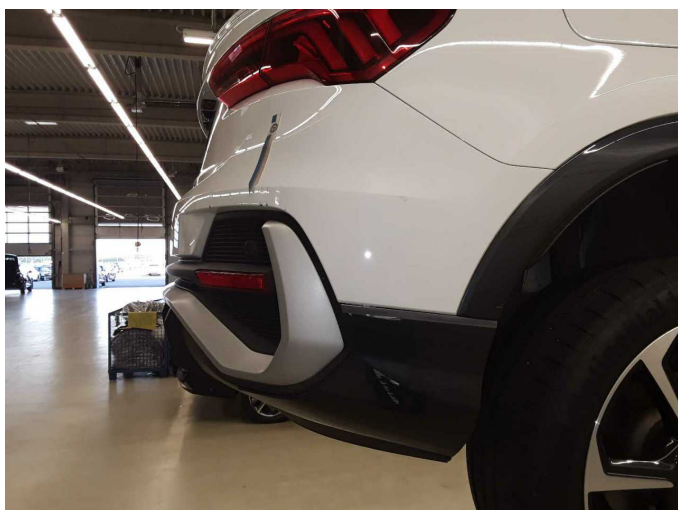

Damage 12: Rear bumper: Rear bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint



Damage 12: Rear bumper: Rear bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint



Damage 12: Rear bumper: Rear bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF30P1123267

Hersteller / Modell: AUDI AUDI Q3 35 TDI Sportback S tronic S line

Datum	KM-Stand	Beschreibung
26.11.2025	61.339	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.02.2025	31.079	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges