



Expertise

Protocol number: 46322657  
Order No. / Reference: 26543163  
Inspection date: 6 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan 2.0 TDI SCR Life

VIN: WVGZZZ5N8PW092659



| Vehicle details                         |                             |
|-----------------------------------------|-----------------------------|
| Manufacturer / Type / Model / Equipment |                             |
| Volkswagen Tiguan 2.0 TDI SCR Life      |                             |
| Vehicle Identification number           | WVGZZZ5N8PW092659           |
| Mileage (Read)                          | 95,917 km                   |
| First registration                      | 13 Jun 2023                 |
| Number of holders                       | 1                           |
| Next periodical technical inspection    | 06/2026                     |
| (Report not on hand)                    |                             |
| Power / Engine displacement             | 110 kw / 1,968 ccm          |
| Fuel type / Cylinder                    | Diesel / 4                  |
| Gearbox / Number of gears               | Manual / 6                  |
| Type of drive                           | Front drive                 |
| Type of vehicle                         | SUV                         |
| Colour / colour code                    | Dolphin grey metallic (C7Q) |
| Doors / Seats                           | 5 / 5                       |
| Upholstery type                         | Cloth                       |
| Colour of upholstery                    | Black-Anthracite            |



| Vehicle details                              |                              |                         |                                                            |
|----------------------------------------------|------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | digital proof / complete     | Next maintenance in     | 20,700 km                                                  |
| Last service on / at                         | 03/2026 at 88,658 km         |                         |                                                            |
| Key is / should be                           | 2 / 2                        | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                              | Letter No.              | GV190615                                                   |
| Previous damage / Accident                   | Detectable                   | Repainting              | None detectable                                            |
| Inspection conditions                        | sufficient                   | Lifting equipment / pit | yes                                                        |
| Test drive                                   | Not performed                | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 0603 / BZG 30265             |                         |                                                            |
| Emission standard                            | EURO6;WLTP;AP;PI/CI; M, N1 I | fine dust sticker       |                                                            |
| Permitted total weight                       | 2,060 kg                     | Empty weight            |                                                            |

| Tyres            |                |                             |              |             |
|------------------|----------------|-----------------------------|--------------|-------------|
| Mounted tyres    |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 215/65 R17 99V | Summer tyres on Light alloy | Hankook      | 2mm / 2mm   |
| 2)               | 215/65 R17 99V | Summer tyres on Light alloy | Hankook      | 5mm / 5mm   |
| Additional tyres |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 215/65 R17 99H | Winter tyres on Light alloy | Continental  | 6mm / 6mm   |
| 2)               | 215/65 R17 99H | Winter tyres on Light alloy | Continental  | 8mm / 8mm   |
| Replacement      |                |                             |              |             |
| Typ              | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|                  | Tirefit        | Expiration date 04/2027     |              |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side
  - Adaptive Cruise Control (ACC)
  - third brake light
  - Diesel particulate filter
  - Parking assistance
  - Electronic Stability Program with counter-steering support
  - Electric windows front and rear
  - High beam control Light Assist
  - Pedestrian detection
  - Transmission: 6-speed manual transmission
  - rear window wiper
  - ISOFIX mounting points, also for i-Size child car seats
  - Air conditioning system "Air Care Climatronic"
  - Rear headrests (3)
  - Front headrests
  - LED reading lights, 2 in the front and 2 in the rear
  - Steering wheel: Multifunction steering wheel in leather
  - Manual headlight range adjustment
  - Multifunction display "Premium"
  - Non-smoking version
  - Upholstery: Cloth
  - Radio accessories: 8 speakers
  - Tire pressure monitoring system
  - Wheels: Tires 215/65 R 17, rolling resistance class A
  - Wheels: Tire Mobility Set (12V compressor and tire sealant)
  - electromechanical power steering
  - Seats: Front passenger seat backrest folds down completely
  - Seats: Lumbar support in the front
  - Seats: Front seats with height adjustment
  - Start-stop system with brake energy recuperation
  - Power outlet: 2 USB-C ports on the front
  - First aid kit, warning triangle and high-visibility vest
  - Green thermal insulation glazing, sides and rear
- Airbag: Head airbag system for front and rear passengers including front side airbags
  - Electrically adjustable and heated exterior mirrors
  - black roof rails
  - Tachometer
  - Electronic parking brake including auto-hold function
  - Automatic headlight control, with LED daytime running lights
  - Windscreen made of laminated safety glass, heat and sound insulating
  - Rear window heated
  - Interior mirror automatically dimming
  - LED license plate lighting
  - Combination instrument cluster with electronic speedometer
  - Paint finish: Solid
  - LED headlights with LED daytime running lights
  - Light in the front footwell
  - front center armrest
  - Fatigue detection
  - Emergency call service
  - Radio "Composition"
  - Rain sensor
  - Wheels: Light alloy (4) "Tulsa" 7 J x 17 (in Dark Graphite, surface polished - tires 215/65 R 17)
  - Gearshift knob in leather
  - Drawers under the front seats
  - Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
  - Seats: Comfort seats in the front
  - Seats: Rear bench seat asymmetrically split
  - Lane keeping assistant "Lane Assist"
  - 12-volt socket
  - Textile floor mats front and rear
  - Electronic immobilizer
  - Central locking without safe locking, with remote control and 2 remote keys



## Extra equipment

- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
- Foldable towbar (electric release)
- Navigation system "Discover Media" incl. "Streaming & Internet"
- Package: Business Premium (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Cargo Package "Plus" (luggage net - net partition)
- Storage compartments in the overhead console
- Surround view "Area View" (incl. reversing camera "Rear View")
- Tailgate with electric opening and closing, adjustable opening angle
- Trailer maneuvering assistant "Trailer Assist" including parking assist "Park Assist" and parking aid
- Wheels: Winter wheels (4) (additional), alloy "Montana" 7 J x 17 (AirStop winter tires 215/65 R 17 H - on-board tools and jack)
- Wirelessly heated windshield (infrared-reflective, noise-reducing)
- Airbag: Side airbags for the outer rear seats (including front side airbags and head airbag system)
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - Dynamic headlight range control with dynamic cornering lights - LED taillights, dark red - Bad weather light and cornering light - IQ.LIGHT - LED matrix headlights with LED daytime running lights, cornering lights and dynamic turn signals)
- Package: Cargo (230V socket in the luggage compartment - luggage compartment lighting - luggage compartment floor height adjustable in 2 stages)
- Paint finish: Metallic
- Seats: ergoActive front seats (ergoActive front seats height-adjustable, seat and backrest tilt adjustable, thigh support longitudinally adjustable - lumbar support in front electrically adjustable and with massage function - seat center panels of the front seats and the outer rear seats in microfleece "ArtVelours" - top comfort seats in front)
- Tire pressure monitoring system
- Tire pressure monitoring system for road tires and winter tires
- Windows: Rear side windows and rear window tinted

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                        |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group       | Description                                                             |
|-----|-----------------------|-------------------------------------------------------------------------|
| 1   | Wheel / tyres         | Tyre - front - does not meet manufacturer specifications - Replace      |
| 2   | Door - rear left side | Door - Scratched - Repair and paint                                     |
| 3   | Front bumper          | Front bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint |

## Previous damages

| No. | Previous damage                                                 | Extent of damage (Net) |
|-----|-----------------------------------------------------------------|------------------------|
| 1   | Side - left, Provided by user / customer, from 12 Nov 2025      | 1.401,20 €             |
| 2   | Front, Side right, Provided by user / customer, from 4 Feb 2026 | 1.650,79 €             |



## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
*(Functional testing of driver assistance systems is not included in the scope of services!)*
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.





**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)




**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front

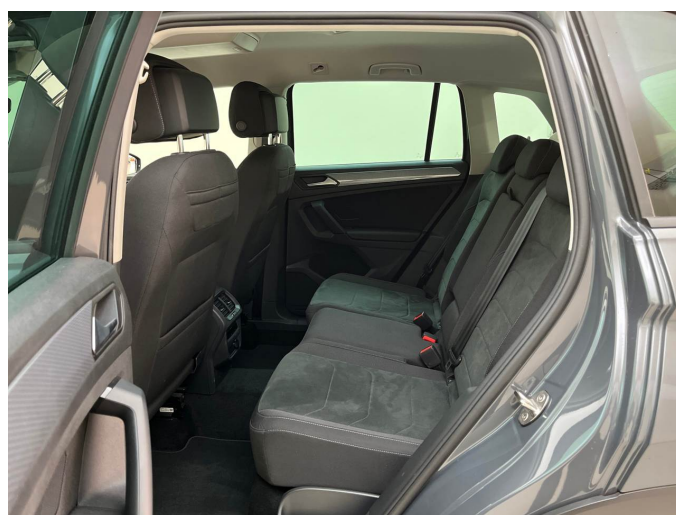

**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

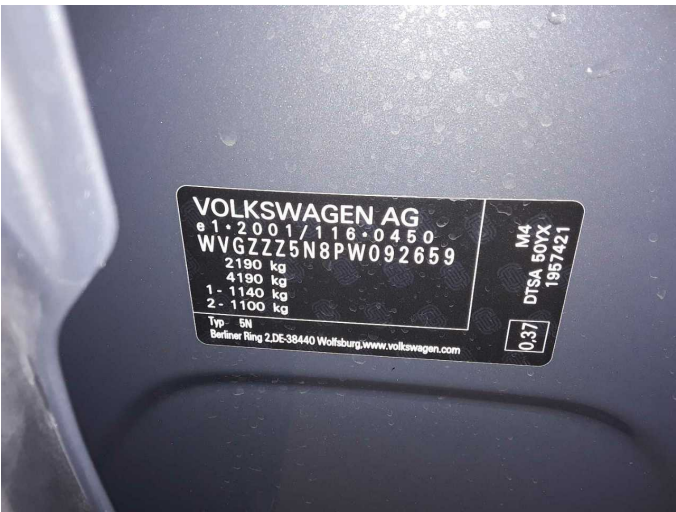


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

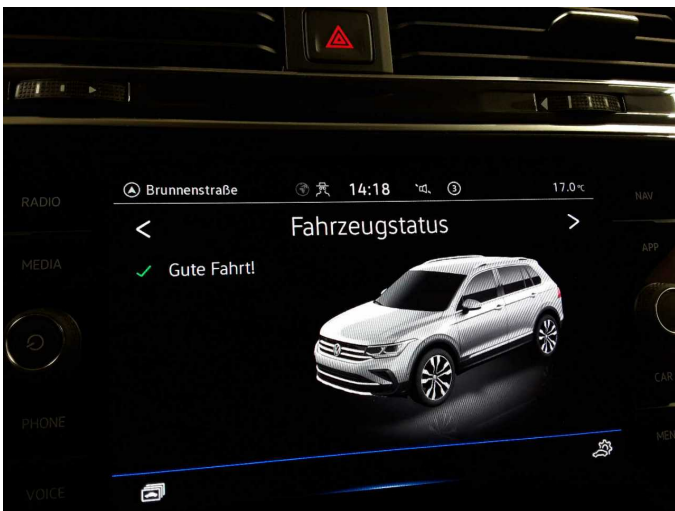


Figure 15: Documents

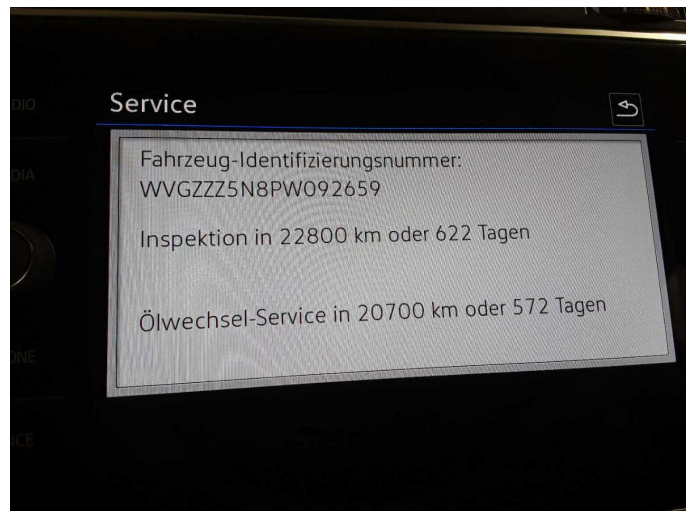


Figure 16: Documents



Figure 17: Additional tyres

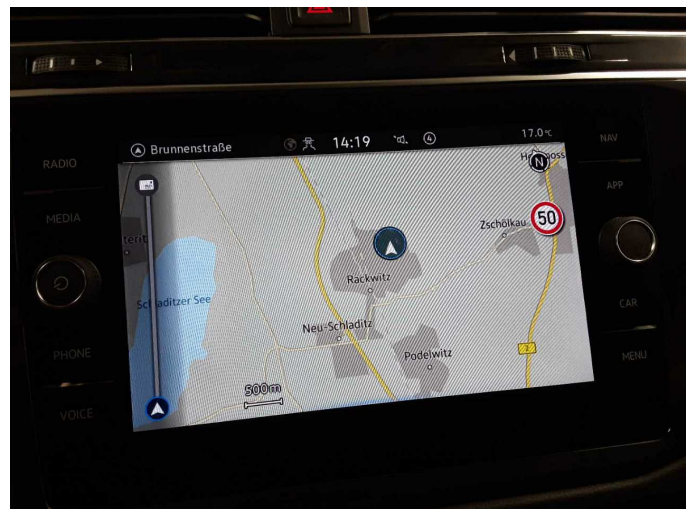


Figure 18: Navigation





Figure 19: Misc.



Figure 20: Misc.

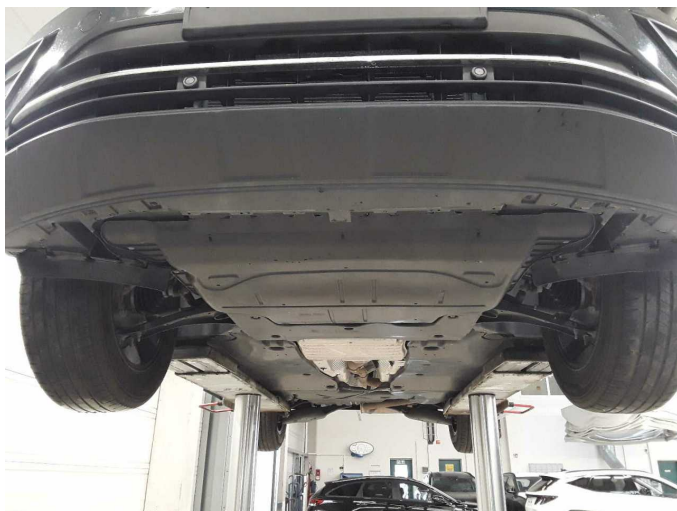


Figure 21: Misc.

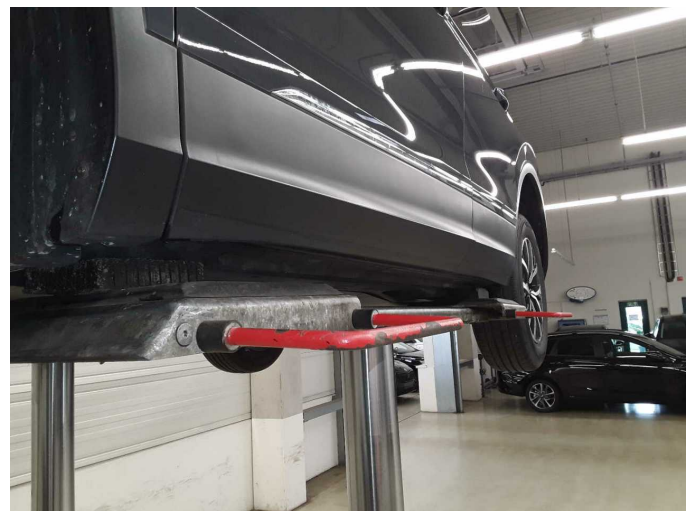


Figure 22: Misc.



Figure 23: Misc.

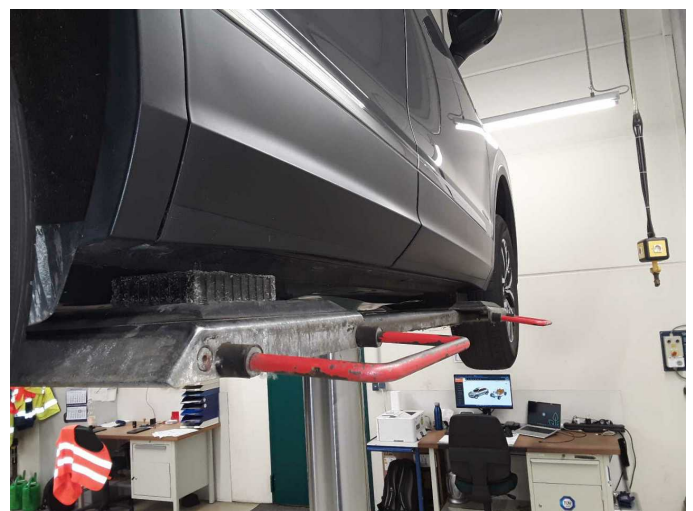


Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Figure 27: Misc.



**Damage 1:** Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

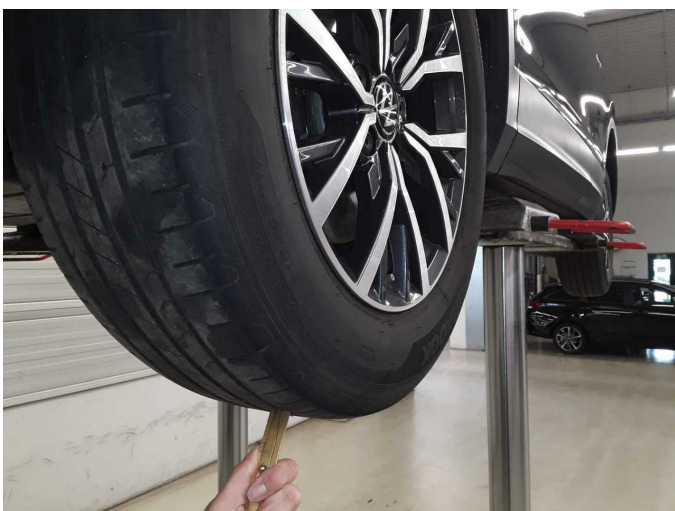

**Damage 1:** Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace




**Damage 1:** Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace







**Damage 1:** Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

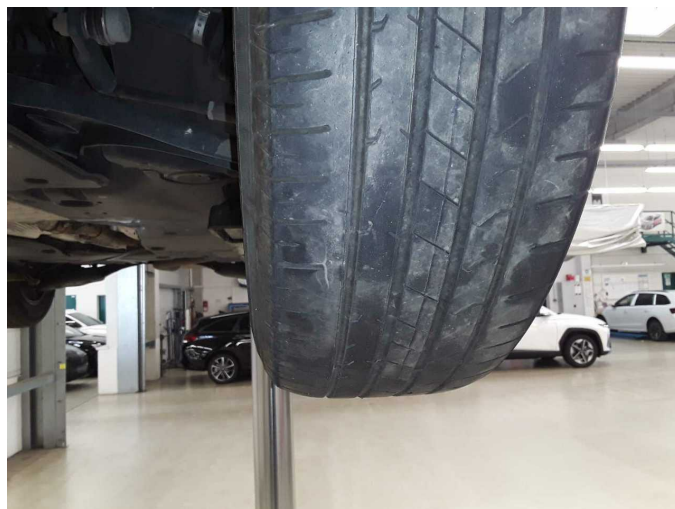


**Damage 1:** Wheel / tyres: Tyre - front - does not meet manufacturer specifications - Replace

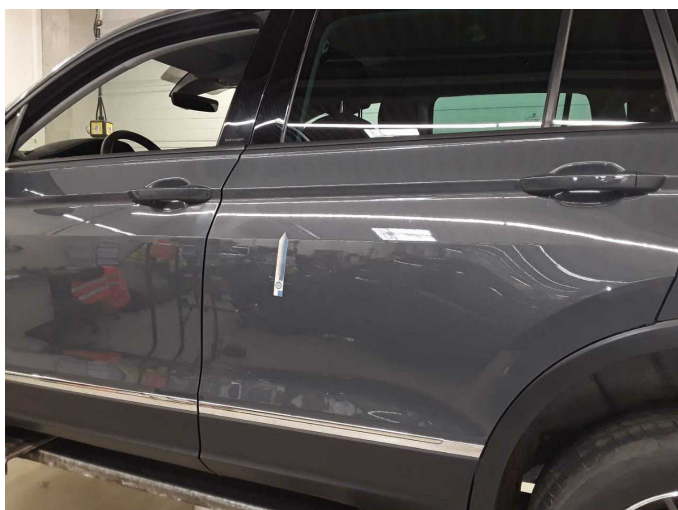

**Damage 2:** Door - rear left side: Door - Scratched - Repair and paint

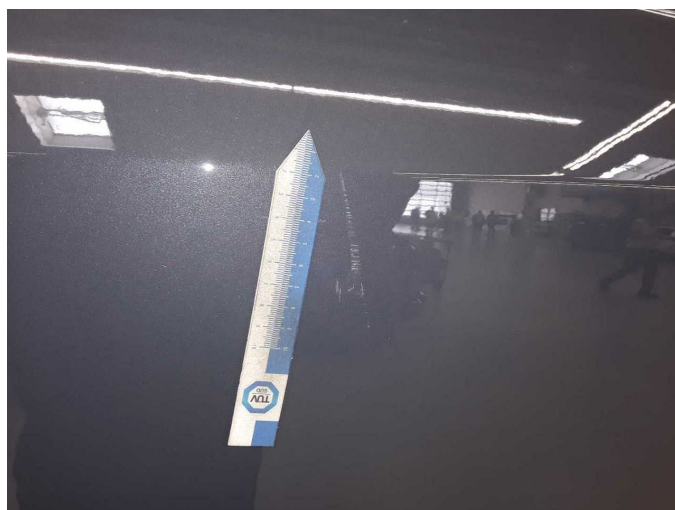

**Damage 2:** Door - rear left side: Door - Scratched - Repair and paint

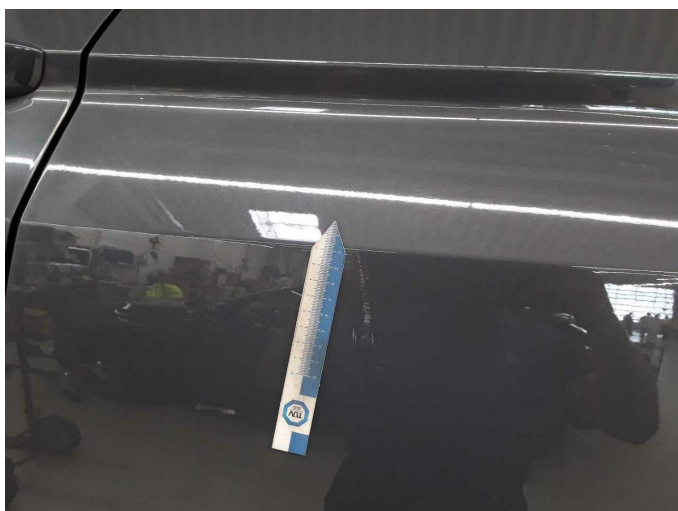


**Damage 2:** Door - rear left side: Door - Scratched - Repair and paint



**Damage 3:** Front bumper: Front bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint




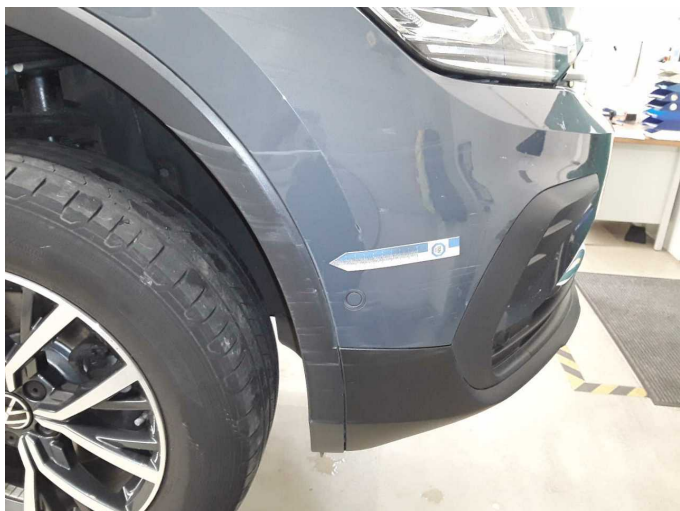


**Damage 3:** Front bumper: Front bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint



**Damage 3:** Front bumper: Front bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint

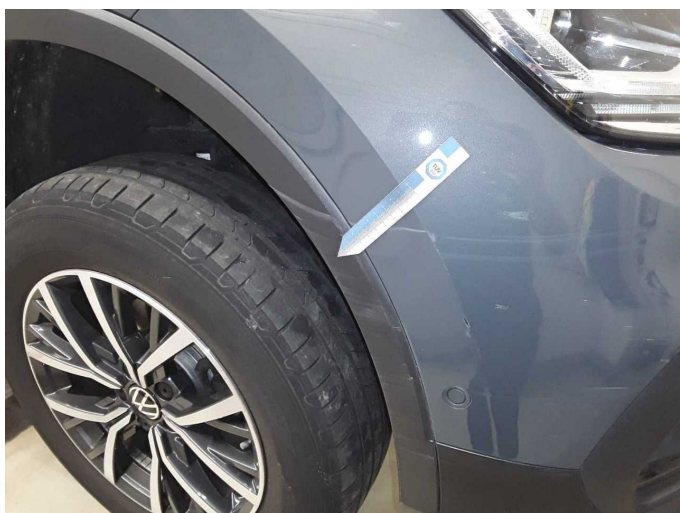

**Damage 3:** Front bumper: Front bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint

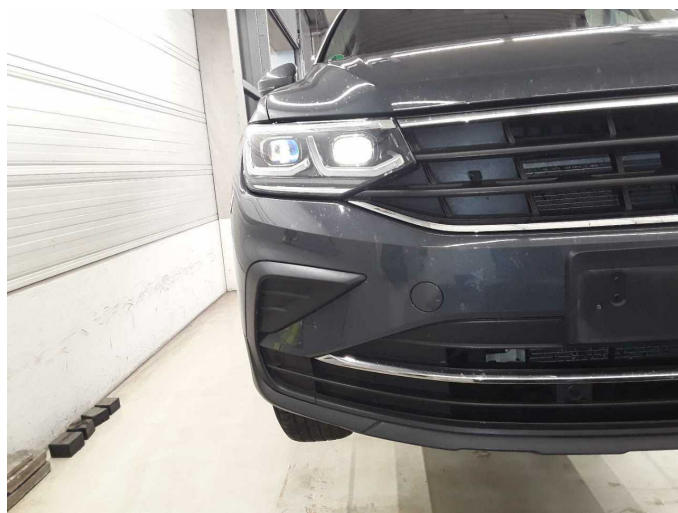

**Damage 3:** Front bumper: Front bumper (Incl. Anbauteile erneuern) - Scratched - Repair and paint



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5N8PW092659

Hersteller / Modell: VOLKSWAGEN VW Tiguan 2.0 TDI SCR Life

| Datum      | KM-Stand | Beschreibung                                                                                                                                                                                                                                                                                            |
|------------|----------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 17.03.2026 | 88.658   | Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges |
| 25.03.2025 | 58.393   | Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                                                                                        |
| 18.04.2024 | 29.396   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges                                                                                                                                                                                                                                |