



RENAULT Megane: 8297-LKC

Vinnumber:	VF1RFB00965015785	Versionname:	Limited Blue dCi 85 kW (115CV) berlina con portón
First Registrationdate:	29/09/2020	Fiscalpower:	85kW 5P manual
Expertise Mileage:	194565	Power Kw:	
Bodytype:	Berline	Body colour:	White
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Aluminium
Transmission:			
Fueltype:	Diesel		
Engine functioning:	Yes		
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		

Options

Number of keys total	2	Radio
Number keys remote	2	Central consol F
Windows electric F		Luggage cover
Windows electric R		Rear parking sensors
Cruise Control		
Steering wheel multifunctional		
Steering wheel leather		
Radio multimedia		
Type of climate control	Autom climate control	

Tyres


205/55/16/91 W				
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/55 R 16 91 W
Tyre size FR				205/55 R 16 91 W
Tyre size RL				205/55 R 16 91 H
Tyre size RR				205/55 R 16 91 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Spare wheel	Yes	Jack	Yes
Seat cover FL, Burned, Replace			



Roof liner, Burned, Acceptable

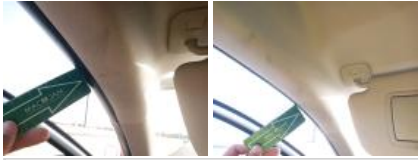

Outside rear-view mirror housing L, Scratch(es), Acceptable



Wing RL, Dent(s), Acceptable



Bumper F, Broken, Repair and paint (complete)



Headlight R, Scratch(es), Polish




Alloy rim FR, Scratch(es), Repair/replace (lump sum)



Bumper R, Scratch(es), Repair and paint (complete)



Tyres, No damage, Check

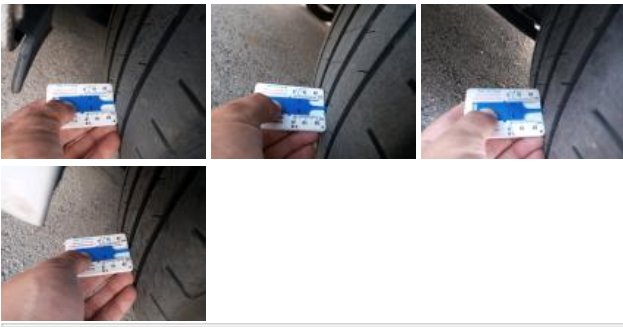

Aerial, Missing, Replace



