

## Expertise

Protocol number: 45770604  
Order No. / Reference: 26469560  
Inspection date: 3 Jun 2026

Manufacturer: Volvo

Model: XC60 T6 AWD Recharge Geartronic Inscription

VIN: LYVUZH1VDNB038383



### Vehicle details

#### Manufacturer / Type / Model / Equipment

Volvo XC60 T6 AWD Recharge Geartronic Inscription

<b>Vehicle Identification number</b>	LYVUZH1VDNB038383
<b>Mileage (Read)</b>	83,032 km
<b>First registration</b>	4 May 2022
<b>Number of holders</b>	1
<b>Next periodical technical inspection</b> (Report on hand)	06/2027

<b>Power / Engine displacement</b>	186 kw / 1,969 ccm
<b>Fuel type / Cylinder</b>	Hybr.B/E ext.auf1 / 4
<b>Gearbox / Number of gears</b>	Automatic / 8
<b>Type of drive</b>	All-wheel drive
<b>Type of vehicle</b>	SUV

<b>Colour / colour code</b>	Platinum Grey Metallic
<b>Doors / Seats</b>	5 / 5
<b>Upholstery type</b>	Leather
<b>Colour of upholstery</b>	Anthracite-Black



## Vehicle details

<b>Maintenance booklet / proof</b>	Available / complete	<b>Next maintenance in</b>	5 Tag(e)
<b>Last service on / at</b>	06/2025 at 63,279 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		<b>Letter No.</b>	GF857732
<b>Previous damage / Accident</b>	Detectable	<b>Repainting</b>	Detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	9101 / BRS 00014		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>fine dust sticker</b>	
<b>Permitted total weight</b>	2,660 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R20 105V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	255/45 R20 105V	Summer tyres on Light alloy	Michelin	5mm / 5mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105T	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	235/55 R19 105T	Winter tyres on Light alloy	Goodyear	5mm / 5mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

**Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.**

TÜV SÜD Auto Partner GmbH  
Wiesenring 2  
04159 Leipzig

Inspection location  
Hartmann Compound Professionals  
Arnoldschacht 9-11  
44894 Bochum



## Equipment



## Standard equipment

- 12-volt socket in the luggage compartment
- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Android infotainment system
- Electrically folding exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- Chrome applications in the front bumper
- CleanZone air quality system with activated carbon filter
- Roof edge spoiler
- Digital Instrumentation 2nd Gen.
- Aluminum door sill plates with Recharge lettering, front
- Electronic differential lock
- Chrome window surround
- Front grille in waterfall design in chrome
- Transmission: 8-speed Geartronic automatic transmission
- Automatic tailgate
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- Keyless Drive
- Automatic climate control with separate temperature control for driver and front passenger
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Rear center armrest (foldable)
- Package: Winter Package
- Panoramic glass sunroof with lifting function (electric)
- Upholstery: Leather/leatherette comfort seats
- Radio accessories: Digital radio reception (DAB+)
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Whiplash Protection System (WHIPS)
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- First aid kit and warning triangle
- Volvo On Call
- 12-volt connection at the front
- Acoustic Vehicle Alerting System (AVAS)
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- All-wheel drive (AWD)
- Ambient lighting
- Dashboard in leather look with contrasting stitching
- Electrically adjustable and heated exterior mirrors
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Aluminum roof rails (integrated)
- Drive Mode
- Electronic Stability Control (ESC)
- Electric windows front and rear
- Automatic emergency braking
- Luggage compartment partition net
- Google Services with navigation function
- Heated rear window
- Interior lighting
- ISOFIX mounting for the outer rear seats
- Child safety lock (rear doors)
- Headrests (5) front and rear
- Rear headrests foldable
- Charging cable Schuko/Type 2 (Mode 2)
- Cargo area roller blind
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment and cup holders
- Electric parking brake
- Radio: High Performance Sound audio system
- Radio accessories: Subwoofer
- Rain sensor
- Tire pressure monitoring system
- Wheels: Tire sealant
- Safety Assistance
- Gearshift lever made of Swedish crystal glass by Orrefors
- Speed-sensitive power steering
- Seat belts
- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Driver's seat electrically adjustable
- Start/Stop technology
- Phone: Inductive smartphone charging system
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)



- Immobiliser

- Central locking system with two remote controls and integrated emergency keys

### Extra equipment

- Towbar (semi-electric)
- Package: Connect Edition (Inscription) (Electrically adjustable passenger seat - Headlight cleaning system - Driver Assistance - Memory function for passenger seat - Full LED headlights - Front and rear parking sensors - Rearview camera - 20" 5-Y-spoke design diamond cut/graphite look with 255/45 R20 tires - Onyx Black Metallic)
- Radio: Audio system High Performance Sound Pro by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Windscreen, heater
- Package: Xenium Package (High Performance Sound Pro audio system by Harman/Kardon - 600 watts of power - 14 speakers - Fresh Air Subwoofer - Dirac Unison sound optimization; Advanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Parking camera with 360° surround view in conjunction with parking assistance or Connect Edition package
- Wheels: 20" alloy wheels, 5-Y-spoke design, diamond cut/graphite look (tires 255/45 R20 with rims 8 x 20")
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)

### Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

### Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats (VL) - Holes - Replace
2	Equipment	Tirefit filler - Expired - Replace
3	Wing mirror - left side	Cap - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
5	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
6	Bonnet	Insulation lining - Missing - Replace
7	Trim / covers	Door trim - front left side - Broken / torn - Replace
8	Boot lid / rear door	Boot lid (Vogelkotverätzung) - Paint defect - Paint

### Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

### Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 16 Jul 2023	2.826,19 €
2	Side - left, Provided by user / customer, from 21 Jul 2025	5.867,32 €



## Repainting

### No. Repainting

1 Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

## Paint coat thickness measurement

Door - rear left side 171  $\mu\text{m}$  |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

Der beiliegende Radsatz gehört nicht zur Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

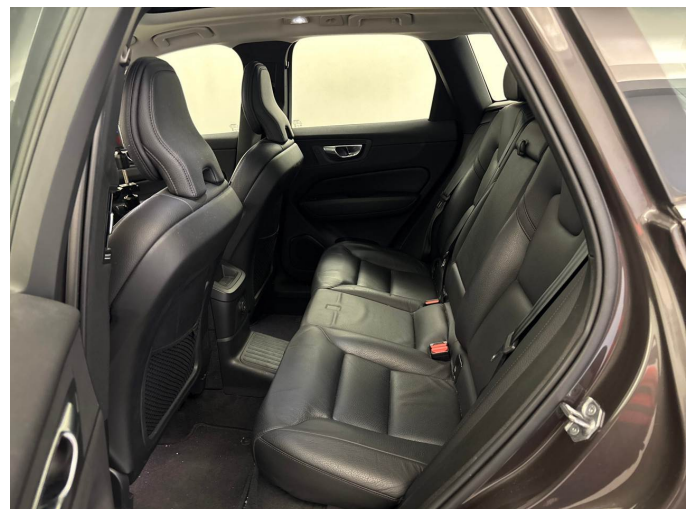


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

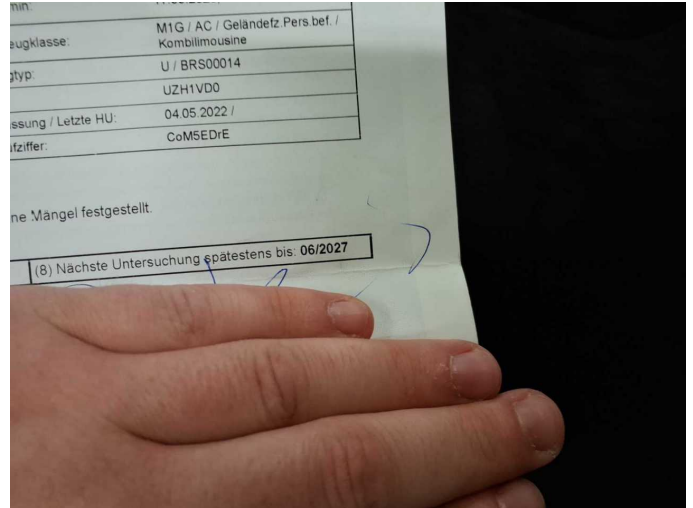


Figure 14: Documents

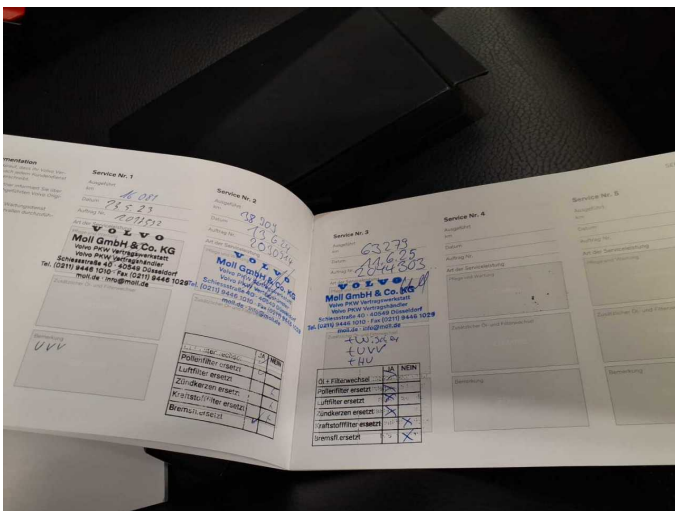


Figure 15: Documents



Figure 16: Additional tyres

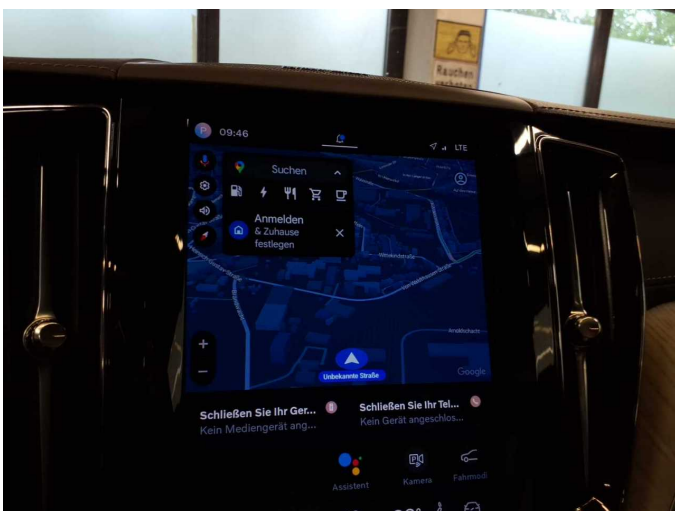


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

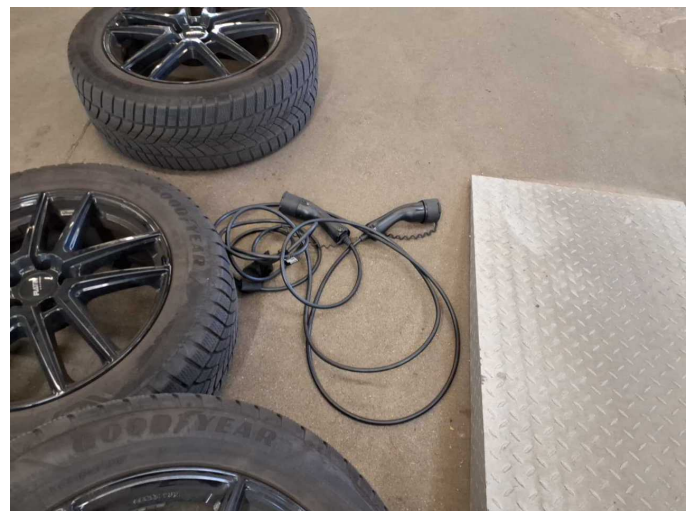


Figure 24: Misc.



Figure 25: Misc.

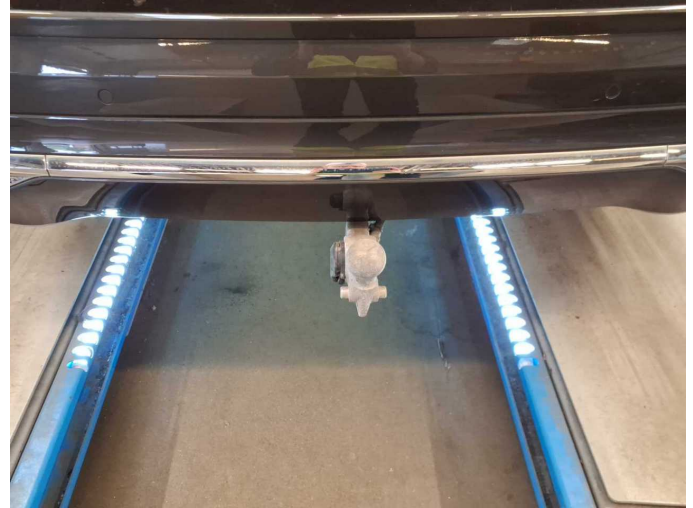


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

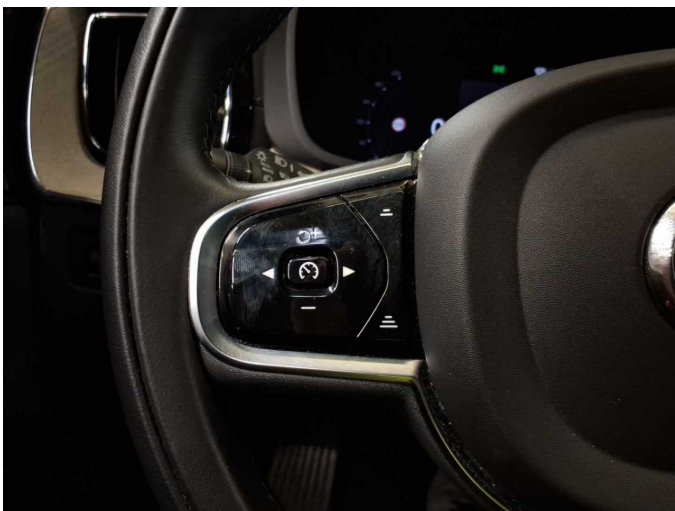


Figure 35: Misc.

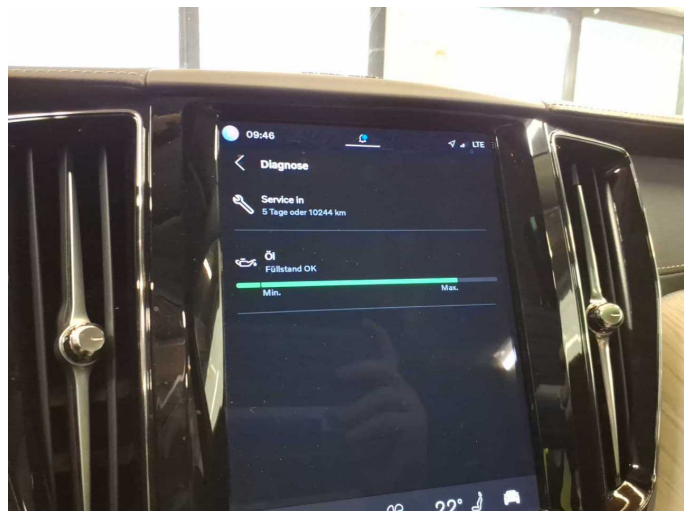


Figure 36: Misc.




Figure 37: Misc.



Figure 38: Misc.



Damage 1: Trim / covers: Floor mats (VL) - Holes - Replace

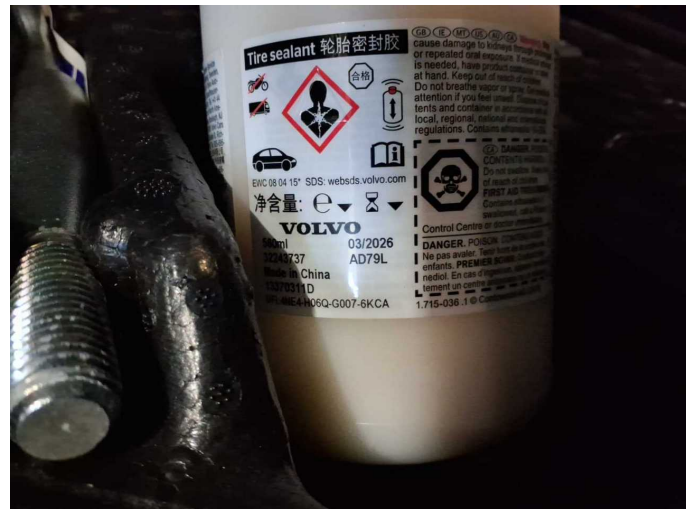

Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Wing mirror - left side: Cap - Scratch(es) - Smart repair



**Damage 4:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



**Damage 4:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




**Damage 4:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value

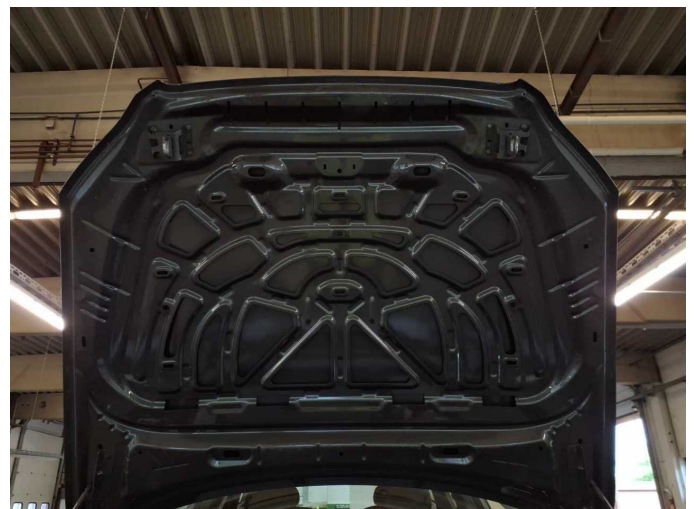

**Damage 6:** Bonnet: Insulation lining - Missing - Replace



**Damage 7:** Trim / covers: Door trim - front left side - Broken / torn - Replace



**Damage 8:** Boot lid / rear door: Boot lid (Vogelkotverätzung) - Paint defect - Paint



**Damage 8:** Boot lid / rear door: Boot lid (Vogelkotverätzung) - Paint defect - Paint



**Repainting 1:** Door - rear left side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: LYVUZH1VDNB038383

Hersteller / Modell: VOLVO VOLVO XC60 T6 AWD Recharge Geartronic Inscription

Datum	KM-Stand	Beschreibung
11.06.2025	63.276	Bremse Sonstiges; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
13.06.2024	38.306	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
23.05.2023	16.081	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges