



Expertise

Protocol number: 46852213
Order No. / Reference: 26811425
Inspection date: 3 Aug 2026

Manufacturer: Skoda
VIN: TMBJH8NZ0RC013250

Model: Superb Combi 2.0 TDI DSG L&K



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG L&K	
Vehicle Identification number	TMBJH8NZ0RC013250
Mileage (Read)	180,481 km
First registration	28 May 2024
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Cobalt Blue/Reef blue (B5K)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Light grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	477 Tag(e)
Last service on / at	07/2026 at 179,565 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HE249190
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AXZ 00020		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,241 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 98Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/45 R18 98Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99V	Winter tyres on Light alloy	Pirelli	3mm / 3mm
2)	215/60 R16 99V	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments in the front door panels with 1.5l bottle holders
- Airbag, driver and passenger
- Airbag: Side airbags, front center airbag and front and rear head airbags
- Trailer hitch preparation including trailer stabilization
- Anti-lock braking system (ABS)
- Attention and fatigue assistant
- Exterior mirrors and door handles in body color
- Cup holders in the front center console
- Hill start assist
- third brake light
- Four roof grab handles (rear with coat hooks, ticket holder on the windshield)
- Diesel particulate filter
- Digital rotary controls (Smart Dials)
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Luggage compartment lighting with 2 lamps
- Cruise control system including speed limiter (speed limiter)
- Rear window wiper including windshield washer system
- Interior mirror with automatic dimming function (Automatic interior mirror dimming with rain and light sensor)
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (3-zone) (separately adjustable for driver, front passenger and rear passengers)
- Paint finish: Solid
- LED footwell lighting front and rear
- electric auxiliary air heater
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Package: Chrome (Combi) (Window trim strips and radiator grille ribs in chrome - Radiator grille frame and front bumper trim strip in Unique Dark Chrome - Roof rails silver anodized)
- Package: Infotainment (Navigation system - 13" infotainment display - Display cleaner - Infotainment Online (3-year subscription))
- Package: Light & Sight (Matrix LED headlights with Light Assist and Welcome Effect - Dynamic High Beam Assist - Dynamic and automatic headlight range control - LED rear reflectors with dynamic turn signals, crystal design and Welcome Effect - Rear fog lights on both sides, reversing lights on both sides - Cornering and rough road lights)
- Package: Winter (Heated front seats and outer rear seats - Heated leather steering wheel with multifunction buttons and paddle shifters - Wireless heated windscreen)
- Phone box with charging function 15 W
- Proactive occupant protection with rear impact detection
- Storage pockets on the backs of the front seats including smartphone pockets
- Airbag, driver's knee airbag
- Ambient lighting (dashboard, front and rear trim strips, footwell with selectable color climate) in the interior as well as LED safety warning lights in the front and rear doors)
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors with boarding spots (memory function - automatic dimming (driver's side))
- Hydraulic brake assist (HBA)
- Cargo elements in the trunk
- Grey headliner
- Roof rails, black
- Digital Cockpit Plus
- Ice scraper in the fuel filler flap
- Electronic transverse differential lock (XDS+)
- Electric windows front and rear, including anti-pinch protection and electric child safety lock
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Interior LED lights at the front with 2 reading lights, 2 reading lights at the rear
- Interior Design Selection Suite L&K Black (dashboard in black - headliner in grey - door trim in black with soft touch - seat covers in perforated black leather with Laurin & Klement logo, seat bolsters in black)
- Rear headrests (3), height adjustable
- Front headrests, height and length adjustable
- Stainless steel loading edge
- Remote release of the rear seat backrests in the trunk
- Center armrest with storage compartment and 12-volt socket
- Multifunctional camera (for driver assistance systems)
- eCall+ emergency call function
- Package: Drive Plus (Adaptive chassis DCC Plus - Driving profile selection - Progressive steering)
- Package: EU-NCAP (Bumpers with enhanced and predictive pedestrian protection measures - Traffic sign recognition - Emergency Steering and Turn Assist - Crossroad Assist - Front radar assist including City Emergency Braking and pedestrian and cyclist detection - Intelligent Speed Assist (ISA) - Lane Assist - Side Assist and Exit Warning)
- Package: Transport (Combi) (Luggage compartment net program (3 nets) - Luggage compartment cover with flexible storage pocket with electric roller blind release - Comfort opening with electric tailgate operation - KESSY - Anti-theft alarm system including safe system with interior monitoring and tilt sensor)
- Front and rear parking sensors with maneuvering brake function
- Radio accessories: 2 USB charging ports in the center console (and 2 on the back of the front center armrest (Type-C) 45 W)



- Radio accessories: Bluetooth hands-free system
- Radio accessories: CANTON sound system with 14 speakers (12 speakers, 1 center speaker, 1 subwoofer) - including steel spare wheel)
- Radio accessories: Wireless & Wired SmartLink (Apple CarPlay - Android Auto)
- Umbrella and broom compartments in the front doors
- Tire pressure monitoring
- Tire mobility kit (tire repair spray incl. compressor)
- Rear view camera
- Electromechanical power steering
- LED safety lights in the front and rear doors
- Seats: Heated front seats
- Seats: Ergo Comfort front seats (fully electrically adjustable - extended massage function - memory function - adjustable lumbar support - entry aid - extendable leg rest - seat ventilation)
- 12V power outlet in the luggage compartment
- Daytime running lights with cornering lights and coming home function
- Glazing: Acoustic glazing in the front side windows and Sunset (dark tinted rear window and rear side windows)
- Electronic immobilizer

Extra equipment

- Swiveling trailer hitch including trailer stabilization
- Paint finish: Metallic
- Package: Infotainment Plus (Navigation system - 13" infotainment display - Display cleaner - Head-up display - Infotainment Online (3-year subscription))
- Auxiliary heater with radio remote control

- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB charging port in the rearview mirror (15W)
- Umbrella
- Rain sensor and driving light assistant ((Easy Light Assist) (Tunnel light, Coming Home, Leaving Home))
- Wheels: 18" Belatrix alloy wheels, diamond-turned anthracite (8Jx18 tires 235/45 R18 94)
- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)
- Seats: Rear seat backrest split 60:40, foldable with center armrest
- Sun visors with illuminated make-up mirror on driver and passenger side
- Sunset (rear window and rear side windows tinted dark)
- Textile floor mats
- Front door sill trims
- Lashing eyes in the luggage compartment
- Preparation for alcohol immobilizer
- Central locking accessories: 3rd vehicle key

- Luggage net partition
- Package: Driving Assistance Plus (Travel Assist Plus: - Adaptive Cruise Control ACC (control range up to 210 km/h, cruise control system omitted) - Adaptive Lane Keeping Assist (Lane Assist +) - Traffic Jam and Emergency Assist - Intelligent Park Assist, front and rear parking sensors - Trained Park Assist - 360° Surround View Cameras)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Body	Underbody panelling - Scratched - Replace
2	Roof	Roof (Harz,Mehrkosten möglich) - Soiled - Conditioning
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Door - rear right side	Door - Scratch(es) - Smart repair
5	Sill - right side	Sill - dent(s) - Smart repair
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
8	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
9	Sill - left side	Sill - Deformed - Repair and paint
10	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
11	Bonnet	Bonnet - Scratch(es) - Paint
12	Front bumper	Front bumper - Deformed - Repair and paint
13	Vehicle glazing	Windscreen (Randbereich) - Stone chips - repair according to calculation

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres (Profiltiefe 3mm) - Does not meet the leasing specifications - No deduction
2	Trim / covers	Door trim - rear left side - Soiled - No deduction
3	Door - front right side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

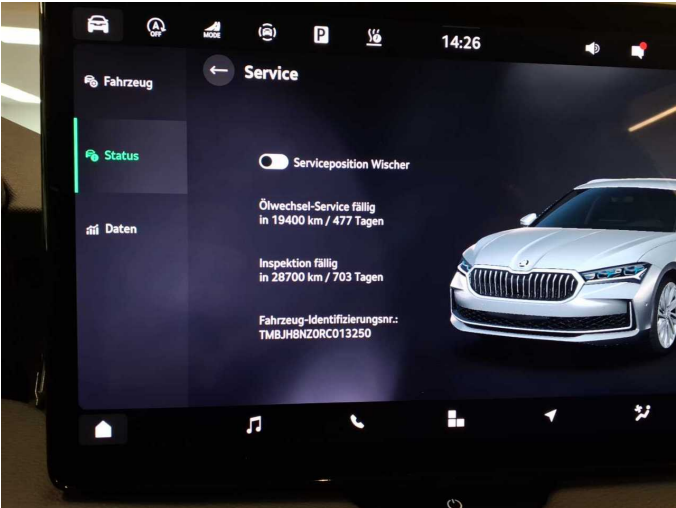


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

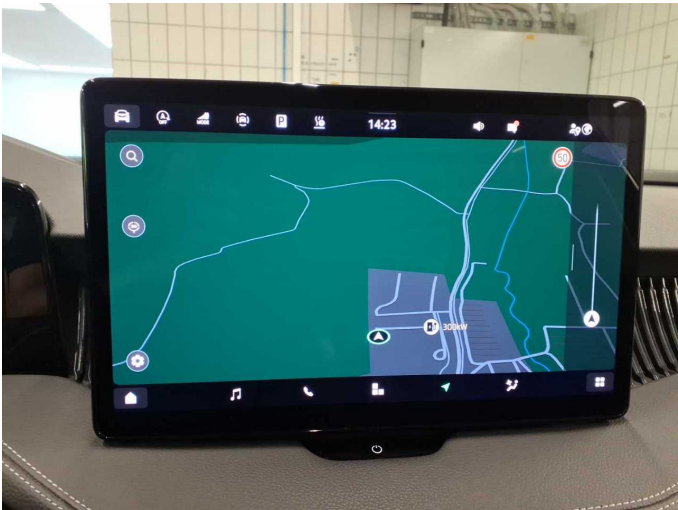


Figure 16: Navigation

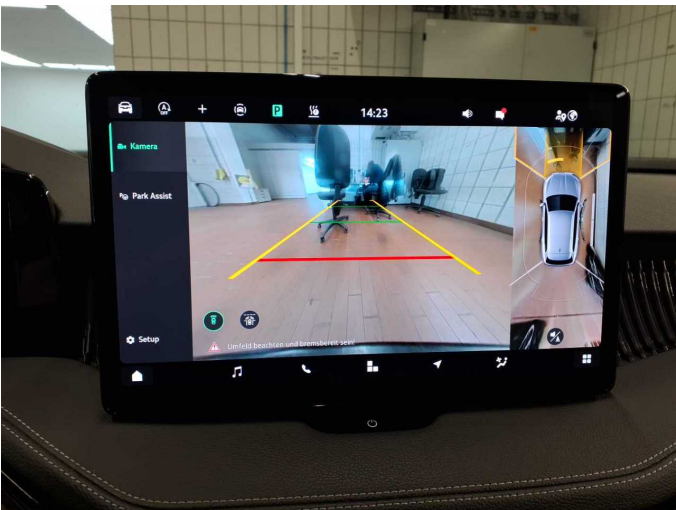


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

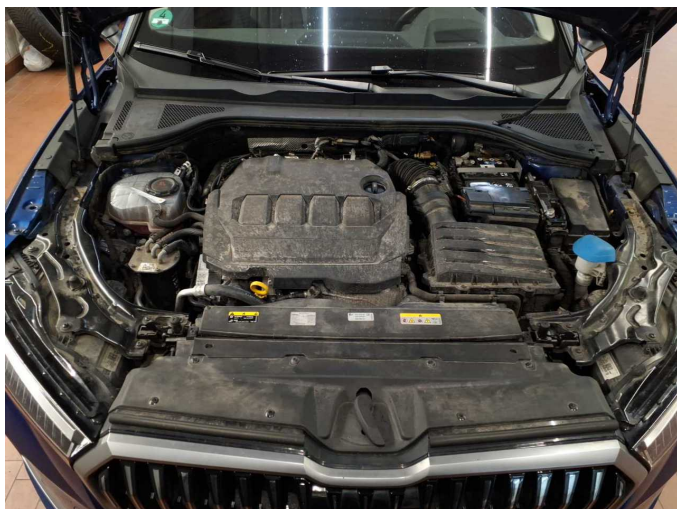


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Body: Underbody panelling - Scratched - Replace




Damage 1: Body: Underbody panelling - Scratched - Replace



Damage 1: Body: Underbody panelling - Scratched - Replace



Damage 1: Body: Underbody panelling - Scratched - Replace

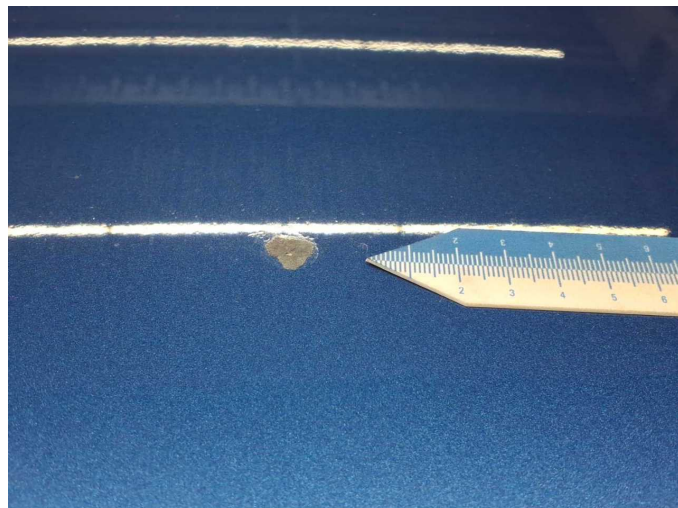


Damage 2: Roof: Roof (Harz,Mehrkosten möglich) - Soiled - Conditioning

Damage 2: Roof: Roof (Harz,Mehrkosten möglich) - Soiled - Conditioning



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair

Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair

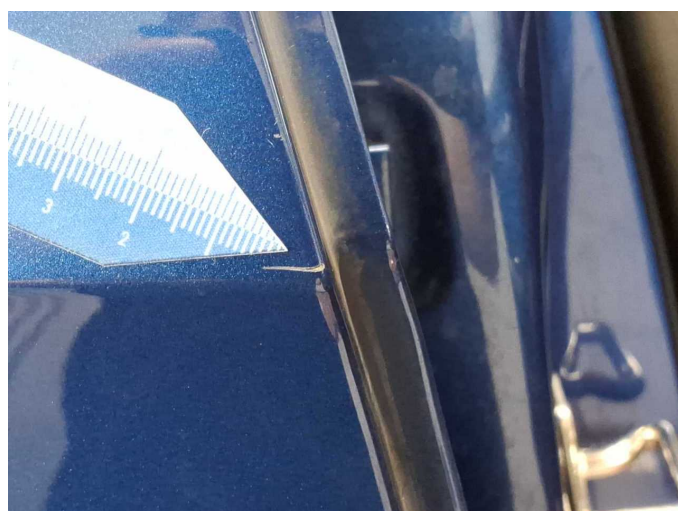

Damage 4: Door - rear right side: Door - Scratch(es) - Smart repair

Damage 4: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 5: Sill - right side: Sill - dent(s) - Smart repair




Damage 5: Sill - right side: Sill - dent(s) - Smart repair



Damage 5: Sill - right side: Sill - dent(s) - Smart repair




Damage 5: Sill - right side: Sill - dent(s) - Smart repair

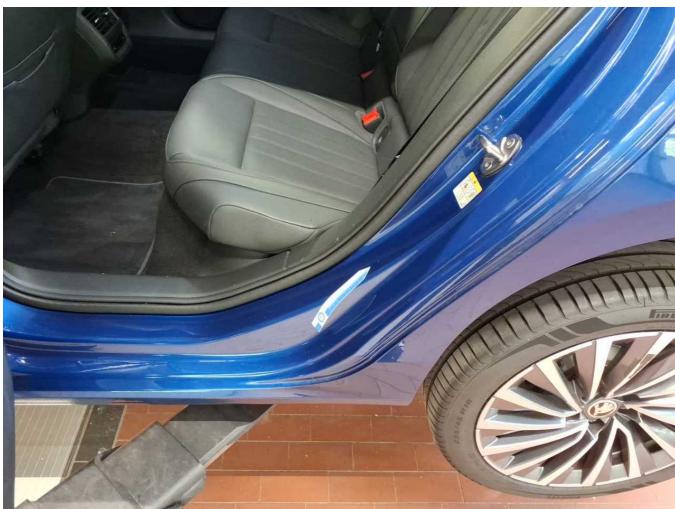

Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

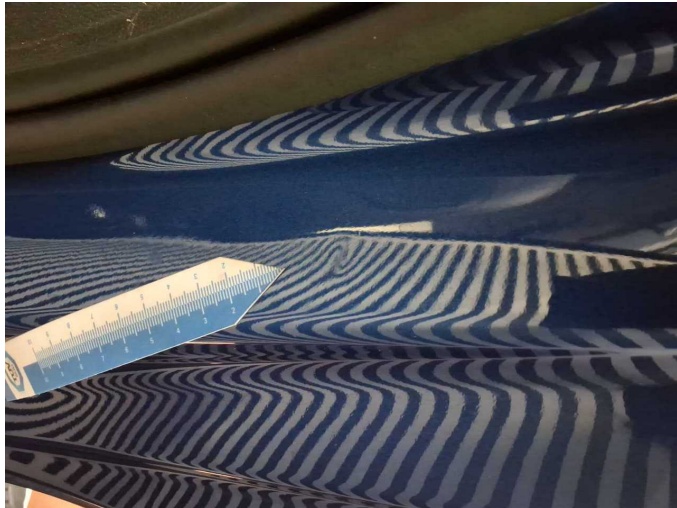


Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 8: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 8: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value

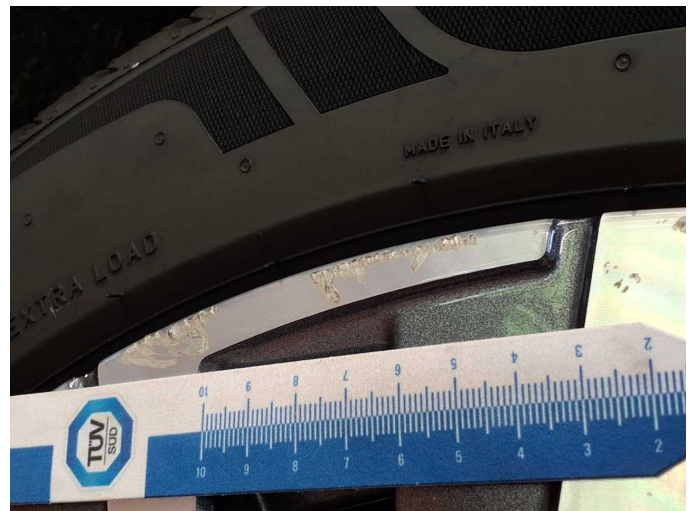

Damage 8: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 9: Sill - left side: Sill - Deformed - Repair and paint



Damage 9: Sill - left side: Sill - Deformed - Repair and paint



Damage 9: Sill - left side: Sill - Deformed - Repair and paint



Damage 9: Sill - left side: Sill - Deformed - Repair and paint



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 11: Bonnet: Bonnet - Scratch(es) - Paint




Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Deformed - Repair and paint



Damage 12: Front bumper: Front bumper - Deformed - Repair and paint

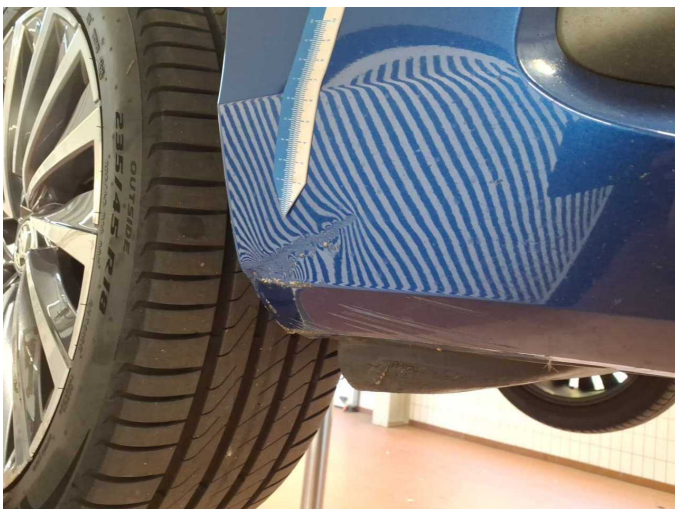


Damage 12: Front bumper: Front bumper - Deformed - Repair and paint



Damage 12: Front bumper: Front bumper - Deformed - Repair and paint



Damage 13: Vehicle glazing: Windscreen (Randbereich) - Stone chips - repair according to calculation

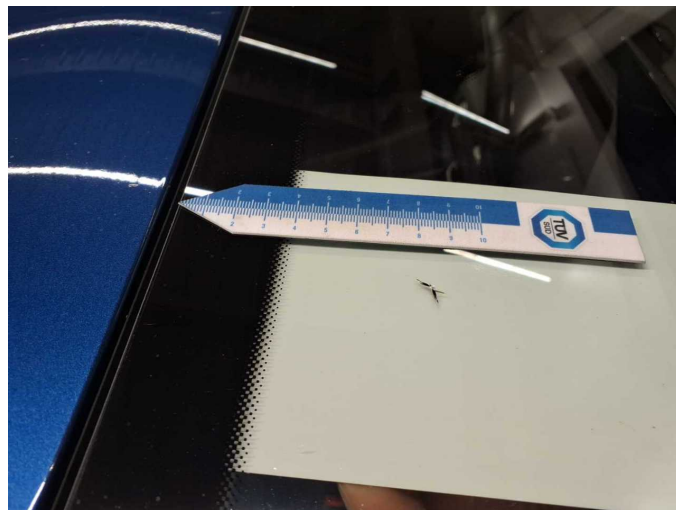

Damage 13: Vehicle glazing: Windscreen (Randbereich) - Stone chips - repair according to calculation



Damage 13: Vehicle glazing: Windscreen (Randbereich) - Stone chips - repair according to calculation



Wear and tear 2: Trim / covers: Door trim - rear left side - Soiled - No deduction



Wear and tear 2: Trim / covers: Door trim - rear left side - Soiled - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJH8NZ0RC013250
Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG L&K

Datum	KM-Stand	Beschreibung
14.07.2026	179.565	Motoröl b. Wartung; Ölfilter ern; Reparatur Sonstiges; Systemtest/ Eigendiagnose; Turbolader ern; Wartung Sonstiges
06.07.2026	179.126	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben hinten; Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zahnriemen/Steuerkett ern
25.02.2026	150.342	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.10.2025	121.097	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.06.2025	89.512	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.02.2025	60.168	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.12.2024	48.830	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
13.09.2024	29.236	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges