



Expertise

Protocol number: 46080236
Order No. / Reference: 26328391
Inspection date: 22 Jun 2026

Manufacturer: Opel
VIN: VXKUHZKXZP4042903

Model: Corsa-e Elegance



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Corsa-e Elegance	
Vehicle Identification number	VXKUHZKXZP4042903
Mileage (Read)	34,021 km
First registration	24 Apr 2023
Number of holders	1
Power / Engine displacement	57 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Kristall Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Blue-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	11,100 km
Last service on / at	01/2025 at 20,152 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS820042
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / ABX 00036		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	1,920 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 87H	Winter tyres on Steel rim with wheel cover	Fulda	6mm / 6mm
2)	195/55 R16 87H	Winter tyres on Steel rim with wheel cover	Fulda	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91H	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	195/55 R16 91H	Summer tyres on Light alloy	Michelin	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (storage compartment in the center console, front and rear - cup holder in the center console - glove compartment - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 0.5-liter beverage bottles)
- Active Pedestrian Warning System (AVAS)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- On-board computer
- Braking system: Regenerative
- Electronic brake force distribution (EBD)
- Driver information display 7", color (fully digital)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection
- Intelligent speed control and limiter
- Transmission: Automatic electric drive with fixed gear ratio
- Back window, heater
- Rear window wiper (with intermittent function)
- Child safety lock in the rear doors, manual
- Automatic climate control (recirculation mode, manual - automatic air distribution - sun position sensor - activated carbon filter - rear footwell heating)
- LED headlights (LED daytime running lights - high beam assist - LED turn signals in exterior mirrors)
- Steering column, height and reach adjustable
- Headlight range adjustment, manual
- Center armrest with storage compartment in front
- Driver fatigue detection (Based on steering behavior and driving time, it detects signs of possible driver fatigue and issues a visual and audible warning (3-stage warning).)
- Electric parking brake
- Pollen filter
- Quickheat rapid heating system
- Radio: Multimedia radio with 7" color touchscreen display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, phonebook and call list display, smartphone integration via Apple CarPlay, Android Auto, voice control (e.g., navigation (Google Maps, Apple Maps), music, phone, reading and dictating text messages), 1 USB port in the center console, front, DAB+ digital radio reception, steering wheel controls, 6 speakers)
- Visibility equipment (rain sensor, front - automatic dimming headlights with tunnel detection - interior rearview mirror, automatically dimming)
- Seats: Rear seat backrest split 60:40, foldable
- 12V power outlet in the center console, front
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Adaptive brake light
- Airbag: Front airbags, driver and front passenger (front passenger airbag can be manually deactivated)
- Airbag: Front and rear head airbags
- Airbag: Side airbag for driver and front passenger side (side airbag, front passenger, deactivatable)
- Ambient lighting, front doors
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable - exterior mirror housing in black)
- third brake light
- Headliner, Grey
- Electronic Stability Program Plus (ESP Plus)
- Driving modes: 3 adjustable (ECO, Normal and Sport)
- Front collision warning with automatic emergency braking and pedestrian detection (Active between 5 and 85 km/h. Monitors the distance to the vehicle ahead; if the vehicle approaches a vehicle or pedestrian too quickly, the driver is alerted by a warning tone and a display in the driver information screen. In case of a collision risk, the braking system is prepared and, if necessary, emergency braking is initiated to minimize the consequences of a potential collision.)
- Headrests (5) (Height adjustable)
- Charging cable: Mode 2 charging cable (Type 2, up to 1.8 kW - for household sockets - 6 meters length)
- Steering wheel made of vegan synthetic leather, flattened at the bottom.
- Lithium-ion battery (50 kWh storage capacity)
- myOpel App, with Corsa-e specific functions (battery charge level indicator and range monitoring - remote control of climate control and charging settings)
- Onboard charger (vehicle-integrated charging unit, single-phase (7.4 kW))
- Upholstery: Fabric/Premium Leather Look Combination (Comfort passenger seat, 6-way manually adjustable (length, height, backrest angle) - pockets on front seat back)
- Tire pressure warning
- Wheels: 6.5 J x 16 alloy wheels in 5-spoke design in silver/black (low rolling resistance tires 195/55 R16)
- Keyless Start system
- Power steering (speed-dependent)
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Seats: Comfort driver's seat (6-way manually adjustable (length, height, backrest angle))
- Lane Keeping Assist (warning in case of unintentional lane departure (between 65 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Pre-installation for ISOFIX child seat mounting system (on the front passenger seat)



- Ambient lighting
- Traffic sign recognition (recognition of speed limits and their cancellation, as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions))
- Immobiliser
- Heat-insulating glazing, tinted

- Pre-wiring for child seat mounting system "ISOFIX" (rear outer)
- Central locking with remote control

Extra equipment

- Paint finish: Metallic
- Navigation system: Multimedia navigation system with 7" color touchscreen display (Multimedia radio, automatic music recognition, Bluetooth hands-free system, Apple CarPlay, Android Auto, voice control, 1 USB port, DAB+, steering wheel remote control, navigation system, road map of Europe (including Russia and Turkey), 3D map display, dynamic route guidance, display of points of interest, tour planning, GPS module, charging station display, OpelConnect, including live navigation services, real-time traffic information, online POI search, map updates (via USB))
- Charging cable: Mode 3 charging cable, 3-phase (for public charging (11 kW))
- Onboard charger (vehicle-integrated charging unit, 3-phase (11 kW))
- Park & Go Plus (180-degree panoramic reversing camera - Park Pilot, front and rear parking aid with audiovisual warning - blind spot warning and side protection - electrically folding exterior mirrors)
- Heated seats for driver and front passenger (multi-stage adjustable)
- winter tires

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Wheel / tyres	Wheel cover - front right side - Broken / torn - Replace
3	Wheel / tyres	Wheel cover - front left side - Broken / torn - Replace
4	Wheel / tyres	Wheel cover - rear right side - Broken / torn - Replace
5	Wheel / tyres	Wheel cover - rear left side - Scratch(es) - Replace
6	Roof	Stub aerial - Damage caused by marten / rodent - Replace
7	Wing mirror - right side	Cap - Scratch(es) - Smart repair
8	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
9	2nd wheel set	2 alloy rims - Scratch(es) - Loss in value
10	Front bumper	Front bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Accident damages

No. Accident

1 Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

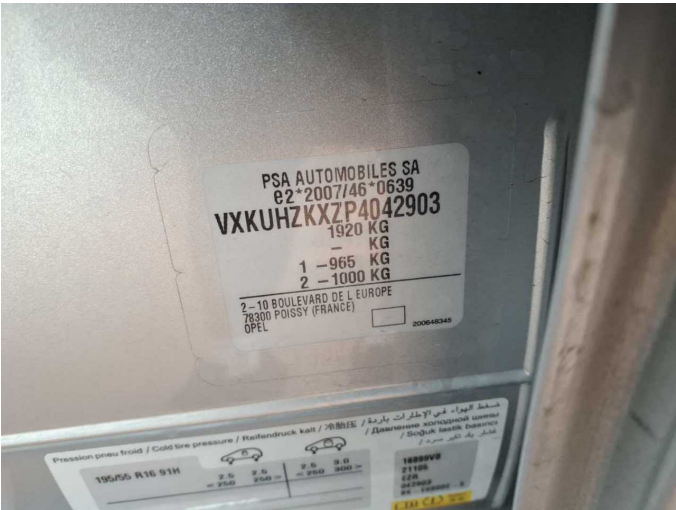


Figure 11: VIN

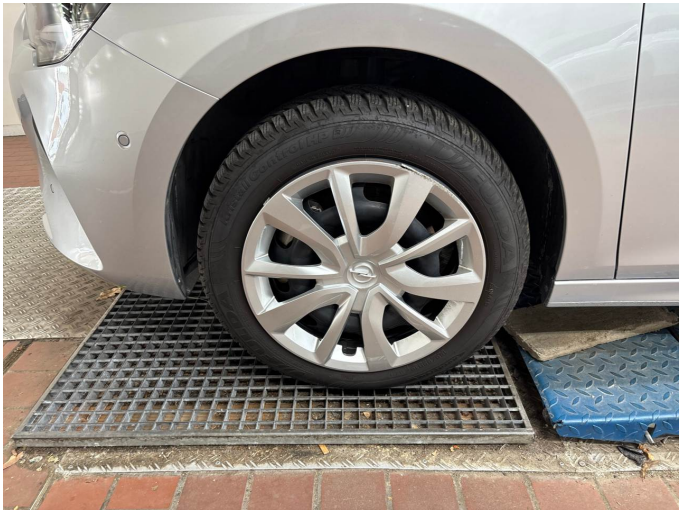


Figure 12: Mounted tyres



Figure 13: Documents

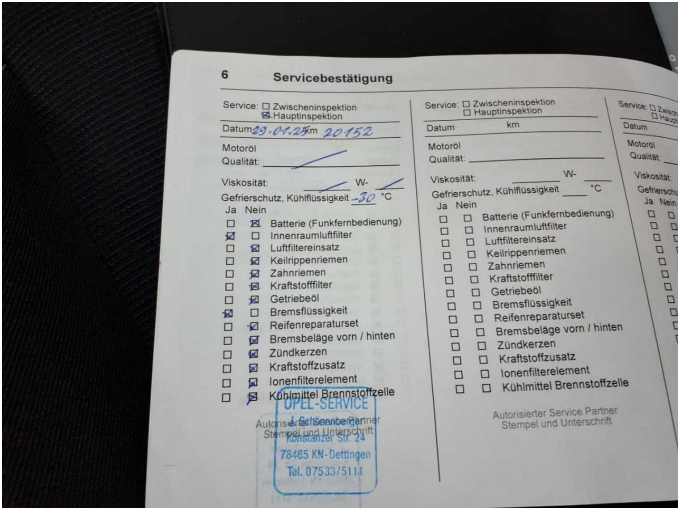


Figure 14: Documents

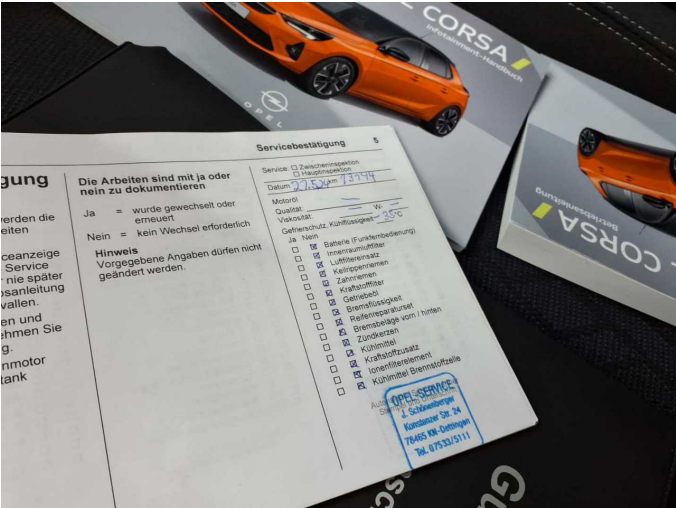


Figure 15: Documents

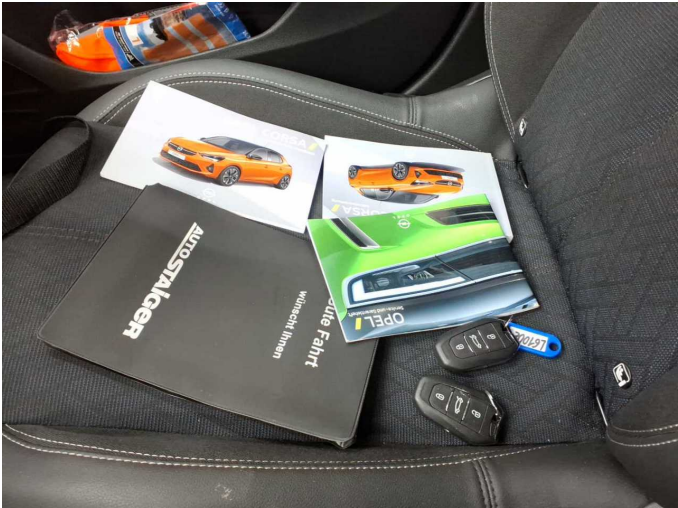


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

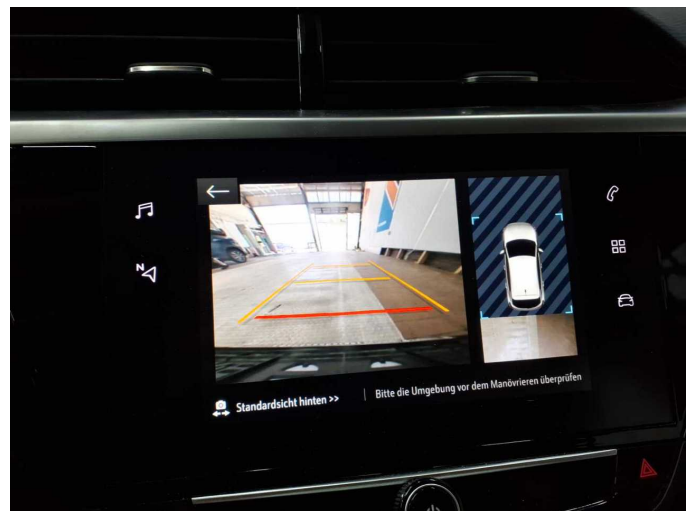


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

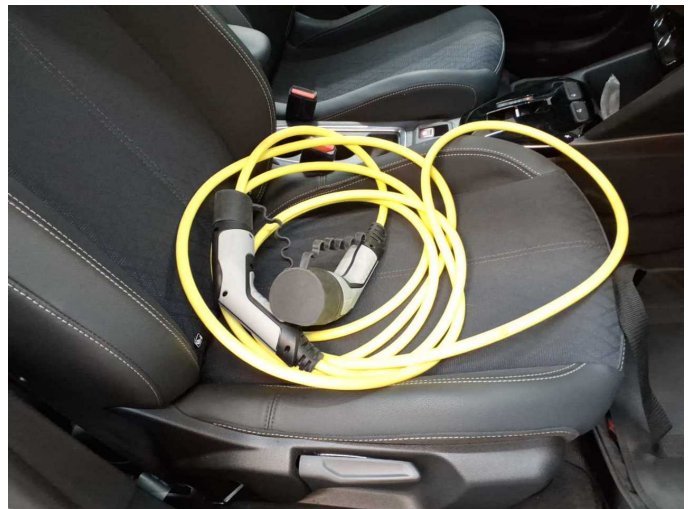


Figure 28: Misc.

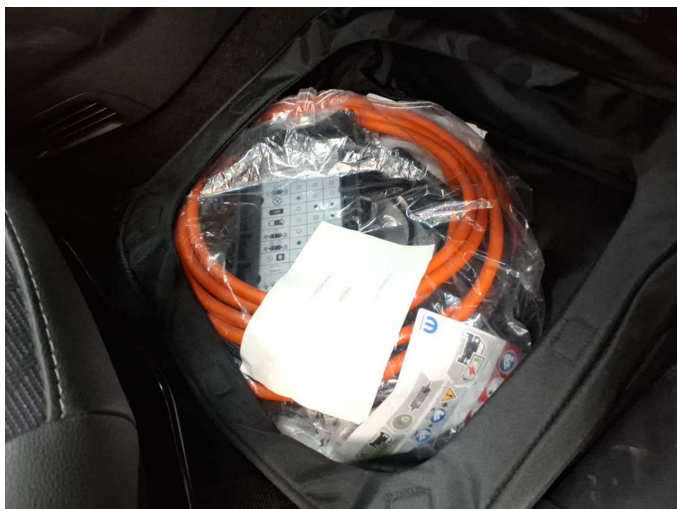


Figure 29: Misc.

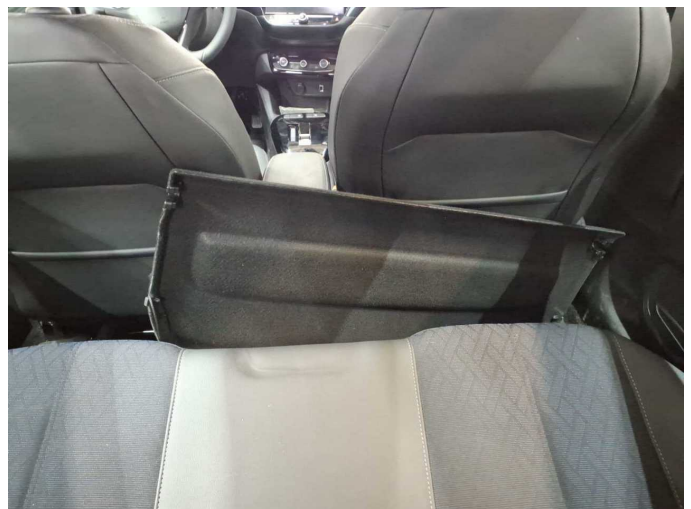


Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.

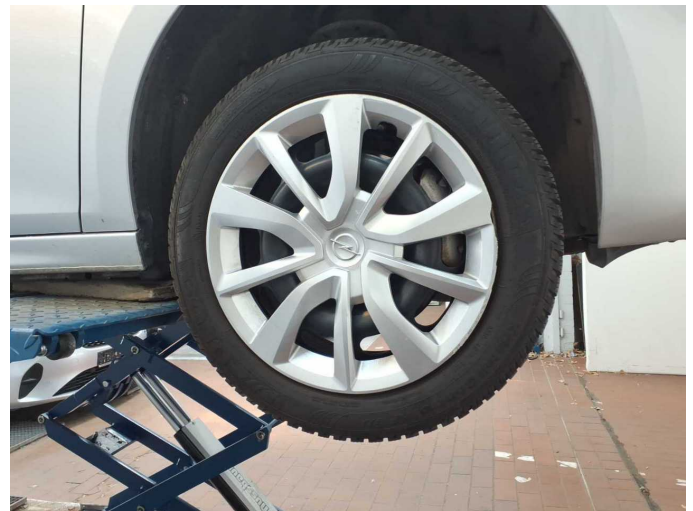

Damage 2: Wheel / tyres: Wheel cover - front right side - Broken / torn - Replace



Damage 2: Wheel / tyres: Wheel cover - front right side - Broken / torn - Replace

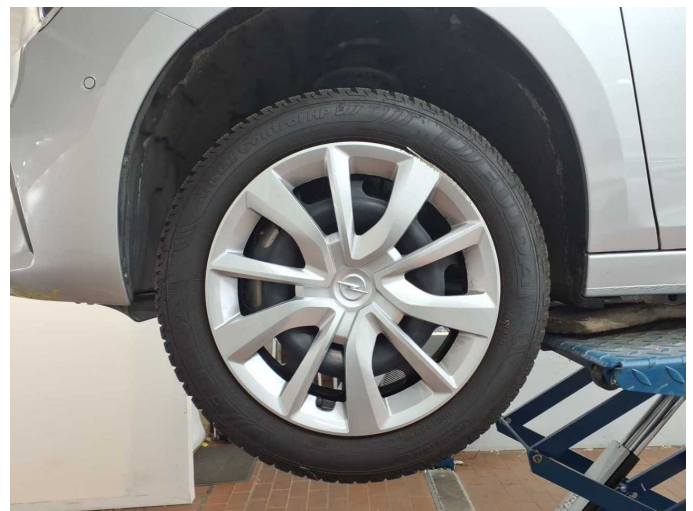

Damage 3: Wheel / tyres: Wheel cover - front left side - Broken / torn - Replace



Damage 3: Wheel / tyres: Wheel cover - front left side - Broken / torn - Replace



Damage 4: Wheel / tyres: Wheel cover - rear right side - Broken / torn - Replace



Damage 4: Wheel / tyres: Wheel cover - rear right side - Broken / torn - Replace



Damage 5: Wheel / tyres: Wheel cover - rear left side - Scratch(es) - Replace



Damage 5: Wheel / tyres: Wheel cover - rear left side - Scratch(es) - Replace



Damage 6: Roof: Stub aerial - Damage caused by marten / rodent - Replace



Damage 6: Roof: Stub aerial - Damage caused by marten / rodent - Replace



Damage 7: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 7: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 8: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 9: 2nd wheel set: 2 alloy rims - Scratch(es) - Loss in value



Damage 10: Front bumper: Front bumper - Scratch(es) - Paint



Damage 10: Front bumper: Front bumper - Scratch(es) - Paint



Damage 10: Front bumper: Front bumper - Scratch(es) - Paint



Damage 10: Front bumper: Front bumper - Scratch(es) - Paint



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right