



CITRO?N BERLINGO: FN-568-BC

Vinnumber:	VR7EFYHWCKJ812581	Versionname:	CITRO?N BERLINGO Taille M 1000kg BlueHDi 75
First Registrationdate:	15/01/2020		BVM Club VU [4P] bvm 5-75CH-5cv
Expertise Mileage:	173443		(fourgonnettesimple cabine)
Bodytype:	Transporter	Fiscalpower:	
Gearbox:	MAN 5 VIT	Power Kw:	55
Transmission:	Front	Body colour:	White
Fueltype:	Diesel	Paint type:	Opaque
Engine functioning:	Yes	Interior colour:	Black
Battery functioning:	Yes	Type of rims (mounted):	Steel
Vehicle running:	Yes	Dashboard color:	Black
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	2	Tow bar	
Number keys remote	1	Radio	
Windows electric F		Rear parking sensors	
Cruise Control		Sliding door right-side	
Type of climate control	Manual climate control	Seat cover lining	Lining Other

Tyres

215/65/16/109 T			
Summer tyres:	Fr.L.	Other: 0%	Fr.R.
	Re.L.	Other: 0%	Re.R.
Tyre profile depth FL			8.6
Tyre profile depth FR			8.5
Tyre profile depth RL			8.8
Tyre profile depth RR			8.6
Tyre size FL			215/65 R 16 109 T
Tyre size FR			215/65 R 16 109 T
Tyre size RL			215/65 R 16 109 T
Tyre size RR			215/65 R 16 109 T
Tyre type FL			All seasons
Tyre type FR			All Seasons
Tyre type RL			All seasons
Tyre type RR			All Seasons
Tyre make FL			263
Tyre make FR			263
Tyre make RL			263
Tyre make RR			263

Assistance equipment


Spare wheel	Yes	Jack	Yes
Interior, Not original part, Acceptable			



Switch, Missing, Acceptable



Air vent, mid-dashboard, Broken, Replace

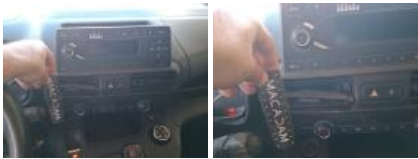

Steering wheel, Worn, Replace



Seat cover FL, Tear, Replace



Interior, Stain, Cleaning



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Door trim FL, Scratch(es), Replace



Wing trim RL, Scratch(es), Replace



Side wall RL, Dent(s) and scratch(es), Repair and paint (complete)





Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)



Bumper F, Scratch(es), Repair and paint (complete)



Bumper F, Broken, Replace




Bonnet, Scratch(es), Acceptable



Sliding door R, Dent(s) and scratch(es), Repair and paint (complete)



Door FR, Dent(s) and scratch(es), Repair and paint (complete)

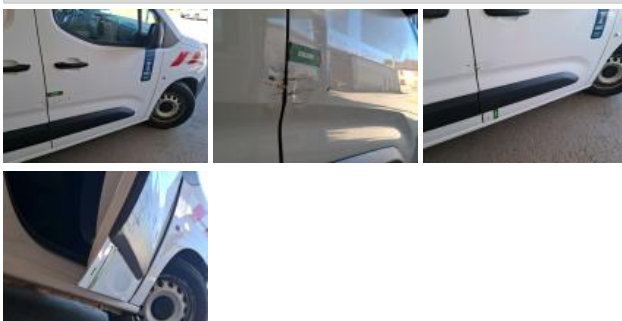

Door trim FR, Scratch(es), Replace



Door trim RR, Scratch(es), Replace



Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)



Wing FR, Dent(s) and scratch(es), Repair and paint (complete)



Rear light L, Broken, Replace



Bumper corner RL, Deformed / Strained, Replace



Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)



Bumper R, Deformed / Strained, Replace



Bodywork, Not original part, Acceptable



Historique Maintenance

Immatriculation: **FN-568-BC** Date de 1ère immatriculation: **15/01/2020**

Modèle: **Citroen BERLINGO Taille M 1000kg BlueHDi 75 BVM Club VU [4P] bvm 5-75CH-5cv (fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
12/06/2026	171.653	CMOBILITY	LAMPE RPLT
			REVISION
03/03/2025	147.800	CMOBILITY	REVISION
10/12/2024	143.418	CMOBILITY	DIAG
			FAP RPLT
26/11/2024	142.350	CMOBILITY	DIAG
			ESSAI
28/10/2025	140.399	CMOBILITY	INJECTEUR ADBLUE RPLT
			TRIANGLE SUPERIEUR ARG RPLT
			DISQUES PLAQUETTES AV RPLT
			DIVERS
			TRIANGLE SUPERIEUR ARD RPLT
04/11/2024	140.399	CMOBILITY	DIVERS ECHAPPEMENT
			BATTERIE RPLT
			BIELLETTTE DE DIRECTION AVG RPLT
22/07/2024	132.914	CMOBILITY	BIELLETTTE DE DIRECTION AVG RPLT
			PLAQUETTES AR RPLT
			DISQUES PLAQUETTES AV RPLT
			LAMPE CODE AVD RPLT
19/03/2024	126.307	AUTO SECURITE COLOMBE SAS	LAMPE AR RPLT
			CONTRE VISITE CT
30/01/2024	123.010	CMOBILITY	BALAISSUIE GLACE AV
			CARDAN AVG RPLT
			COUPELLES AMORTISSEURS AV RPLT
			FERMETURE DOSSIER TECHNIQUE
			REVISION ET CLIM ET AIR ET CARBURANT
			LIQUIDE DE FREIN
			COURROIE ACCESSOIRES RPLT
			LAMPE AR RPLT
29/01/2024	122.950	AUTO SECURITE COLOMBE SAS	AMORTISSEURS AV RPLT
			CARDAN AVD RPLT
29/01/2024	122.950	AUTO SECURITE COLOMBE SAS	CONTROLE TECHNIQUE

Historique Maintenance

Immatriculation: **FN-568-BC**

Date de 1ère immatriculation: **15/01/2020**

Modèle: **Citroen BERLINGO Taille M 1000kg BlueHDi 75 BVM Club VU [4P] bvm 5-75CH-5cv
(fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
04/05/2023	102.261	CMOBILITY	DIVERS
			PLAQUETTES AR RPLT
			PLAQUETTES AV RPLT
			BALAIS ESSUIE GLACE AV
			ADBLUE
			REVISION
19/07/2022	78.680	CMOBILITY	RESERVOIR ADBLUE RPLT
11/05/2022	73.066	CMOBILITY	PLAQUETTES AR RPLT
			DISQUES PLAQUETTES AV RPLT
31/05/2021	41.008	SARL COUYBES	REVISION ET CLIM ET AIR ET CARBURANT
			PLAQUETTES AR RPLT
21/04/2021	36.602	SARL COUYBES	PLAQUETTES AV RPLT