



Expertise

Protocol number: 46596278
Order No. / Reference: 26757766
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Caddy Cargo 2.0 TDI BMT Maxi

VIN: WV1ZZZSK8PX078257



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Caddy Cargo 2.0 TDI BMT Maxi

Vehicle Identification number WV1ZZZSK8PX078257
Mileage (Read) 256,885 km
First registration 15 May 2023
Number of holders 1
Next periodical technical inspection 05/2027
(Report not on hand)

Fuel type Diesel
Engine displacement / Cylinder 1,968 ccm / 4
Power 75 kW
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Van
Colour / colour code Candyweiß
Doors / Seats 4 / 2
Upholstery type Cloth
Colour of upholstery Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,700 km
Last service on / at	04/2026 at 248,127 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS560628
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
Manufacturer key number/ type code number	0603 / CMF 00336		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,300 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	All-season tyres on Steel rim with wheel cover	Firestone	5mm / 5mm
2)	205/60 R16 96V	All-season tyres on Steel rim with wheel cover	Firestone	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments (Various shelves and storage compartments)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- Cockpit panel, matte
- Three-phase generator 140 A
- Electronic parking brake including auto-hold function
- ESP Electronic Stability Program with Brake Assist (incl. Anti-lock Braking System (ABS), Traction Control (ASR), (EDS and MSR))
- Electric windows, front
- Halogen dual headlights-H7
- Heating and ventilation system in the driver's cab
- Interior lighting in the cargo area (1 light)
- Fuel fill quantity, standard fuel initial fill
- Steering column adjustable in height and tilt
- Center console with 2 universal cup holders
- Multi-collision brake
- Fatigue detection
- Non-smoking version
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- Wheels/Tires: 205/60 R 16 96 H XL, optimized for low rolling resistance
- Gearshift lever in plastic
- Sliding door, on the right in the passenger/cargo area
- Standard side panels in the cargo area
- Speed-sensitive power steering (Servotronic)
- Seats: Height adjustment for left seat, manual
- Seats: Left and right seats in the 1st row (including headrests)
- Start-stop system (with brake energy recuperation)
- Tire Mobility Set (12-volt compressor and tire sealant)
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Additional dust protection seal on the outside
- Storage compartments: Glove compartment open
- Towing eye front and rear, screw-in
- Exterior mirrors: electrically adjustable
- Exterior mirror housings and door handles in black, sliding door track in silver
- Floor coverings: Carpet in the driver's cab
- third brake light
- Roof rail/roof rack preparation
- Three-point automatic seat belts (with front belt height adjustment and electric belt tensioners)
- Automatic headlight control with daytime running lights
- Windows: Laminated glass front pane in heat-insulating glazing
- Transmission: 6-speed transmission
- Rear wing door (asymmetrically divided) without window cutout
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Headlight range control
- Multifunction display: 16.51 cm (6.5 inch) color touchscreen for convenient operation (with USB charging port (Type C), no radio function)
- eCall emergency call system
- Upholstery: Fabric, "Double Grid" design
- Wheels, tires: Wheel covers
- Wheels/Tires: Steel wheels 6.5J x 16, in black
- taillights
- Windscreen wiper intermittent control with light sensor
- Keys for locking system: 2 remote control flip keys
- Side indicator lights
- Seat belt indicator (warning tone and light for unfastened front seat belts)
- Sun visors without mirrors, with ticket pocket on the driver's side, plus airbag label on the sun visor
- Bumper in grey
- Partition wall (tall) without window
- Lashing points: 6 lashing points for securing cargo
- Electronic immobilizer
- Central locking with remote control and interior operation



Extra equipment

- Storage compartments: Glove compartment with lockable, illuminated flap
- Floor coverings, rubber floor covering in the cargo area
- Deletion: Lettering on the rear (excluding lettering for type/model designation - excluding promotional lettering and decals)
- Cruise control system including speed limiter
- Steering wheel: Multifunction steering wheel
- Navigation system "Discover Media" (25.4 cm (10 inch) touch color display - streaming & internet - 2 USB interfaces (Type C) in the center console, front - glove compartment with lockable, illuminated flap - 4 speakers - mobile phone interface)
- Package: Cool & Sound (Refrigerant R1234yf - Safety interior mirror, automatically dimming - Air Care Climatronic air conditioning with 2-zone temperature control and air purification function)
- Radio accessories: Digital radio reception DAB+
- Wheels/Tires: All-season tires 205/60 R 16 96 H XL, optimized for low rolling resistance
- Wheels/Tires: Spare wheel in driving tire size, steel (spare wheel in driving tire size, steel - on-board tools and jack)
- Adaptive Cruise Control (ACC) with speed limiter
- Electrically adjustable and heated exterior mirrors
- Parking assistance (parking distance control, front and rear)
- Window: Fixed side window in the cargo/passenger compartment, front right
- Paint finish: Solid
- Multifunction display "Plus"
- Fog lights including cornering lights
- Emergency braking assistant "Front Assist", evasive steering assist and turning assistant (multifunction camera - multifunction steering wheel - evasive steering assist and turning assistant - auto-dimming rearview mirror - emergency braking assistant "Front Assist" with pedestrian and cyclist detection - cruise control including speed limiter - multifunction display "Plus")
- Package: Winter package (Seat heating for seats in the driver's cab, left and right, separately adjustable - Washer fluid level indicator with enlarged washer fluid reservoir - Heated windshield washer nozzles at the front)
- Telephone: Mobile phone interface
- Partition wall (high) with grilles

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Unrund

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Rear door - right side - dent(s) - Smart repair
2	Wheel / tyres	Tyre - right - Porous / cracked - Replace
3	Engine	Engine (Unrund lauf) - Functional / admissibility - Perform diagnosis

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Wheel / tyres - Spare wheel



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

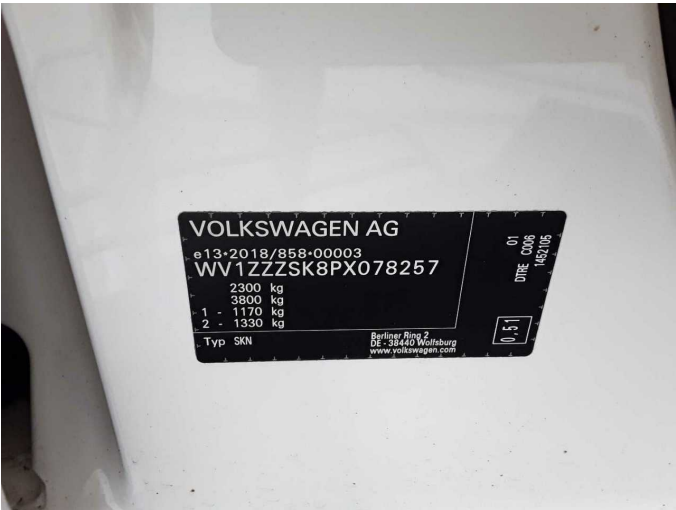


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

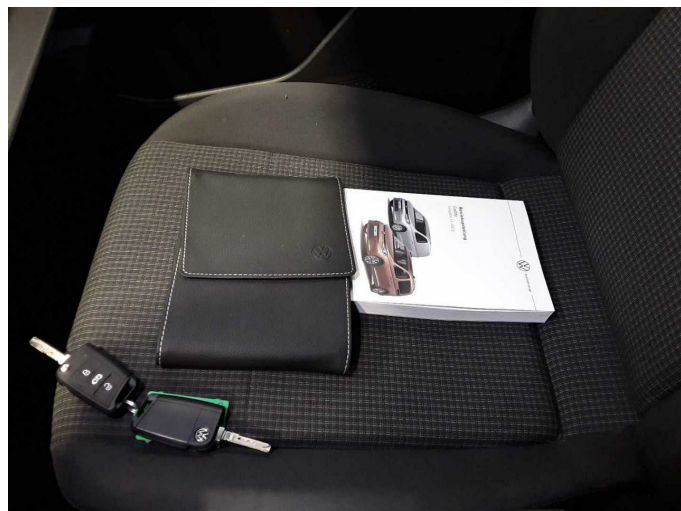


Figure 15: Documents

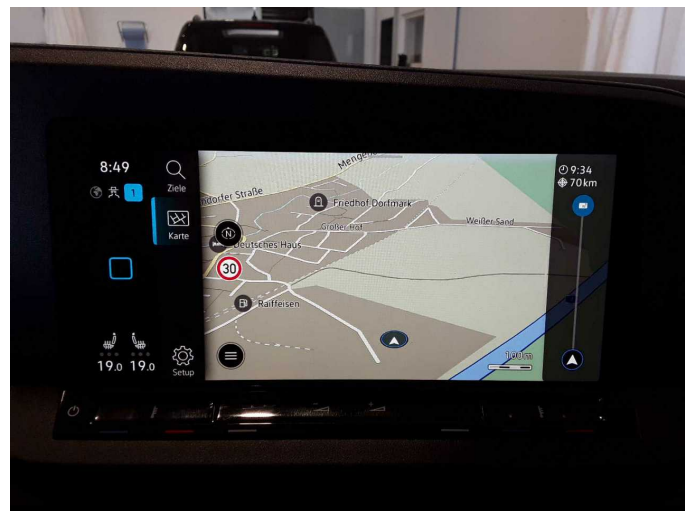


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.




Damage 1: Boot lid / rear door: Rear door - right side - dent(s) - Smart repair




Damage 1: Boot lid / rear door: Rear door - right side - dent(s) - Smart repair




Damage 2: Wheel / tyres: Tyre - right - Porous / cracked - Replace

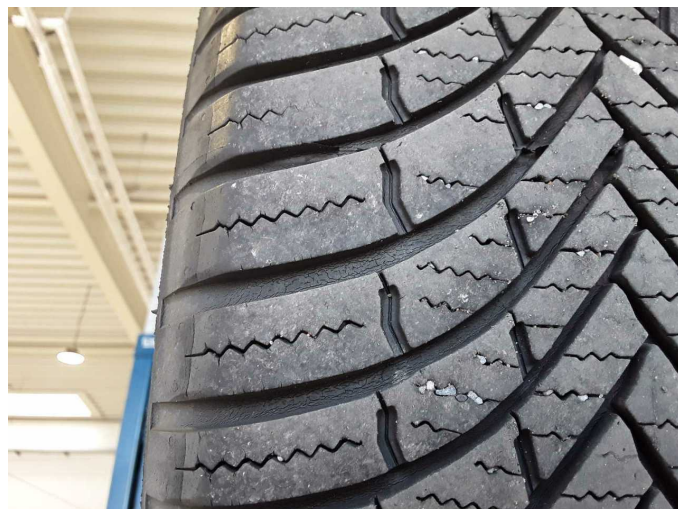

Damage 2: Wheel / tyres: Tyre - right - Porous / cracked - Replace

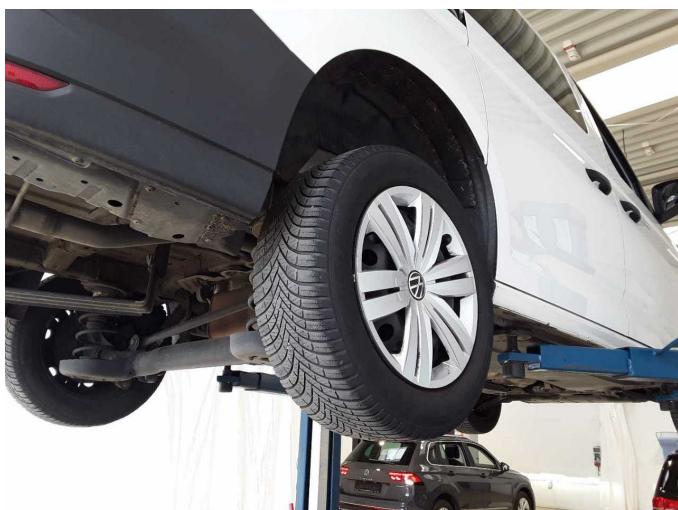

Damage 2: Wheel / tyres: Tyre - right - Porous / cracked - Replace

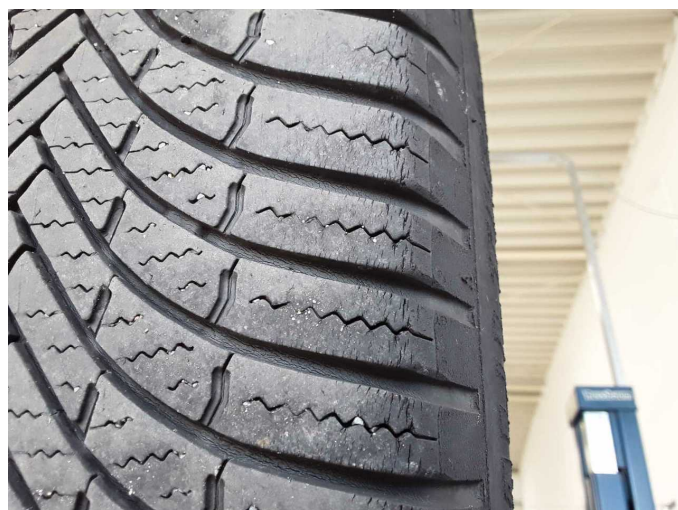

Damage 2: Wheel / tyres: Tyre - right - Porous / cracked - Replace



Damage 3: Engine: Engine (Unrunder lauf) - Functional / admissibility - Perform diagnosis



Missing part 1: Wheel / tyres: Spare wheel - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV1ZZZSK8PX078257

Hersteller / Modell: VOLKSWAGEN VW Caddy Cargo 2.0 TDI BMT Maxi

Datum	KM-Stand	Beschreibung
29.04.2026	248.127	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.12.2025	232.585	Regelwartungsdienst; Wartung Sonstiges
24.10.2025	224.022	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
21.05.2025	200.034	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Getriebeöl ern/prüfen; HU + AU; Keilrippenriemen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Spannrolle ern; Wartung Sonstiges; Zahnriemen/Steuerkett ern
19.12.2024	165.398	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.08.2024	136.737	Bremse Sonstiges; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.05.2024	103.638	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.02.2024	73.831	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.09.2023	30.725	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges