



VSSZZZKNZNW010239

Angaben zum Fahrzeug

Halter		Besichtigungszustand	bedingt: Licht/Nässe/Schmutz
Kennzeichen		Laufleistung (abgelesen)	22.093 km
Hersteller	Seat	Restlauf bis Service	0 km
Typ/Modell	TARRACO	HU (Abgelesen aus ZBI)	07/2025
Fahrgestellnummer	VSSZZZKNZNW010239	Leistung / Hubraum	140 kW / 1.984 ccm
Erstzulassung	15.07.2022	Polster/Farbe	Stoff/Leder Kombination / Schwarz
Letzte Wartung		Lackierung	Grau
Kraftstoffart	Benzin	Getriebe	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung
1	Sonstiges	Hauptuntersuchung (07/2025 fällig) - fällig - durchführen
2	Heckbereich	Anhängerkupplung (schwenkt nicht vollständig aus) - Fehlstellung - Diagnose durchführen
3	Verkleidungen/Abdeckungen	Heckdeckel, Innenverkleidung (Abdeckung für Heckleuchte) - lose - erneuern
4	Sonstiges	Inspektion/Wartung (07/2024 fehlt -> 2Jahre/30.000km) - kein Nachweis
5	Sonstiges	Inspektion/Wartung - fällig - durchführen

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung
1	Verglasung	Frontscheibe - Steinschlag

Fehlteile

Fehlteil

Festgestellte Nachlackierungen

Nr.	Ort
Keine feststellbar	

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	255/40 R20 100V	Continental	Sommerreifen	5mm - 5mm	i.O.	i.O.
2	255/40 R20 100V	Continental	Sommerreifen	5mm - 5mm	i.O.	i.O.

Ersatz

Typ	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Ablaufdatum
Notrad	175/40 R18 103	Sonstige	Sommerreifen	6	

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
KFZ Sachverständigenbüro &
Ingenieurbüro Hulich
Erkrather Straße 103
40233 Düsseldorf

Besichtigungsdatum: 01.06.2026
Protokollnummer: **45745502**
Erstellt durch: Paula Kube
Besichtigt durch: Raschid Hulich



Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
KFZ Sachverständigenbüro &
Ingenieurbüro Hulich
Erkrather Straße 103
40233 Düsseldorf

Besichtigungsdatum: 01.06.2026
Protokollnummer: 45745502
Erstellt durch: Paula Kube
Besichtigt durch: Raschid Hulich



Angaben zum Fahrzeug

Hersteller	Seat	Besichtigungszustand	bedingt: Licht/Nässe/Schmutz
Typ/Modell	TARRACO	Laufleistung (abgelesen)	22.093 km
Fahrgestellnummer	VSSZZZKNZNW010239	Erstzulassung	15.07.2022

Angaben zum Auftrag:

Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:

Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:

Eine ordnungsgemäße Sichtprüfung der Lackierung und der Karosserie war wegen unzureichender Lichtverhältnisse/ Nässe oder Verschmutzung nur eingeschränkt möglich.

Allgemeinzustand:

Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Paula Kube)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

Übersichtsfotos



Abbildung 1: FIN



Abbildung 2: Schräg vorne



Abbildung 3: Schräg vorne



Abbildung 4: Schräg hinten



Abbildung 5: Schräg hinten



Abbildung 6: Montierte Bereifung

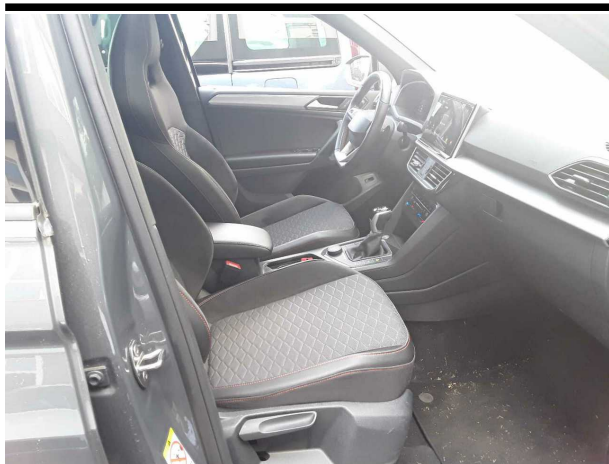


Abbildung 7: Innenraum vorne

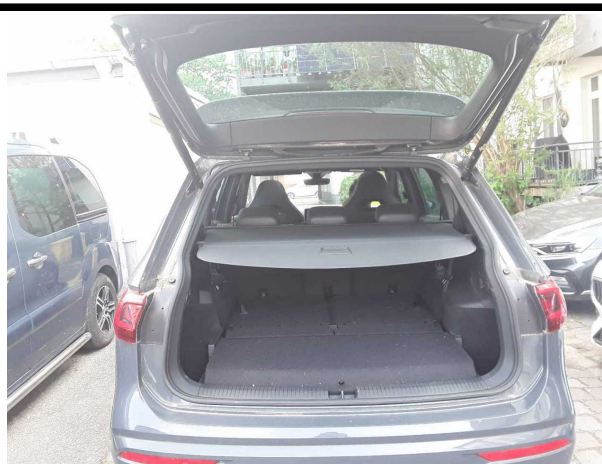


Abbildung 8: Laderaum



Abbildung 9: Laderaum



Abbildung 10: Kombiinstrument



Abbildung 11: Kombiinstrument



Abbildung 12: Instrumententafel

TÜV SÜD Auto Partner GmbH
 Gutenbergstraße 13
 70771 Leinfelden-Echterdingen

Besichtigungsort
 KFZ Sachverständigenbüro &
 Ingenieurbüro Hulich
 Erkrather Straße 103
 40233 Düsseldorf

Besichtigungsdatum: 01.06.2026
Protokollnummer: 45745502
 Erstellt durch: Paula Kube
 Besichtigt durch: Raschid Hulich



Abbildung 13: Instrumententafel



Abbildung 14: Dokumente



Abbildung 15: Dokumente



Abbildung 16: Sonstiges

Beschädigungsfotos



Beschädigung #2: Heckbereich: Anhängerkupplung (schwenkt nicht vollständig aus) - Fehlstellung - Diagnose durchführen



Beschädigung #5: Sonstiges: Inspektion/Wartung - fällig - durchführen



Beschädigung #3: Verkleidungen/Abdeckungen: Heckdeckel, Innenverkleidung (Abdeckung für Heckleuchte) - lose -

49. CO₂ emissions/fuel consumption/electric energy consumption:
1. All power trains except pure electric vehicles (if applicable):
- | NEDC values | CO ₂ emissions | | Fuel consumption [l/100 km] | | | |
|------------------------|---------------------------|----------------|-----------------------------|-------------------|---------------------------------|------------|
| | Petrol/Diesel g/km | LPG / CNG g/km | Others g/km | Petrol/Diesel [L] | LPG / CNG [L]/[m ³] | Others [L] |
| Urban conditions | 196 | ---- | ---- | 8.6 | ---- | ---- |
| Extra-urban conditions | 140 | ---- | ---- | 6.1 | ---- | ---- |
| Combined | 160 | ---- | ---- | 7.0 | ---- | ---- |
| Weighted, combined | ---- | ---- | ---- | ---- | ---- | ---- |
- Deviation factor (if applicable):
Verification factor (if applicable):
2. Pure electric vehicles and OVC hybrid electric vehicles (if applicable)
Electric energy consumption (weighted, combined): [Wh/km]
Electric range: [km]
3. Vehicle fitted with eco-innovation(s):
3.1. General code of the eco-innovation(s):
3.2. Total CO₂ emissions savings due to the eco-innovation(s):
3.2.1. NEDC savings (if applicable)
Diesel / Petrol
LPG / NG [g/km]
Others [g/km]
3.2.2. WLTP savings (if applicable)
Diesel / Petrol
LPG / NG [g/km]
Others [g/km]
yes
e9 28

4. All power trains, except pure electric vehicles (if applicable)
- | WLTP values | CO ₂ emissions | | Fuel consumption: [l/100 km] | | | |
|--------------------|---------------------------|----------------|------------------------------|-------------------|---------------------------------|------------|
| | Petrol/Diesel g/km | LPG / CNG g/km | Others g/km | Petrol/Diesel [L] | LPG / CNG [L]/[m ³] | Others [L] |
| Low | 235 | ---- | ---- | 10.4 | ---- | ---- |
| Medium | 189 | ---- | ---- | 8.3 | ---- | ---- |
| High | 165 | ---- | ---- | 7.3 | ---- | ---- |
| Extra High | 190 | ---- | ---- | 8.4 | ---- | ---- |
| Combined | 188 | ---- | ---- | 8.3 | ---- | ---- |
| Weighted, combined | ---- | ---- | ---- | ---- | ---- | ---- |
5. 1. Pure electric vehicles (if applicable)
Electric energy consumption [Wh/km]:
Electric range [km]:
Electric range city [km]:
5. 2. OVC hybrid electric vehicles (if applicable)
Electric energy consumption (EC_{AC,weighted}) [Wh/km]:
Electric range (EAER) [km]:
Electric range city (EAER city) [km]:
51. For special purpose vehicles:
Designation in accordance with Annex II, Section 5:
52. Remarks:

NO 16.2.: with trailer axle 2+110 kg##N
O 35.: alt. to pos 35 with deviating val. in pos 49:##215/65 R17 99V#7,0JX17 ET4
0:##215/65 R17 99V#6,5JX17 ET38:##235/45 R20 100V#8,0JX20 ET41:##235/50 R19 99V#
7,0JX19 ET43:##235/55 R18 100V#7,0JX18 ET43:##255/40 R20 101V#8,5JX20 ET38:##255
/45 R19 100V#8,5JX19 ET38:##215/65 R17 99H M+S#7,0JX17 ET40:##215/65 R17 99H M+S
#6,5JX17 ET38:##235/50 R19 103H M+S#7,0JX19 ET43:##235/55 R18 104H M+S#7,0JX18 E
T43:##

München, den 14. Juli 2022
Landeshauptstadt München
Kreisverwaltungsreferat
ZBII 67882154

Complete vehicles

The undersigned hereby certify that the vehicle:

- 0.1. Make (Trade name of manufacturer): SEAT
0.2. Type: KN
Variant: XDNNAX1
Version: AD7MAD7GC0064BIML761B8B
TARRACO
Commercial name: IP-MQB37AS_B1_0821-VSS-1
Interpolation family's identifier: AT-5QA_OV_0223_000-VSS-1
ATCT family's identifier: 09-VSS-715W_KN_DNNA_AD7_B-000
PEMS family's identifier: RL-DQ381_7A_17_020-WVW-1
Roadload family's identifier: -----
Roadload matrix family's identifier (if applicable): PR-AU_00109_00_000-WVW-1
Periodic regeneration family's identifier: EV-5N_APW_D_BOABXX-WVG-1
Evaporative test family's identifier: M1
Vehicle category: SEAT, S.A.
Company name and address of manufacturer: Autovia A-2, Km. 585
ES-08760 Martorell
- 0.3. Location and method of attachment of the statutory plates:
On the right B-pillar, glued or bonded
- 0.4. Location of the vehicle identification number:
In the engine compartment, right
- 0.5. Vehicle identification number:
VSSZZZKNZNW010239
- 0.6. Date of manufacture of the vehicle:
2022-05-30

conforms in all respects to the type described in approval e9*2007/46*6666*26 issued on 2022-02-14 and can be permanently registered in Member States having right hand traffic and using metric units for the speedometer and metric units for the odometer.

Martorell, 2022-05-30

Martorell, 2022-05-30

Daniel Cortina Munuera
Director Quality Assurance

Robin Christoph Bräutigam
Head of Technical Conformity

Internal Manufacturer Data

VSSZZZKNZNW010239

1. Number of axles / wheels: 2 / 4
3. Powered axles (number, position): 2 Axle 1/2
Interconnection of powered axles: front-rear axle gear box-cardan shaft
- 3.1. Specify if the vehicle is non-automated/automated/fully automated: non-automated
4. Wheelbase[mm]: 2787
- 4.1. Axle spacing [mm]: 2787
5. Length [mm]: 4735
6. Width [mm]: 1839
7. Height [mm]: 1665
13. Mass in running order [kg]: 1791
- 13.2. Actual mass of the vehicle [kg]: 1929
16. Technically permissible maximum masses:
16.1. Technically permissible maximum laden mass [kg]: 2440
16.2. Technically permissible mass on each axle (1./2.) [kg]: 1160 / 1330
16.4. Technically permissible maximum mass of the combination [kg]: 4840
18. Technically permissible maximum towable mass in case of:
18.1. Drawbar trailer [kg]: -----
18.3. Centre-axle trailer [kg]: 2400
18.4. Unbraked trailer [kg]: 750
19. Technically permissible maximum static vertical mass at the coupling point [kg]: 100
20. Manufacturer of the engine: Audi AG
21. Engine code as marked on the engine: DNN
22. Working principle: Positive ignition / 4 stroke
23. Pure electric: no
- 23.1. Class of Hybrid (electric) vehicle: -----
24. Number and arrangement of cylinders: 4, in Line
25. Engine capacity [cm³]: 1984
26. Fuel: petrol
- 26.1. Mono fuel/Bi fuel/Flex fuel/Dual fuel: mono fuel vehicle
- 26.2. Type of dual fuel engine: -----
27. Maximum power: -----
- 27.1. Maximum net power [kW at min⁻¹] (internal combustion engine): 140.00 / 4200
- 27.2. Maximum hourly output [kW] (electric motor): -----
- 27.3. Maximum net power [kW] (electric motor): -----
- 27.4. Maximum 30 minutes power [kW] (electric motor): -----

Gearbox (type): automatic									
28.	Gear	-----	-----	-----	-----	-----	-----	-----	-----
28.1.	Gearbox ratios:	-----	-----	-----	-----	-----	-----	-----	-----
28.1.2.	Final drive ratio:	-----	-----	-----	-----	-----	-----	-----	-----
	Total gear ratios:	-----	-----	-----	-----	-----	-----	-----	-----

29. Maximum speed [km/h]: 210

30. Axle(s) track (1./2.) [mm]: 1577 / 1568

35. Fitted tyre/wheel combination/energy/efficiency class of RRC/Type category used for CO₂ determination:

Axle 1: 255/40 R20 101V / 8.5JX20 ET38 / B / C1

Axle 2: 255/40 R20 101V / 8.5JX20 ET38 / B / C1

36. Trailer brake connections: -----

38. Code for bodywork: AC

40. Colour of vehicle: GREY

41. Number and configuration of doors: 5 / ie 2, ri 2, ba 1

42. Number of seating positions (including the driver): 7

42.1. Seat(s) designated for use only when the vehicle is stationary: ---

42.3. Number of wheelchair user accessible position: ---

46. Sound level

Stationary [dB(A) at min⁻¹]: 76.00 / 3750

Drive-by [dB(A)]: 66.00

47. Exhaust emission level: EURO 6 AP

47.1. Parameters for emission testing of Vind: 2022

47.1.1. Test mass [kg]: -----

47.1.2. Frontal area [m²]: -----

47.1.3. Road load coefficients	47.1.3.0. f0 [N]	47.1.3.1. f1 [N/(km/h)]	47.1.3.2. f2 [N/(km/h)²]
	171.045978	0.753000	0.040123

47.2. Driving cycle: 3b

47.2.1. Driving cycle class: -----

47.2.2. Downscaling factor (f_{acc}): -----

47.2.3. Capped speed: no

48. Exhaust emissions: 715/2007/2018/1832AP

1.2. Test procedure: Type 1 (NEDC average values, WLTP highest values) [mg/km] or WHSC (EURO VI)									
Petrol / Diesel	CO	THC	NMHC	NO _x	THC + NO _x	NH ₃	Particles	Particles #	Particles #
178.0	19.2	16.9	16.1	-----	-----	-----	0.0200	0.22E11	-----
LPG/CNG	CO	THC	NMHC	NO _x	THC + NO _x	NH ₃	Particles	Particles #	Particles #
-----	-----	-----	-----	-----	-----	-----	-----	-----	-----
Other	CO	THC	NMHC	NO _x	THC + NO _x	NH ₃	Particles	Particles #	Particles #
-----	-----	-----	-----	-----	-----	-----	-----	-----	-----

2.2. Test procedure: WHTC (EURO VI) [mg/kWh]									
Petrol / Diesel	CO	THC	NMHC	CH ₄	NO _x	NH ₃	Particles	Particles #	Particles #
-----	-----	-----	-----	-----	-----	-----	-----	-----	-----
LPG/CNG	CO	THC	NMHC	CH ₄	NO _x	NH ₃	Particles	Particles #	Particles #
-----	-----	-----	-----	-----	-----	-----	-----	-----	-----
Other	CO	THC	NMHC	CH ₄	NO _x	NH ₃	Particles	Particles #	Particles #
-----	-----	-----	-----	-----	-----	-----	-----	-----	-----

48.1. Smoke corrected absorption coefficient [m⁻¹]: -----

48.2. Declared maximum RDE values (if Complete RDE trip: NO_x [mg/km] Particles (number) with exponent (#/km)

Urban RDE trip: 60.0 6.00 E11

Urban RDE trip: 60.0 6.00 E11

MOBILITY CONCEPT

LVV Nr	4613768
Hersteller	SEAT
Model	Tarraco
Variante	null
Listenpreis	42.966,39
VIN	VSSZZZKNZNW010239
Erstzulassungsdatum	1.7.2022
Kennzeichen	M RP1841

Schadensfälle der int. Belegnummer: **4613768**

10.07.2026

Schadennummer	Unfalldatum	Beschädigung	Schadenhöhe in EUR
2025105557	27.02.2025	Windschutzscheibe gerissen	644,11

- Seite 1 von 1 -