



Expertise

Protocol number: 46151794
Order No. / Reference: 26570845
Inspection date: 23 Jun 2026

Manufacturer: Audi

Model: A6 Avant 40 TDI quattro S tronic design

VIN: WAUZZZF20NN051337



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 Avant 40 TDI quattro S tronic design	
Vehicle Identification number	WAUZZZF20NN051337
Mileage (Read)	137,059 km
First registration	17 Jun 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	ibisweiss (Y9C)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	-10 Tag(e)
Last service on / at	12/2025 at 112,194 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ180027
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BTA 02035		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,425 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	245/45 R19 102Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Winter tyres on Light alloy	Hankook	3mm / 2mm
2)	245/45 R19 102V	Winter tyres on Light alloy	Hankook	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect remote & control
- Electrically adjustable and heated exterior mirrors
- third brake light
- Aluminum roof rails
- Diesel particulate filter (DPF) with nitrogen oxide catalyst and AdBlue tank
- Electronic Stability Control (ESC)
- key fob
- Cruise control system including speed limiter
- Interior lighting
- Instrument panel and door trim, two-piece, single/multi-color
- 2-zone automatic climate control (separate temperature distribution for driver and front passenger side, rear compartment air conditioning via air vents in the rear center console, defroster nozzles for windshield and side windows, combined pollutant and fine dust filter)
- Steering column, manually adjustable in height and axis
- MMI navigation with MMI touch response
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Rail system with fixing set
- Seats: Standard front seats
- Seats: Split-folding rear seat backrest Avant
- Lane Departure Warning
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear
- Airbag for driver and front passenger
- "quattro" all-wheel drive with ultra technology
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Exterior mirror housings in body color
- Fabric headliner
- Decorative inlays aluminum fragment
- Tachometer
- Door sills with aluminum inlay front and rear
- Driver information system with color display
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- Interior mirror dimming
- Interior elements in faux leather above
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (4)
- LED headlights
- Steering wheel: Double-spoke leather steering wheel with multifunction and paddle shifters
- front center armrest
- Ambient lighting package
- Non-smoking package
- Wheel: Alloy wheels, multi-spoke design
- Wheel: Tire repair kit
- Radio accessories: 8 speakers (passive) front and rear
- Seat covers in Essenz/mono.pur 550 fabric combination (for standard seats)
- Sun visor on driver and passenger side
- Start-stop system
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking



Extra equipment

- Trailer hitch preparation (Includes pre-wiring. The trailer hitch is available via Audi Genuine Accessories and should be retrofitted by a specialist workshop, as additional modifications to the vehicle may be required.)
- Parking aid plus with surround view (acoustic and visual parking aid front, side and rear to assist with parking and maneuvering by measuring with 12 ultrasonic sensors. A selective visual display shows the distance to detected objects in the upper display, depending on the current steering angle and the direction of travel. Optionally, activation occurs automatically as soon as the vehicle approaches a detected obstacle at a speed of less than 10 km/h).
- Paintwork: Special paint finishes, solid colors
- Black Optics Package (black accents in the area of the Audi Singleframe, the trim strips on the side windows, the front and rear bumpers including tailpipe trims - exterior mirror housings in black)
- Reversing camera (The reversing camera displays the area behind the vehicle on the upper display. Dynamic display elements such as a steering angle-dependent lane calculation assist with parking or maneuvering.)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Electrically adjustable, heated and folding exterior mirrors (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb.)
- Deletion of model designation and performance/technology lettering
- Chassis: Sport chassis (with firmer spring and damping for more direct road contact and sportier handling, lowered by 20 mm compared to standard chassis, shock absorbers and coil springs on front and rear axles)
- Steering wheel: Leather steering wheel, 3-spoke, with multifunction and paddle shifters (paddle shifters allow manual changing of the driving modes.)
- Wheel: Light alloy wheels 5-twin-spoke design, graphite grey, polished (8.5 J x 19 with tires 245/45 R 19)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Door trim - rear right side (Druckstelle Reifen) - Smart repair
2	Body	A-pillar - right side - Stone chips - Smart repair
3	Misc.	Inspection / maintenance - Due - Perform
4	Front bumper	Front bumper (+ Steinschläge) - Scratched - Paint
5	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
6	Wheel / tyres	Alloy rim - rear right side - Scratched - Replace



Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
3	2nd wheel set	2 alloy rims (Kein Teil der Ausstattung) - Scratched - No deduction
4	2nd wheel set	2 tyres (Kein Teil der Ausstattung (unter 4mm Profiltiefe)) - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die zusätzlichen Winterräder sind kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

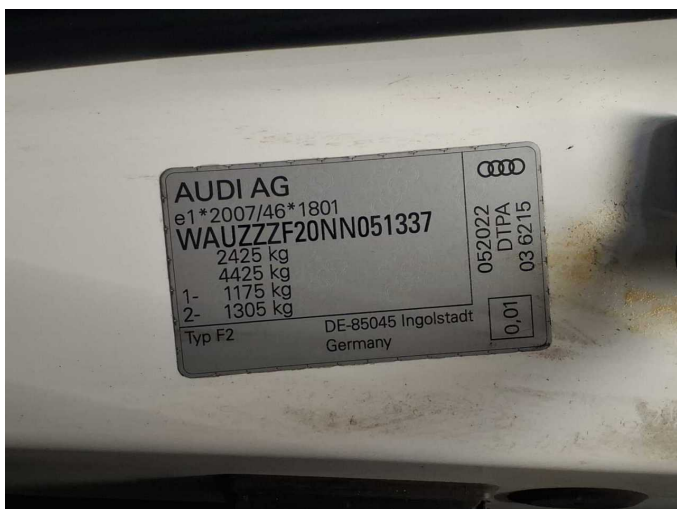


Figure 11: VIN



Figure 12: Mounted tyres

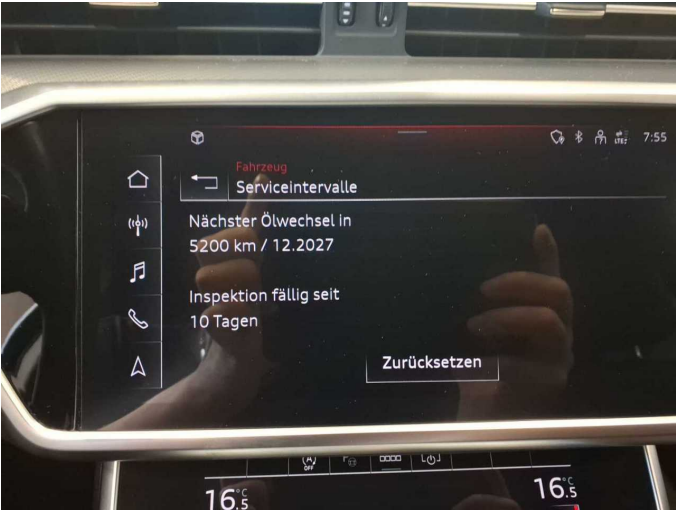


Figure 13: Documents

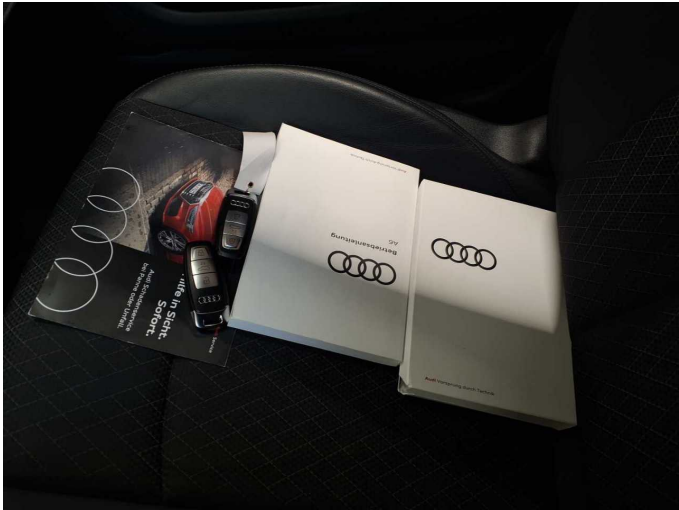


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

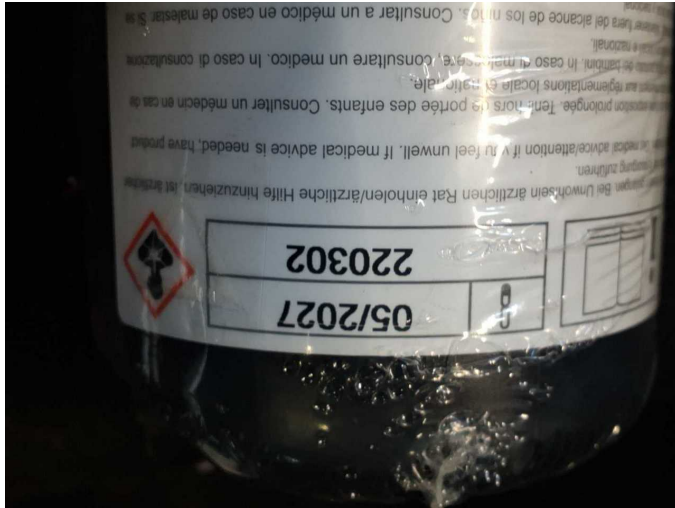


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

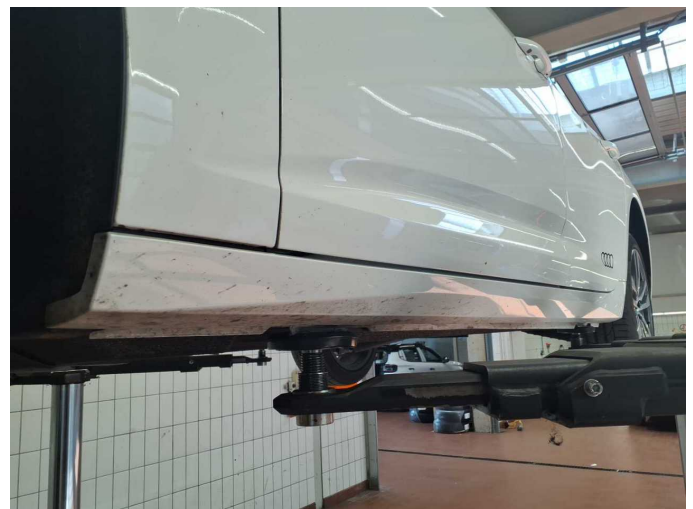


Figure 30: Misc.



Figure 31: Misc.




Damage 1: Trim / covers: Door trim - rear right side (Druckstelle Reifen) - Smart repair



Damage 1: Trim / covers: Door trim - rear right side (Druckstelle Reifen) - Smart repair



Damage 2: Body: A-pillar - right side - Stone chips - Smart repair

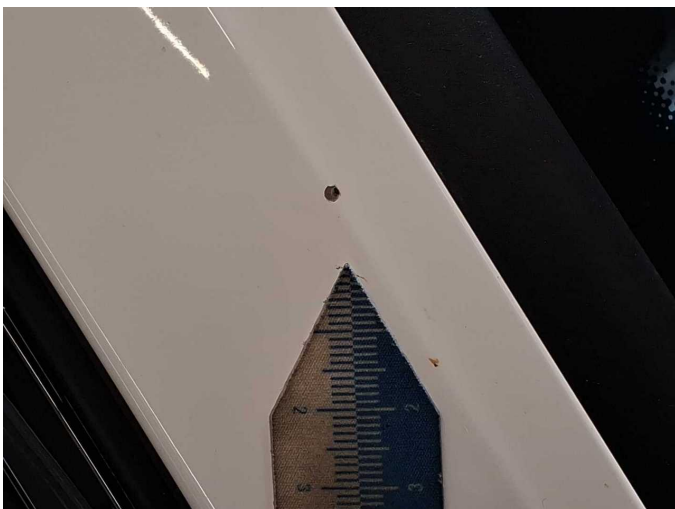

Damage 2: Body: A-pillar - right side - Stone chips - Smart repair



Damage 3: Misc.: Inspection / maintenance - Due - Perform



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 4: Front bumper: Front bumper (+ Steinschläge) - Scratched - Paint



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF20NN051337

Hersteller / Modell: AUDI AUDI A6 Avant 40 TDI quattro S tronic design

Datum	KM-Stand	Beschreibung
09.12.2025	112.194	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
02.06.2025	82.690	AU; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.03.2025	67.732	Systemtest/Eigendiagnose
14.06.2024	56.332	Bremsbelagfühler ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges