

Audi e-tron '19 BEV


Vehicle information




Make:	Audi	License:	
Gearbox:	Automatic	Body color:	
Model:	e-tron '19 BEV	VIN:	WAUZZZGE2LB037821
Fuel type:	Electric	Power:	300 kW
Version:	e-tron 55 quattro Bus.Edition+	First registration	21/07/2020
Mileage:	107825 km	N° of doors:	

Damage summary

Front	④
Left	⑤
Rear	①
Right	⑦

Commercial pictures

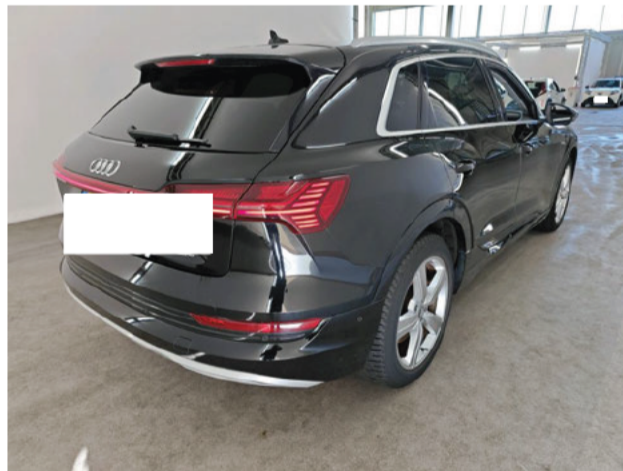

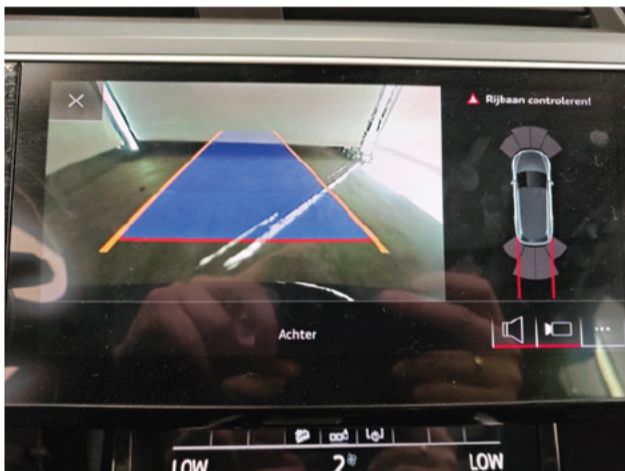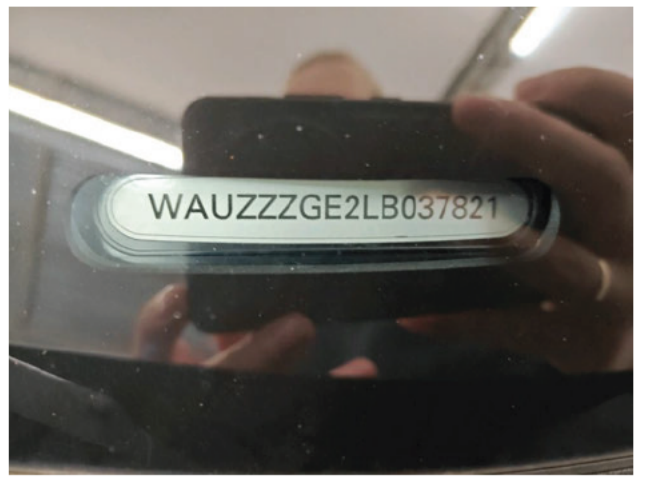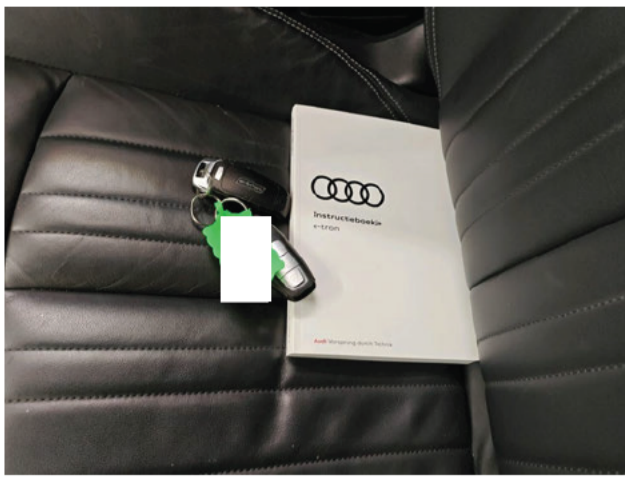

Batterijcertificaat
Datum van diagnose: 15/06/2026

89,05%
Status van de gezondheid (SOH)*

Audi e-tron 55 Quattro
VIN: WAUZZZGE2LB037821
Kilometerstand: 107.825 km

*SOH berekend op basis van fabrieksgegevens, informatie om rekening mee te houden voor de fabrieksgarantie

Meer weten over: www.get-moba.com

CARA



Options according to the inspector

Central consol F	Yes GPS	Yes Headlights Xenon/LED/Laser	Yes
Panoramic roof	Yes Radio multimedia	Yes Sun Roof electric	Yes
Telephone equipment	Yes		


Damages

Alloy rim FL

Scratch(es)

Repair and paint (complete)

Left

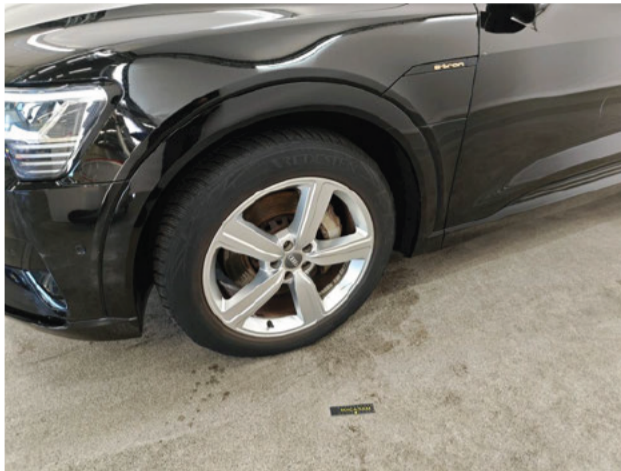


Alloy rim FR

Scratch(es)

Repair and paint (complete)

Right

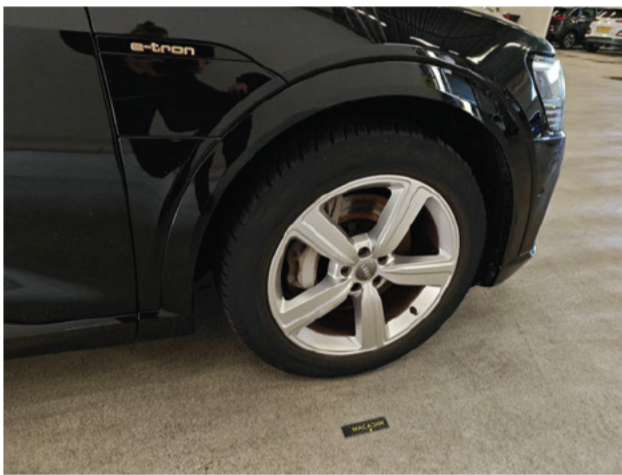

Bonnet

Stone chip(s)

Repair and paint (complete)

Front



Bumper F

Scratch(es)

Repair and paint (complete)

Front



Bumper moulding F

Scratch(es)

Replace and paint

Front




Bumper R

Scratch(es)

Repair and paint (complete)

Rear

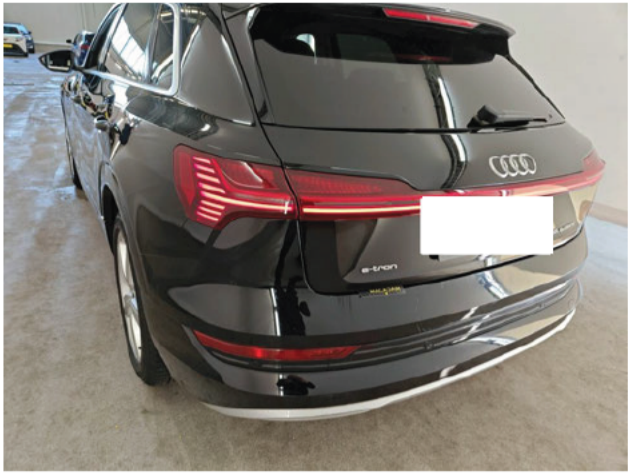

Door FL

Scratch(es)

Repair and paint (complete)

Left



Door FR

Scratch(es)

Repair and paint (complete)

Right



Door frame FL

Scratch(es)

Repair and paint (partial)

Left



Door frame RR

Scratch(es)

Repair and paint (partial)

Right



Door RR

Scratch(es)

Repair and paint (complete)

Right



Fuel cap cover

Scratch(es)

Replace and paint

Right



Outside rear-view mirror housing L

Scratch(es)

Replace and paint

Left



Outside rear-view mirror housing R

Scratch(es)

Replace and paint

Right



Wheel arch cover FL

Scratch(es)
Replace
Left



Windscreen

Stone chip(s)
Windscreen repair
Front



Wing RR

Dent(s) and scratch(es)
Repair and paint (complete)
Right



Tyres

Front Left

Summer

255/50/20/109/Y

Pirelli

7.8 mm

Front Right

Summer

255/50/20/109/Y

Pirelli

7.8 mm

Rear Left

Summer

255/50/20/109/Y

Pirelli

7.8 mm

Rear Right

Summer

255/50/20/109/Y

Pirelli

7.6 mm

Checks

Certificate of Conformity	No CO2 Emission	0
Customer data reset (contacts, e-mails, messages)	Yes Digital maintenance	Yes
GPS storage	Yes GPS storage	HD
Luggage cover	Yes Number head rests	5
Number of charging cables (normal)	1 Number of charging cables (rapid charge)	1
Number of keys total	2 Service book	N/A
User's manual	Yes	

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.