



Expertise

Protocol number: 46504750
Order No. / Reference: 26610806
Inspection date: 30 Jun 2026

Manufacturer: Polestar

Model: 2 Single Motor 69kWh

VIN: YSMVSEFE4PL153302



Vehicle details	
Manufacturer / Type / Model / Equipment	
Polestar 2 Single Motor 69kWh	
Vehicle Identification number	YSMVSEFE4PL153302
Mileage (Read)	92,469 km
First registration	20 Apr 2023
Number of holders	1
Power / Engine displacement	80 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Magnesium Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	688 Tag(e)
Last service on / at	05/2026 at 91,729		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ221613
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2219 / AAB 00009		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,390 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	245/45 R19 102V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Winter tyres on Light alloy	Goodyear	8mm / 8mm
2)	245/45 R19 102V	Winter tyres on Light alloy	Goodyear	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 12V socket in the trunk
- Acoustic Vehicle Alert System - AVAS
- Airbags: Head/shoulder airbags
- Airbags: SIPS side airbags (including inner side)
- Armrest with cup holder and storage compartment
- Automatic braking after a collision
- Back window, heater
- Charging cable (7 meters) for normal sockets (10A 2.3kW - Schuko plug, Type 2, Mode 2)
- Connected Safety (Connected Safety transmits information between your vehicle and other vehicles via the internet. This function can inform the driver if another vehicle on the current route has activated its hazard warning lights or has detected slippery road conditions. Connected Safety communication only works between vehicles equipped with this function and in which it is activated.)
- ECC 2-zone air conditioning
- Electric child safety lock
- Electronic Stability Control (ESC) and traction control
- Frameless, electrically adjustable exterior mirrors (automatically dimming exterior mirrors)
- Front and rear headrests
- Front storage compartment 41 liters
- Infotainment powered by Android (incl. Google Assistant, Google Maps, Google Play Store -Google service connectivity -Over-the-air (OTA) updates for life)
- Keyless opening and starting (remote control for central locking including charging flap - electrically operated trunk lid with extra-wide foot sensor)
- One pedal drive (regenerative braking)
- Paint finish: Magnesium Metallic
- Polestar Connect (Thanks to Polestar Connect, the driver can communicate with the Polestar 2. For example, the Polestar Connect app allows the driver to switch on the climate control without entering the passenger compartment. The vehicle has buttons for making breakdown or emergency calls. In the event of an accident, the Polestar 2 even automatically makes an emergency call and a call if it is stolen.)
- Rear lights, Full-LED (Full LED rear light with persistent light signature - automatically dimming)
- Rear view camera
- Seats: Semi-electric seats, front (driver's seat memory - lumbar support, front - 4-way electrically adjustable)
- Seats: Split and foldable rear bench seat (40/60)
- Steering wheel: Multifunction steering wheel, height and reach adjustable
- Textile floor mats
- third brake light
- 2 USB ports on the back
- 2 USB ports on the front
- Airbags, driver and front passenger (passenger airbag, deactivatable)
- Alarm system (double locking - Alarm inclination sensor and motion sensor)
- Automatic headlight range control
- Automatically folding exterior mirrors
- Bluetooth
- Charging cable (6 meters) (16A 11kW - Type 2, Mode 3)
- CleanZone (cabin air filter)
- Collision avoidance and mitigation (with braking and steering support - vehicle, cyclist and pedestrian detection)
- Driver Alert Control
- Driver display 12.3" (progressive digital display)
- Electric parking brake (with auto-hold function)
- Electric tailgate with soft closing
- electric window regulator
- First aid kit
- Forward Collision Warning
- Front and rear parking assist
- Hexagonal gear selector with illuminated Polestar symbol
- High Performance audio (8 speakers/250 W)
- Hill start assist
- Immobiliser
- Indirect tire pressure monitoring
- Integrated eSIM (with constant internet connectivity)
- Interior rearview mirror with automatic dimming function
- ISOFIX attachment for front passenger seat and outer rear seats
- Lane Keeping Assist (LKA) (The lane keeping assist steers the vehicle back into the lane and/or warns the driver with steering wheel vibrations.)
- Large, vertical display with touchscreen (11, 15")
- LED headlights, adaptive (Thor's Hammer daytime running lights)
- Navigation system
- Polestar Digital Key
- Radio accessories: Digital radio DAB+
- Rain sensor
- Seat belts (warning for unfastened seat belts, belt tensioners in the front and on the outer rear seats)
- Seats: Front seats with seat heating
- Servotronic
- Speed limiter and cruise control
- Tire repair kit
- Upholstery: embossed fabric with 3D etched decor
- Vehicle Deceleration Control (ABS, Electronic Brake Distribution and Emergency Brake Assist)
- Wheels: 19" alloy wheels with 5 V-spokes, black, diamond cut (with tires 245/45 R19 on 8Jx19 ET50 front, 9Jx19 ET53 rear)



- Traffic Sign Information (RSI) (Using a camera or information from the Sensus navigation system, it provides information on speed limits, no-overtaking zones, one-way streets and various supplementary signs. The traffic sign is displayed on the speedometer or in the head-up display.)
- Transmission: Direct drive

- Whiplash protection system (In the event of a collision, the backrest and headrest of the front seat move as a unit with the occupant to support their neck.)

Extra equipment

- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Misc.	Main inspection - No evidence - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

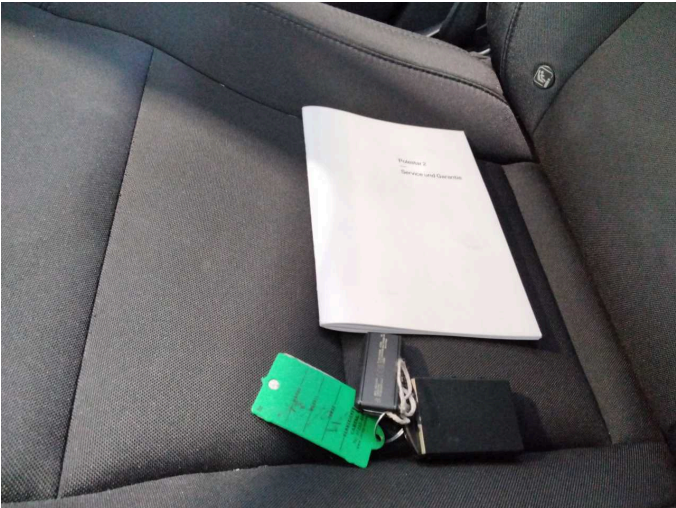


Figure 13: Documents

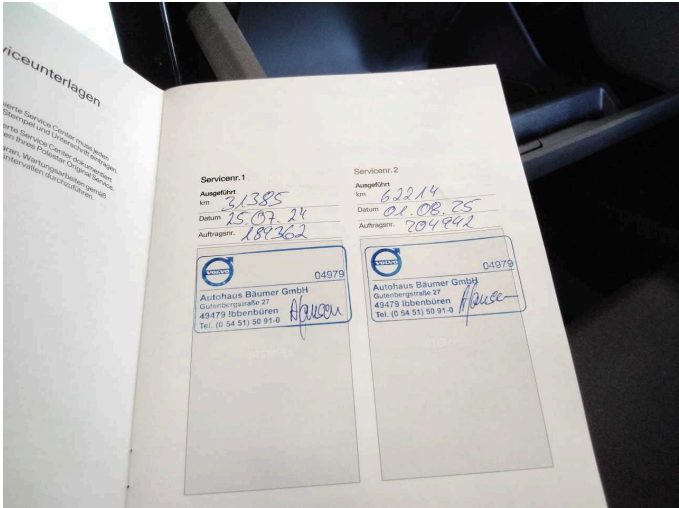


Figure 14: Documents

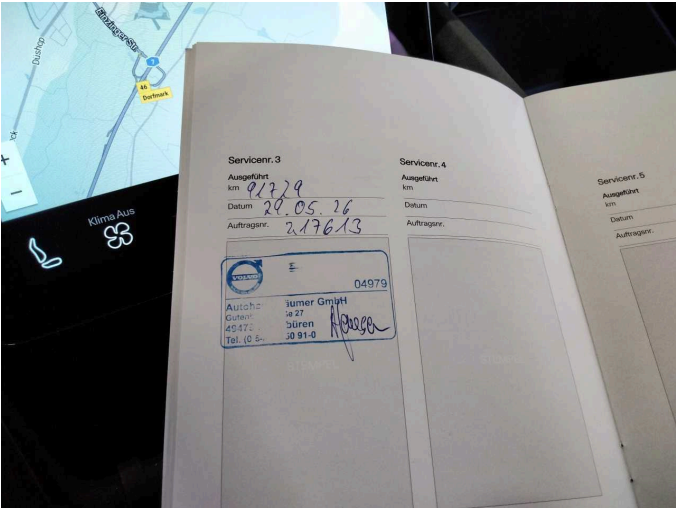


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres

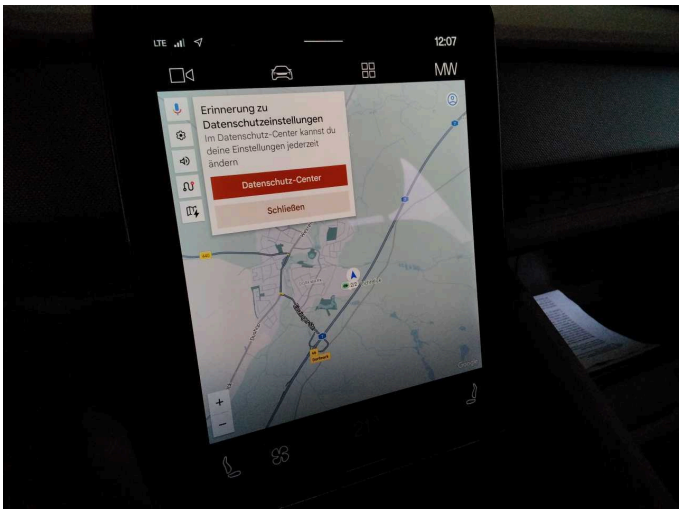


Figure 18: Navigation

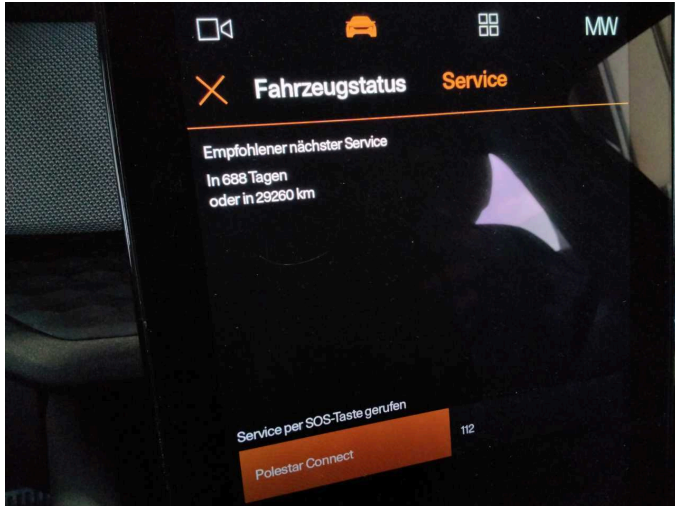


Figure 19: Misc.

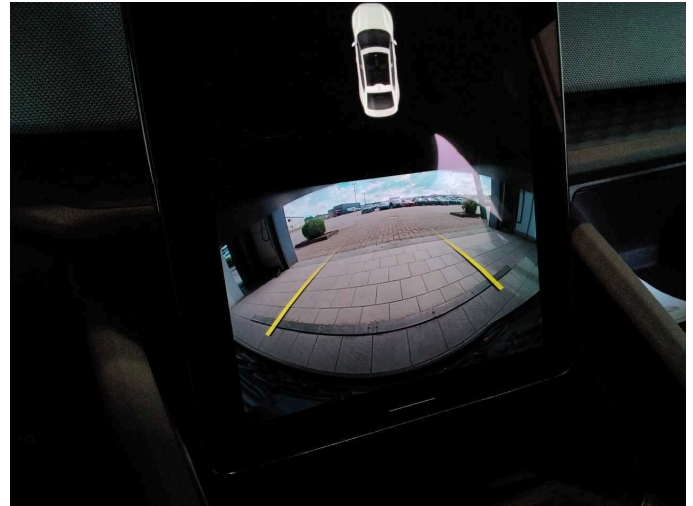


Figure 20: Misc.



Figure 21: Misc.

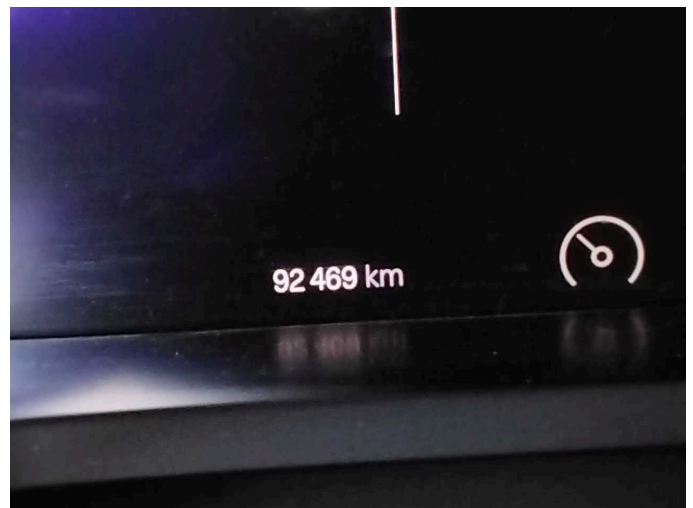


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

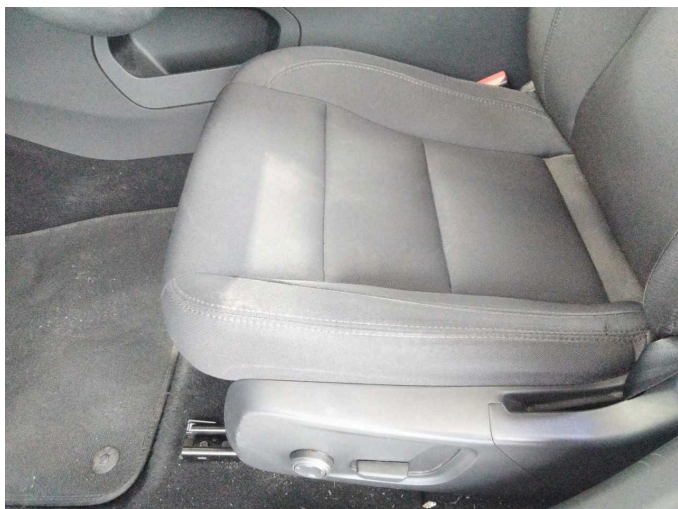


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

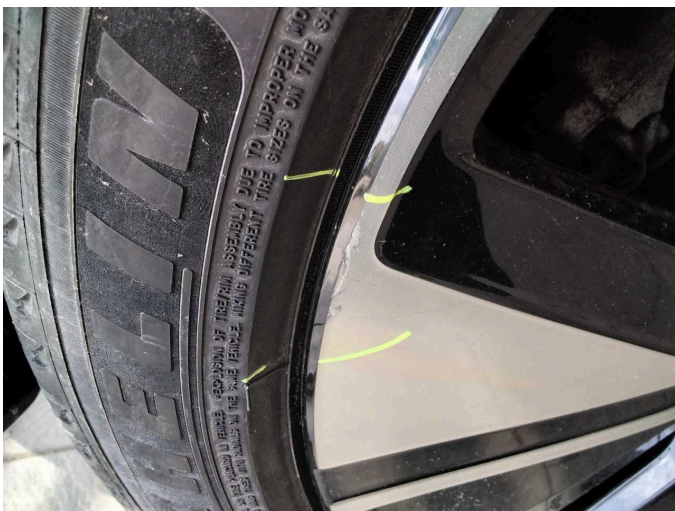

Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction