



Expertise

Protocol number: 46166920
Order No. / Reference: 26566123
Inspection date: 25 Jun 2026

Manufacturer: Skoda
VIN: TMBLJ7NU0P5048254

Model: Karoq 2.0 TDI SCR 4x4 DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Karoq 2.0 TDI SCR 4x4 DSG Sportline	
Vehicle Identification number	TMBLJ7NU0P5048254
Mileage (Read)	97,794 km
First registration	29 Mar 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Moon-Weiß Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	13,500 km
Last service on / at	02/2026 at 88,837 km		
Key is / should be	3 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT094070
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ASQ 03869		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,182 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R18 95W	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	225/50 R18 95W	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Steel	Dunlop	5mm / 5mm
2)	215/60 R16 99H	Winter tyres on Steel	Dunlop	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, high-visibility vest compartment in the front doors, glasses compartment in the headliner, storage compartments in the front door panels with 1.5l bottle holders, cup holders in the front center console)
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Illuminated trunk
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- SPORTLINE decorative inlay
- Digital Cockpit Plus (10")
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Front radar assistant including city emergency braking function with pedestrian detection
- Cruise control
- Green tec (start/stop system and brake energy recuperation)
- Automatic interior mirror dimming
- Trunk cover, fixed
- Front headrests are fixed, rear headrests are height-adjustable.
- LED taillights in crystal glass look (and animated turn signals)
- Reading lights at the front of the headliner
- Rear center armrest with cup holders and pass-through option
- Multi-collision brake
- Package: Infotainment package Bolero (Bolero music system - Capacitive 8" color display - Digital Cockpit Plus - Wireless SmartLink - Voice control)
- Package: Light & Visibility (Matrix LED headlights - LED ambient lighting)
- Package: Winter PLUS (Heated front and outer rear seats - Heated windshield washer nozzles - Headlight cleaning system - Heated windshield)
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink (Android Auto and Apple CarPlay)
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Gear shift indicator
- Electromechanical power steering
- Seats: Adjustable lumbar support in the front seats
- Seats: Height-adjustable front seats
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Exterior mirrors in black, door handles painted in body color
- Hydraulic brake assist (HBA)
- Black headliner
- Roof rails, black
- Diesel particulate filter
- Third vehicle key
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Floor mats
- Closed storage compartment on the dashboard
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Rear window wiper/washer system
- ISOFIX preparation on the outer rear seats (including top tether)
- Paint finish: Special paint finish, solid color
- LED brake light in the rear spoiler
- LED fog lights
- Steering wheel: Heated sports leather steering wheel (DSG) with multifunction buttons (including paddle shifters)
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Fatigue detection
- Package: Comfort PLUS (Adjustable lumbar support in the front seats - Climatronic air conditioning (2-zone) - Sunset - Kessy)
- Package: Performance (4x4) (Adaptive chassis DCC incl. driving profile selection (Normal, Eco, Sport, Individual) - Off-road assistant (only with 4x4 drive) - Progressive steering - Stainless steel look pedals)
- Rear parking sensors
- Radio accessories: 8 speakers
- Radio accessories: USB port in the center console (Type-C)
- Tire mobility kit (tire repair spray incl. compressor)
- Wheels: 18" alloy wheels Procyon black gloss turned, Aero black matt (4x4) (wheels 7J x 18, ET 45 - tires 225/50 R18 95W)
- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)



- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection for rapid assistance in case of breakdown) - Information service (connection to the hotline for all questions regarding vehicle functions) - Free remote vehicle access for one year with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level, etc.)

- Sun visor on driver and passenger side with illuminated vanity mirror
- Speed limiter
- 12V socket - in the trunk
- 12V socket - in the center console
- Bumpers partially painted in body color
- Lashing eyes in the trunk
- Immobiliser
- Central locking with remote control

Extra equipment

- Decorative frame gear knob
- Luggage net partition
- Paint finish: Pearl effect
- Package: Columbus Infotainment Package (Columbus Dynamic Radio Navigation System - 9.2" Capacitive Color Display - Digital Cockpit Plus - Wireless SmartLink - Voice Control - Phonebox with Inductive Charging Function (Connection via External Antenna) - Infotainment Online (3-Year Subscription) - Mapcare Navigation Data Update)
- Variable loading floor in the trunk

- Electric tailgate operation with comfort opening
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Package: Traveller BASIC (Predictive Adaptive Cruise Control ACC (control range up to 210 km/h) - Adaptive Lane Keeping Assist - Traffic Sign Recognition - Capacitive Steering Wheel with Hands Off Detection - USB-C Charging Port on the Interior Mirror - Emergency and Traffic Jam Assist)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work
3	Rear bumper	Rear bumper - Scratch(es) - Smart repair
4	Instrument panel	Indicator light (Airbag) - on - Perform diagnosis
5	Front bumper	Front bumper (inkl. Spoiler) - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Body	Body - Scratch(es) - No deduction
4	Trim / covers	Floor mats - Holes - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster

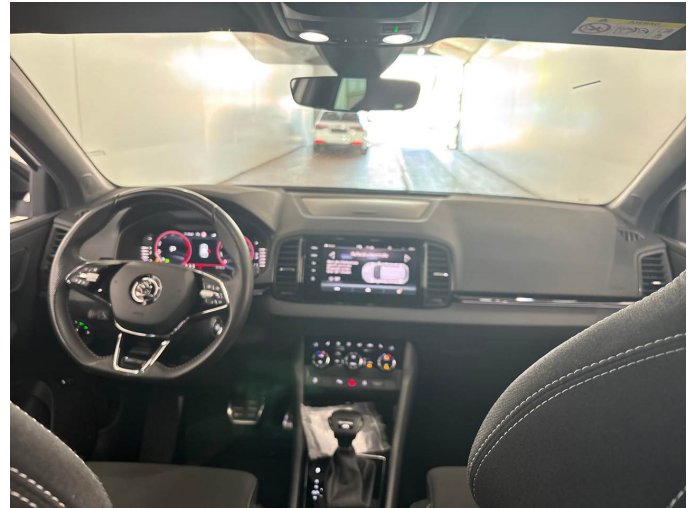


Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

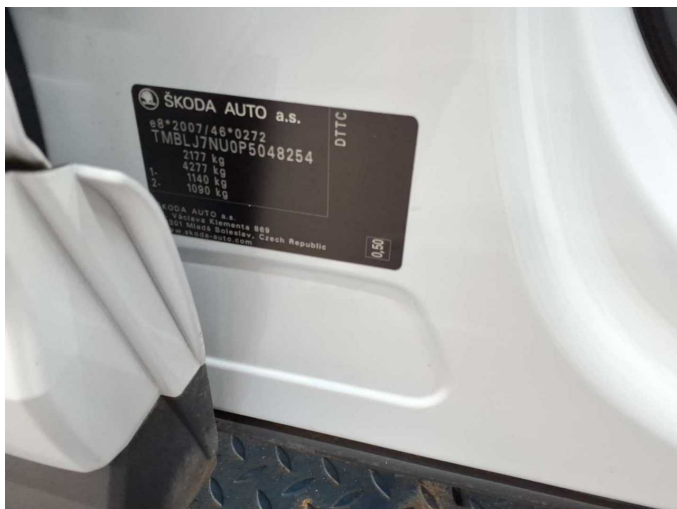


Figure 11: VIN

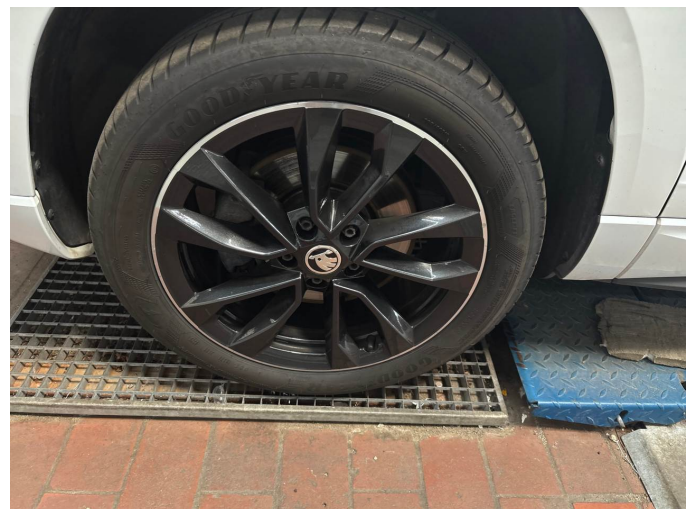


Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

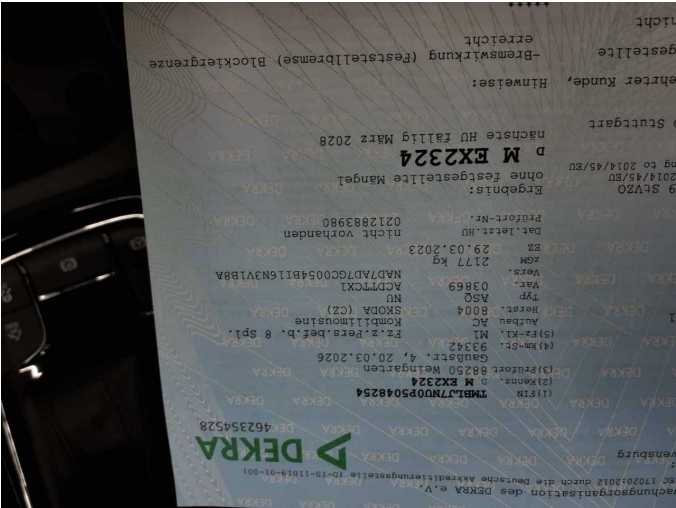


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

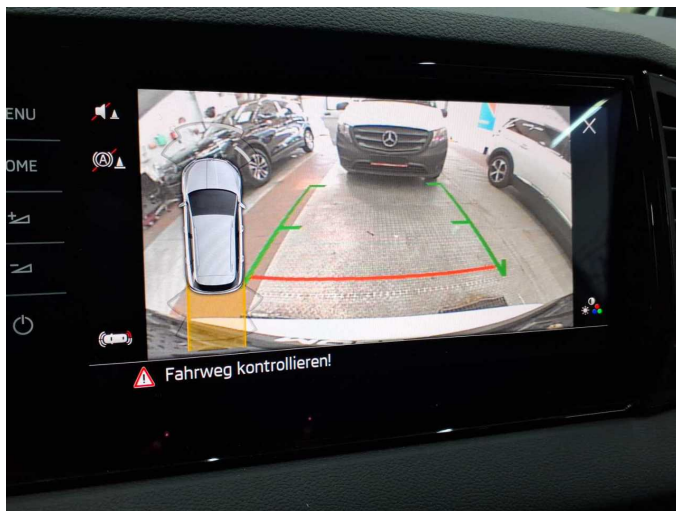


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.




Figure 28: Misc.




Figure 29: Misc.

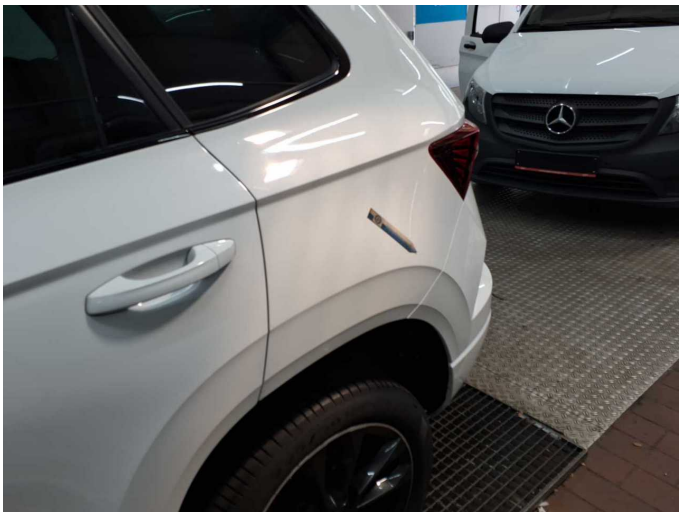

Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

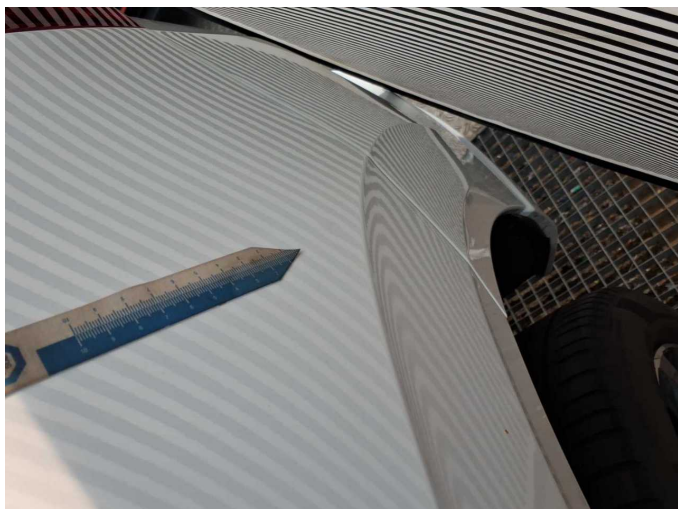

Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

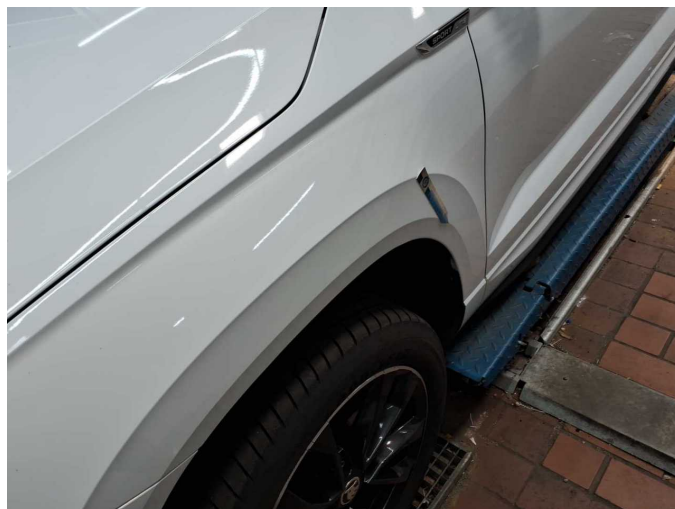

Damage 2: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage 2: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Instrument panel: Indicator light (Airbag) - on - Perform diagnosis



Damage 5: Front bumper: Front bumper (inkl. Spoiler) - Stone chips - Paint



Damage 5: Front bumper: Front bumper (inkl. Spoiler) - Stone chips - Paint



Damage 5: Front bumper: Front bumper (inkl. Spoiler) - Stone chips - Paint



Damage 5: Front bumper: Front bumper (inkl. Spoiler) - Stone chips - Paint



Damage 5: Front bumper: Front bumper (inkl. Spoiler) - Stone chips - Paint



Wear and tear 4: Trim / covers: Floor mats - Holes - No deduction



Wear and tear 4: Trim / covers: Floor mats - Holes - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLJ7NU0P5048254

Hersteller / Modell: SKODA SKODA Karoq 2.0 TDI SCR 4x4 DSG Sportline

Datum	KM-Stand	Beschreibung
20.03.2026	93.342	AU
03.02.2026	88.837	Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
13.06.2025	72.883	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
16.01.2025	59.344	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/ prüfen; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
27.09.2024	48.315	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
02.02.2024	28.790	Regelwartungsdienst; Wartung Sonstiges
15.12.2023	24.911	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges