



BMW X1 (UKL): 2DLG562

Vinnumber:	WBA11EG0105W72976	Versionname:	X1 (U11) sDrive 18d 2.0d 136pk/cv 5p Aut.
First Registrationdate:	17/04/2023	Fiscalpower:	
Expertise Mileage:	168493	Power Kw:	100
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:	Diesel		
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	1	Type of Tow bar	No Tow bar
GPS			
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

205/60/17/100 H				
Winter tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Pirelli: 6 mm	Re.R.	Pirelli: 6 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				205/60 R 17 100 H
Tyre size FR				205/60 R 17 100 H
Tyre size RL				205/60 R 17 100 H
Tyre size RR				205/60 R 17 100 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				All Seasons
Tyre make FL				256
Tyre make FR				256
Tyre make RL				264
Tyre make RR				264

Assistance equipment

Ignition key, Missing, Replace



Backrest cover FL, Scratch(es), Repair/replace (lump sum)



Interior, Dirty, Chemical cleaning



Steering wheel, Scratch(es), Acceptable



Bumper F, Scratch(es), Polish



Bumper moulding F, Scratch(es), Smart repair



Bonnet, Stone chip(s), Acceptable



Alloy rim FL, Scratch(es), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Wing RL, Dent(s) and scratch(es), Repair and paint (complete)



Door RL, Dent(s), Acceptable



Boot lid covering R, Scratch(es), Acceptable



Bumper R, Scratch(es), Acceptable



Tailgate / Boot, Scratch(es), Acceptable




Step R, Scratch(es), Acceptable



Step R, Dent(s) and scratch(es), Repair and paint (complete)



Alloy rim RR, Scratch(es), Repair and paint (complete)

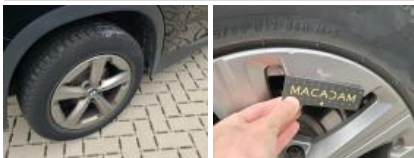

Door RR, Scratch(es), Acceptable



Door FR, Bad repair, Repair and paint (complete)



Door RR, Repaired, Check



Wing RR, Dent(s), Acceptable




Outside rear-view mirror housing R, Scratch(es), Acceptable



Alloy rim FR, Scratch(es), Repair and paint (complete)



Wing RR, Repaired, Check

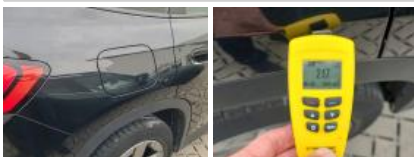

Bodywork, Paint measurement, Check



Ignition key, Worn, Acceptable

