



Expertise

Protocol number: 46602530
Order No. / Reference: 26740746
Inspection date: 14 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan 1.5 TSI OPF DSG R-Line

VIN: WVGZZZ5N0RW503846



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 1.5 TSI OPF DSG R-Line	
Vehicle Identification number	WVGZZZ5N0RW503846
Mileage (Read)	14,970 km
First registration	22 Nov 2023
Number of holders	1
Next periodical technical inspection	11/2026
(Report not on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Re-import	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	-235 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY363958
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / CIR 40589		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	
Dimensions	4511 x 1859 x 1651		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R20 101V	Summer tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm
2)	255/40 R20 101V	Summer tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side (passenger airbag deactivation - knee airbag on the driver's side)
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles (interior door operation in matte chrome)
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Parking aid (warning signals for obstacles in the front and rear area)
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Automatic headlight control with LED daytime running lights ("Coming home" and "Leaving home" function)
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- rear window wiper
- Interior mirror automatically dimming
- Air conditioning system "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Rear headrests (3)
- LED reading lights, 2 in the front and 2 in the rear
- Steering wheel: Multifunction sports steering wheel in leather, heated, with touch controls and paddle shifters
- Fatigue detection
- Non-smoking version (storage compartment and 12V socket at the front)
- Otto particulate filter
- Pedals and footrest in brushed stainless steel
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: AirStop tires 255/45 R 19, optimized for low rolling resistance
- Gearshift knob in leather
- Front windshield washer nozzles automatically heated
- Electromechanical power steering (speed-dependent control)
- Seats: Front passenger seat backrest folds down completely
- Seats: Top comfort seats in the front
- Seats: Heated front seats
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front (charging power up to 45 W)
- Telephone interface
- Textile floor mats front and rear with decorative stitching in grey
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear
- Airbag: Head airbag system for front and rear passengers including front side airbags
- 30-color ambient lighting
- Adaptive Cruise Control (ACC) "stop & go" including speed limiter
- Chrome trim on the side windows
- black roof rails
- Decorative inlays "Carbon Grey" (for instrument panel and front door panels)
- Tachometer
- Front door sill trims in aluminum, with "R-Line" logo
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows front and rear
- High beam control Light Assist
- Pedestrian detection
- luggage compartment light
- Rear window heated
- Rear spoiler in R-style
- ISOFIX mounting points for attaching 2 child seats to the rear seats (also for i-Size child seats)
- Instrument cluster with electronic speedometer (odometer, trip meter, tachometer)
- Front headrests (safety-optimized - adjustable lengthwise and height)
- Light in the front footwell
- Front center armrest adjustable in height and length, with storage box and rear air vents
- Emergency braking assistant "Front Assist"
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Cloth
- Radio
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: Tire Mobility Set omitted
- Wheels: Alloy (4) "Valencia" 8.5 J x 19, Volkswagen R (tires 255/45 R 19)
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts with belt tensioners for the outer rear seats
- Seats: Lumbar support in the front
- Seats: Rear bench seat asymmetrically split (longitudinally sliding and folding - with pass-through and center armrest)
- Seats: Front seats with height adjustment
- 12-volt power outlet (on the rear center console and in the luggage compartment)
- Bumpers in body color, in "R-Line" styling (with chrome design elements)
- First aid kit, warning triangle and high-visibility vest



- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys

Extra equipment

- Airbag: Side airbags for the outer rear seats (including front side airbags and head airbag system)
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Paint finish: Pearl effect
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - LED headlights with LED daytime running lights and cornering lights - LED taillights, dark red)
- Package: "IQ.DRIVE" assistance package including "Emergency Assist", without "Side Assist" (Proactive occupant protection system - "Travel Assist" driving assistant, "Lane Assist" lane keeping assistant and "Emergency Assist" - "Park Assist" parking assistant including parking aid - traffic sign recognition)
- Package: Design Package Ext. "Black Style"
- Package: Sports package in conjunction with DP ExBlackSty
- Package: Winter, additionally with heated outer rear seats (windscreen washer nozzles automatically heated - front seats and outer rear seats heated)
- Progressive steering
- Surround view "Area View" (incl. reversing camera "Rear View")
- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
- Display: Head-up display
- Wirelessly heated windshield (infrared-reflective, noise-reducing)
- Tailgate with electric opening and closing, adjustable opening angle
- Navigation system "Discover Media" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - Map with 2D display - 3-band sound control - Telephone interface - Traffic sign recognition - Points of interest - DAB+ digital radio reception)
- Package: Business Premium (DSG) (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated front windscreen washer nozzles - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Park Assist system including parking aid
- Wheels: Alloy (4) "Suzuka" 8.5 J x 20, Volkswagen R (in Dark Graphite - AirStop tires 255/40 R 20 - Wheel locks with enhanced theft protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Historie) - No evidence - No deduction
2	Door - front right side	Door - dent(s) - Smooth repair work
3	Engine	Engine cover - Damage caused by marten / rodent - Replace
4	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
5	Wheel / tyres	Tyre - rear right side - Scratch(es) - Replace
6	Misc.	Inspection / maintenance - Due - Perform
7	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
8	Door - front left side	Door - Dent / paintcoat damage - repair according to calculation
9	Front bumper	Front bumper (+ Radhausverbreiterung) - Scratch(es) - Paint
10	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Headlight	Headlight - left side - Stone chips - No deduction
2	Door - rear left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

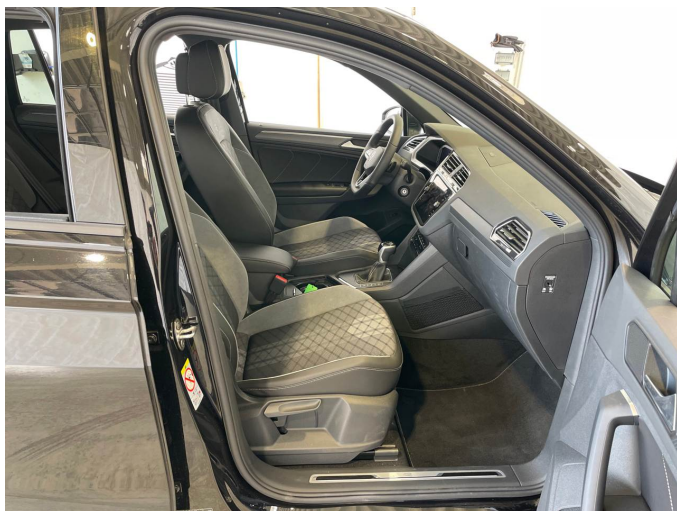


Figure 5: Interior - front

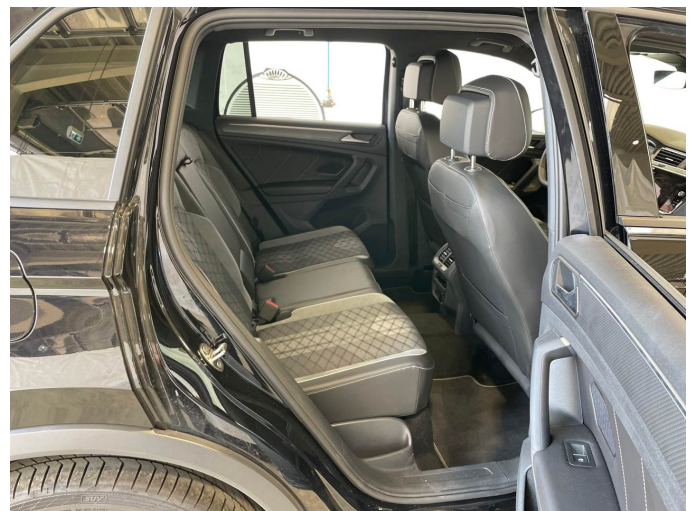


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

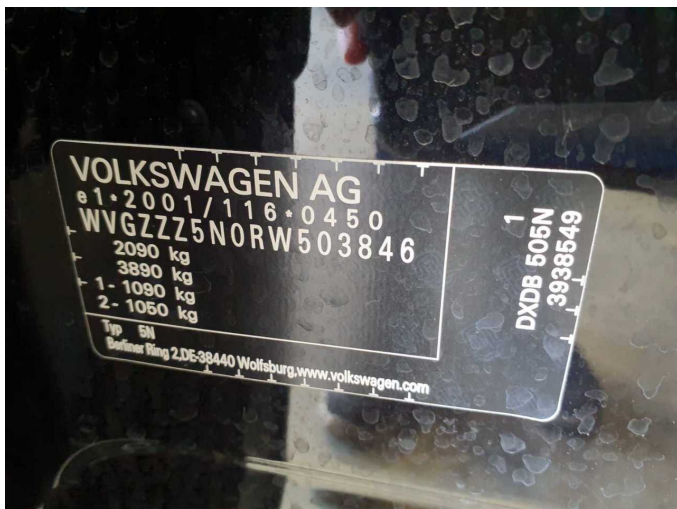


Figure 11: VIN



Figure 12: Mounted tyres

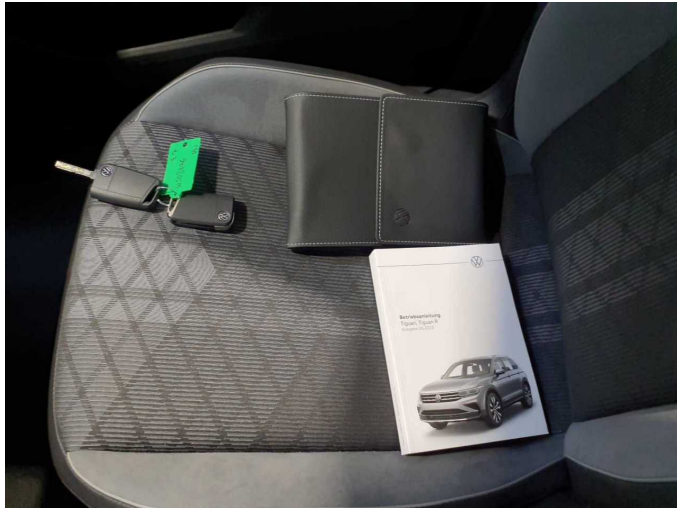


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

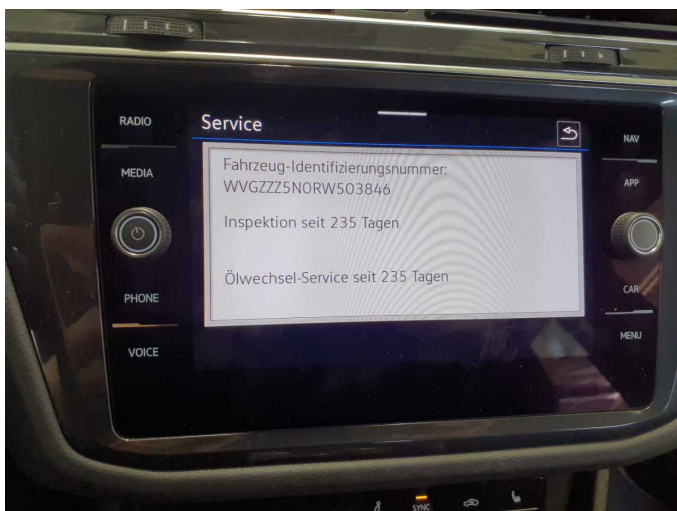


Figure 17: Misc.



Figure 18: Misc.

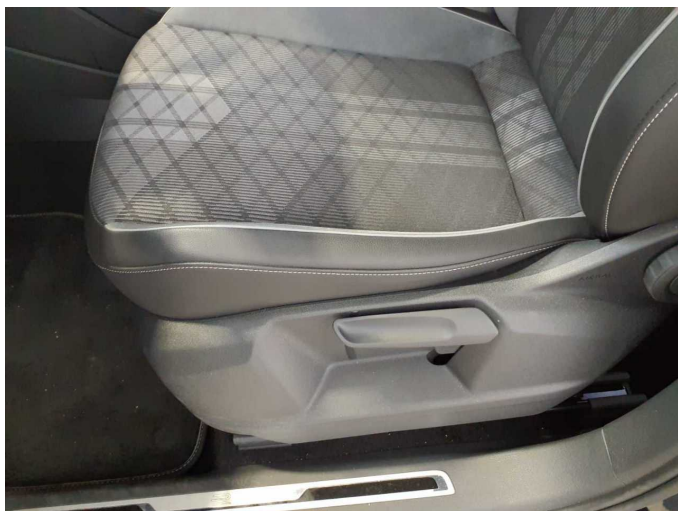


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

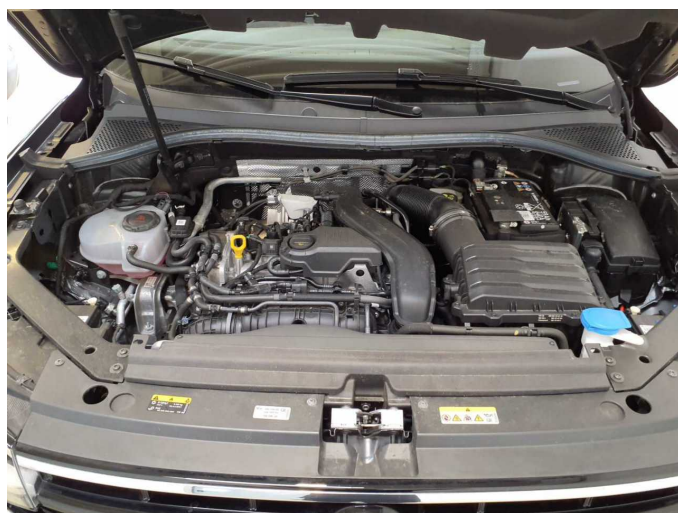


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 2: Door - front right side: Door - dent(s) - Smooth repair work



Damage 2: Door - front right side: Door - dent(s) - Smooth repair work



Damage 3: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 3: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Tyre - rear right side - Scratch(es) - Replace



Damage 5: Wheel / tyres: Tyre - rear right side - Scratch(es) - Replace



Damage 6: Misc.: Inspection / maintenance - Due - Perform



Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

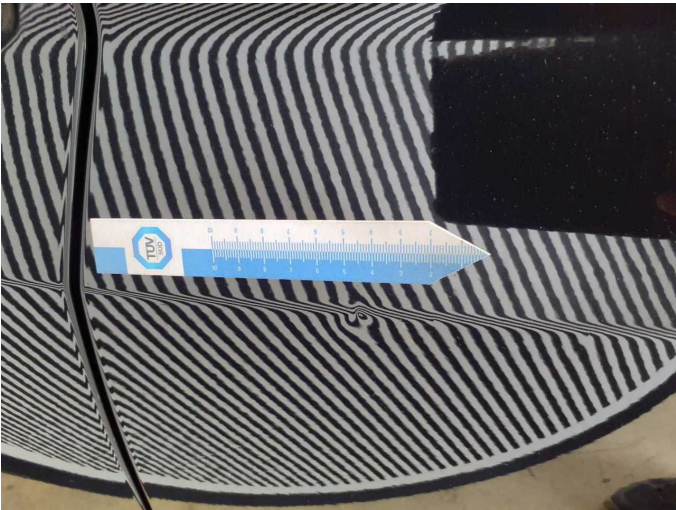

Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 8: Door - front left side: Door - Dent / paintcoat damage - repair according to calculation



Damage 8: Door - front left side: Door - Dent / paintcoat damage - repair according to calculation

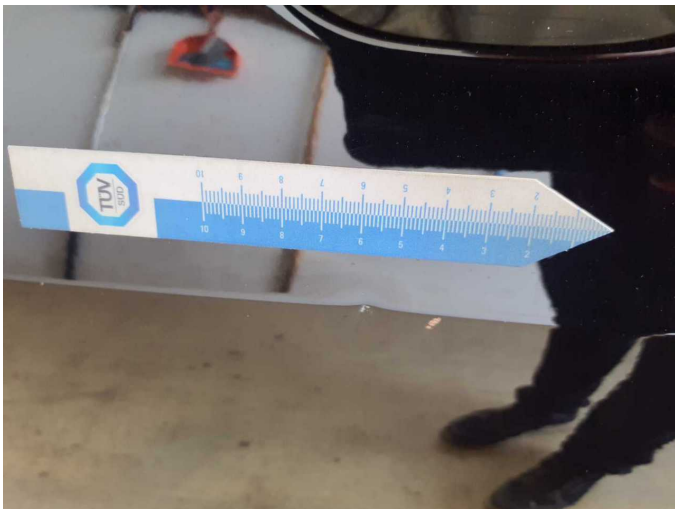


Damage 8: Door - front left side: Door - Dent / paintcoat damage - repair according to calculation




Damage 9: Front bumper: Front bumper (+ Radhausverbreiterung) - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper (+ Radhausverbreiterung) - Scratch(es) - Paint

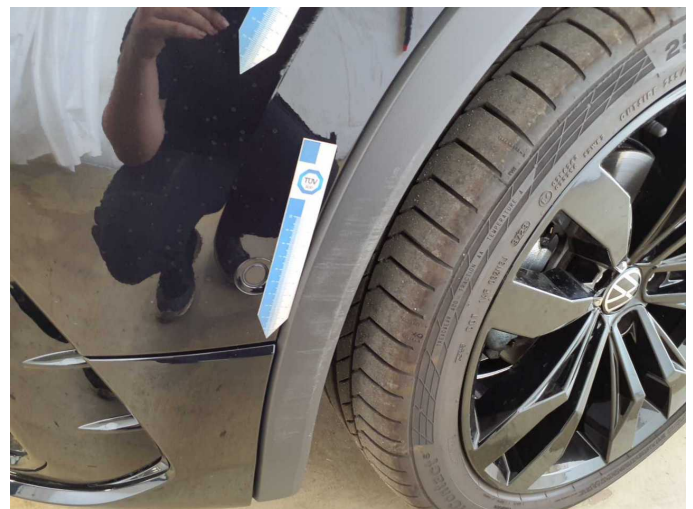

Damage 9: Front bumper: Front bumper (+ Radhausverbreiterung) - Scratch(es) - Paint

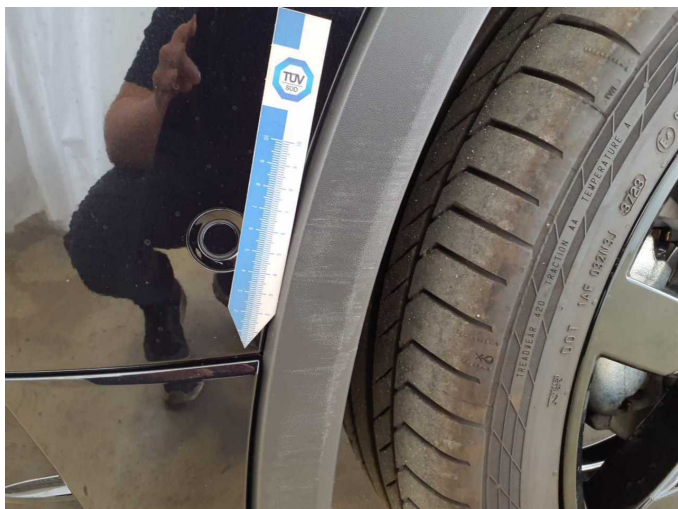

Damage 9: Front bumper: Front bumper (+ Radhausverbreiterung) - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper (+ Radhausverbreiterung) - Scratch(es) - Paint



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace