



Expertise

Protocol number: 46091762
Order No. / Reference: 26534868
Inspection date: 23 Jun 2026

Manufacturer: Mercedes-Benz
VIN: W1N9M0CB4PN041844

Model: EQB 250+ AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQB 250+ AMG Line	
Vehicle Identification number	W1N9M0CB4PN041844
Mileage (Read)	82,585 km
First registration	14 Aug 2023
Number of holders	1
Power / Engine displacement	95 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Kosmossschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	219 Tag(e)
Last service on / at	01/2026 at 71,950 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV731557
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BLE 00007		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,520 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103T	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	235/50 R19 103T	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R18 102T	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/60 R18 102T	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- Ambient lighting in 64 colors
- AMG rear apron in diffuser look with chrome trim
- AMG-specific black panel radiator grille
- AMG-specific front apron
- Rear armrest
- Electrically adjustable exterior mirrors
- Double cup holder
- DYNAMIC SELECT
- Door sills with model-specific lettering, illuminated and with interchangeable cover
- Luggage net on driver and passenger seatbacks
- Transmission: Direct drive
- rear window wiper
- Climate: THERMATIC automatic climate control
- Headrests (5)
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW (3-phase)
- Air vents in silver chrome with outer ring in silver chrome
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Side panels in black grained finish with chrome insert
- Seats: 4-way lumbar support for driver
- Seats: Sports seats
- TIREFIT with tire inflation compressor
- Immobiliser
- Decorative elements spiral optics backlit
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Brake Assist
- Acoustic environmental protection
- AMG floor mats in black velour with "AMG" lettering
- AMG pedal assembly made of brushed stainless steel with rubber studs
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Basic services
- Third brake light in LED technology
- EASY-PACK tailgate
- Chassis: Comfort chassis with lowered suspension
- Electric windows, front and rear
- Speed Limit Assistant
- Rear window heated
- Black fabric headliner
- Communication module (LTE) for the use of Mercedes me connect services
- Charging system: Direct current charging system (DC charging)
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Cargo space
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote and Charging Services Premium
- Windscreen wipers with rain sensor
- Three-point seat belts on all seats
- Seats: Rear seat backrests foldable
- Cruise control
- High-visibility vest for drivers
- Central locking



Extra equipment

- Ambient lighting with projection of the brand logo (one LED projector in each front door - taking over the function of the exit lights)
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Charging cable for wallbox and public charging stations, 8m, smooth (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- Chassis: Comfort chassis (Enjoy high comfort on long motorway journeys, while still being able to tackle tight corners with sporty enthusiasm. The well-balanced comfort chassis offers a convincing mix of ample suspension reserves and very good driving stability. This makes your journey safe and also provides plenty of driving pleasure.)
- Package: Advanced Plus (Fully digital instrument display, high resolution 10.25" - CENTRAL MEDIA DISPLAY 10.25" - Mirror package: interior and exterior mirrors automatically dimming, exterior mirrors electrically folding, ambient lighting for the exterior mirrors to illuminate the entry area - Parking package with reversing camera - Active Park Assist with PARKTRONIC - THERMOTRONIC automatic climate control - KEYLESS-GO Comfort package: KEYLESS-GO function, EASY-PACK tailgate - Wireless charging system for mobile devices in the front - Advanced sound system - 10 speakers, 225 W, Blind Spot Assist)
- Package: Parking package with 360° camera (Active Parking Assist including PARKTRONIC with visual and acoustic warnings of detected obstacles, notification of detected parking spaces in the instrument cluster via arrow display, convenient parking in and out of parallel and perpendicular parking spaces - 360° camera with four networked close-range cameras in the radiator grille, in the tailgate release handle and in the exterior mirror housings, displaying all four sides of the vehicle and visualizing the vehicle and its surroundings from a bird's-eye view in the multimedia system display)
- Seats: Electrically adjustable driver's seat with memory function (the memory programming includes all seat adjustment options such as seat height and fore/aft position, seat cushion tilt, and backrest tilt – exterior mirrors and the optional head-up display are also integrated – dynamic seating while driving. Small movements of the seat cushion and backrest in three programs and two speeds)
- Seats: Front right seat electrically adjustable with memory function (memory programming with seat adjustment options such as height and longitudinal direction, seat cushion tilt and backrest tilt - Motion Seating with three programs and two speeds)
- Dark tinted heat-insulating glass (rear side windows and rear window)
- Exit warning function
- GUARD 360° Vehicle Protection Plus (Anti-theft alarm system - Tow-away protection with visual and audible warning in case of detected change in position - Audible alarm - Interior monitoring (triggers upon movement inside the vehicle) - Assistance with vehicle theft (theft assistance), free of charge for 3 years from activation - Emergency key deactivation, free of charge for 3 years from activation - GUARD 360° label on the front side windows - Collision detection, free of charge for 3 years from activation)
- Heated seats for driver and front passenger
- Heated windshield washer system
- Navigation accessories: MBUX Augmented Reality for Navigation (To help you find your way in complex traffic situations, MBUX Augmented Reality for Navigation connects the virtual world with the real one. The technology overlays graphical navigation and traffic information onto live images. You reach your destination quickly, safely and stress-free.)
- Package: Connectivity Package Navigation (Hard drive navigation - Advanced navigation services)
- Package: Driving Assistance (Active Distance Assist DISTRONIC - Active Speed Limit Assist - Extended Automatic Restart on Highways - Route-Based Speed Adaptation with Traffic Jam Definition - Active Steering Assist - Active Emergency Stop Assist with SOS Function - Emergency Lane Radio - Active Brake Assist - Turning and Intersection Function - Traffic Jam Emergency Braking Function - Evasive Steering Assist - Active Blind Spot Assist - Exit Warning Function - PRE-SAFE)
- Paint finish: Metallic
- Phone accessories: Smartphone integration (Smartphone integration merges your mobile phone with the media system via Apple CarPlay and Android Auto. This gives you convenient access to your smartphone's most important applications. You can also use third-party apps like Spotify quickly and easily. Features include: app display, access to current software and data (e.g., for navigation, traffic information, contacts, messaging, telephony, media), and voice control of smartphone functions.)
- Radio accessories: Burmester surround sound system (with 12 speakers and 590 watts system power)
- Roof rails in polished aluminum
- Seats: Adjustable rear seats (A multi-talent - with the longitudinal adjustment of the rear seats, you can transform your vehicle in just a few moments from a small space miracle for rear passengers to a compact premium transporter. If required, you can slide the entire rear bench seat forward by up to 90 millimeters and back by 50 millimeters.)



- Traffic Sign Assistant (networked system consisting of a camera behind the windshield and navigation maps - analyzes the camera images and can recognize stored traffic signs - assesses the currently driven route based on navigation data - displays speed limits, prohibitions and their cancellation in the instrument cluster or media display as well as in the optionally available head-up display - optional and, upon request, additional acoustic warning when the maximum permitted speed is exceeded - can recognize no-entry signs)
- Sunroof: Panoramic sunroof (large glass module made of heat-insulating, tinted safety glass - mesh wind deflector in the front area - electric sunshade with one-touch operation - comprehensive protection concept: - anti-pinch protection - automatic rain closing - PRE-SAFE closing function (only in conjunction with PRE-SAFE system))
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4-piece set in 5-twin-spoke design (aerodynamically optimized, painted in high-gloss black and polished with 235/50 R 19 tires on 7.5 J x 19 ET 53.5 rims)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Side panel - rear right side	Interior trim - Scratched - Smart repair
3	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Trim / covers	Carpet - front left side - Damaged - Loss in value
6	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
7	Rear bumper	Protection strip - centre - Scratched - Replace
8	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
9	Vehicle glazing	Windscreen (Rissbildung-kein Staubschutz) - Stone chips - repair according to calculation
10	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Door - front left side	Door - Scratch(es) - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

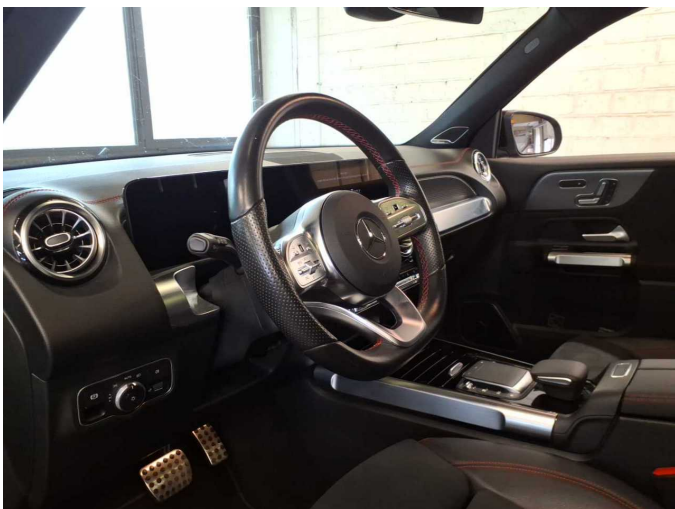


Figure 23: Misc.



Figure 24: Misc.

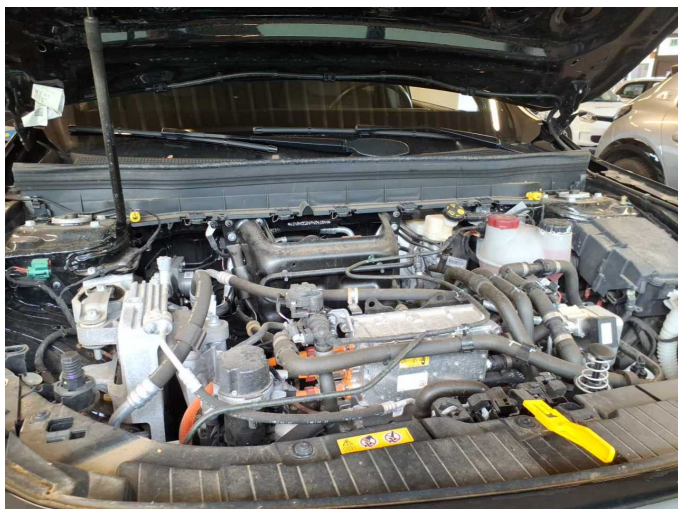


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Damage 2: Side panel - rear right side: Interior trim - Scratched - Smart repair



Damage 2: Side panel - rear right side: Interior trim - Scratched - Smart repair

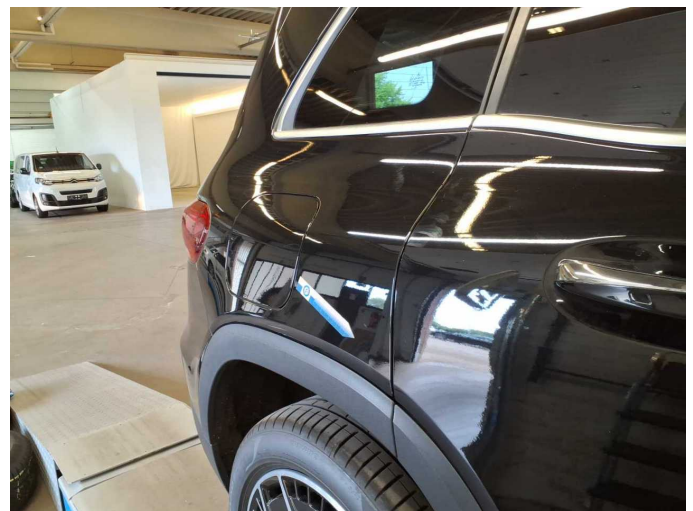

Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 3: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Trim / covers: Carpet - front left side - Damaged - Loss in value

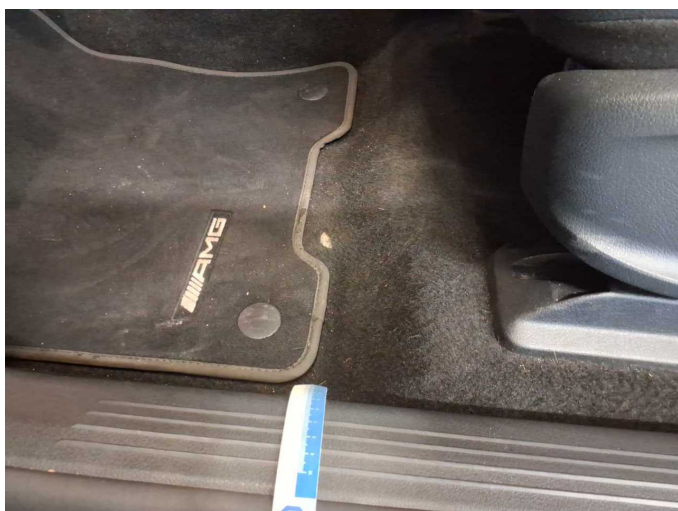

Damage 5: Trim / covers: Carpet - front left side - Damaged - Loss in value



Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

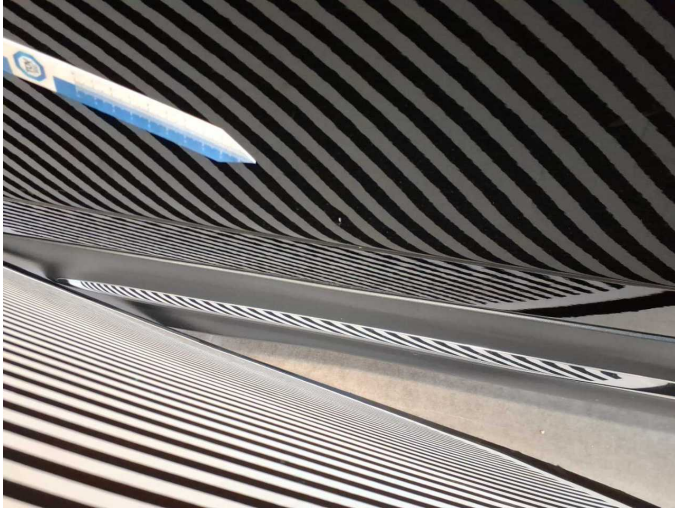

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Rear bumper: Protection strip - centre - Scratched - Replace



Damage 7: Rear bumper: Protection strip - centre - Scratched - Replace



Damage 7: Rear bumper: Protection strip - centre - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 9: Vehicle glazing: Windscreen (Rissbildung-kein Staubschutz) - Stone chips - repair according to calculation




Damage 9: Vehicle glazing: Windscreen (Rissbildung-kein Staubschutz) - Stone chips - repair according to calculation



Damage 9: Vehicle glazing: Windscreen (Rissbildung-kein Staubschutz) - Stone chips - repair according to calculation




Damage 10: Front bumper: Front bumper - Scratched - Paint

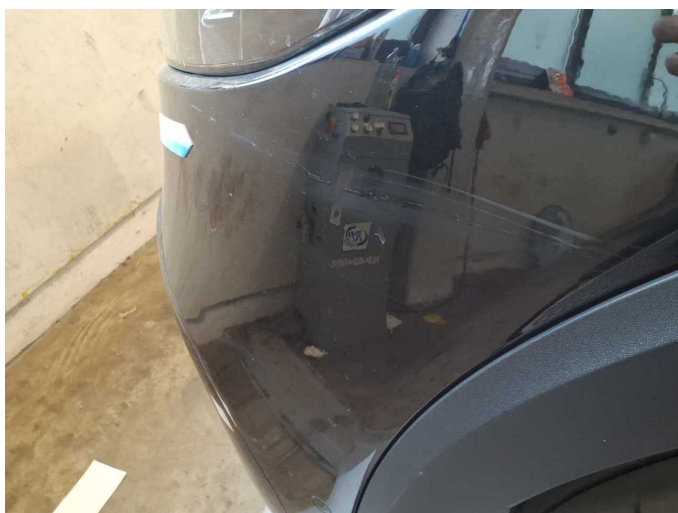


Damage 10: Front bumper: Front bumper - Scratched - Paint



Damage 10: Front bumper: Front bumper - Scratched - Paint

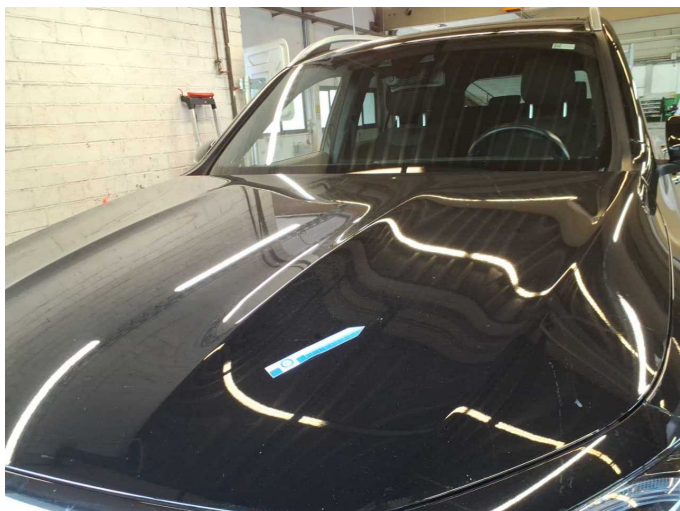

Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

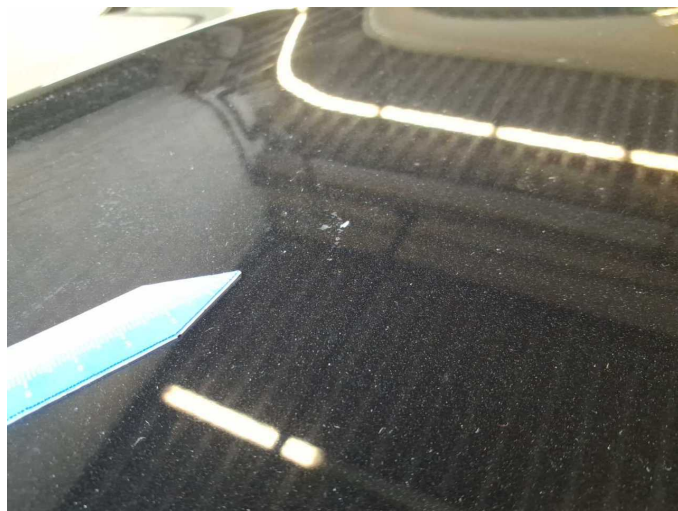

Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Door - front left side: Door - Scratch(es) - Smart repair



Wear and tear 2: Door - front left side: Door - Scratch(es) - Smart repair



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N9M0CB4PN041844

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQB 250+ AMG Line

Datum	KM-Stand	Beschreibung
23.01.2026	71.950	Regelwartungsdienst
25.04.2025	48.395	Regelwartungsdienst
17.05.2024	23.660	Regelwartungsdienst