



Expertise

Protocol number: 46391945
Order No. / Reference: 26543765
Inspection date: 8 Jul 2026

Manufacturer: Peugeot

Model: 3008 BlueHDi 130 Stop & Start Allure

VIN: VF3MCYHZMMS254702



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 3008 BlueHDi 130 Stop & Start Allure	
Vehicle Identification number	VF3MCYHZMMS254702
Mileage (Read)	103,173 km
First registration	10 Jan 2022
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Artense Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	4 Monat(e)
Last service on / at	09/2025 at 90,174 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA842821
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3003 / AZI 00230		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	7mm / 7mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	7mm / 7mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment: Illuminated glove compartment
- Active Safety Brake and Front Collision Warning
- Electrically folding exterior mirrors (with LED approach lighting)
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Turn signals with lane change indicator function
- third brake light
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Decorative inlays "Spray" with carbon look for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Misfueling protection
- Electric windows, front and rear (with comfort operation and anti-pinch protection)
- Follow-me-home function (automatic)
- Front bumper in chrome look
- Transmission: 6-speed manual transmission
- Seat belts: 3-point seat belts (Front seats: - Height-adjustable three-point seat belts with belt locking devices - Pyrostatic belt tensioners and electronically controlled belt force limiters - Isofix on the front passenger seat - Safety-optimized headrests - Warning light and signal when the seat belt is not fastened or is released for the driver and front passenger) Rear seats: - 3 three-point seat belts - Belt force limiters on the side seats - Isofix on the outer seats - Warning light and signal when the seat belt is released)
- LED taillights with 3D effect
- LED daytime running lights and LED turn signals at the front
- light sensor
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- rear fog lights
- Emergency brake assist with automatic activation of the hazard warning lights
- Particulate filter: FAP diesel particulate filter
- Peugeot Connect Box (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Mirror Screen (transmission of multimedia content and apps from a compatible smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps - Android Auto and Mirror Link (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple))
- Reversing camera with 180° surround view
- ABS (Anti-lock Braking System)
- Airbags (6) (Driver and front passenger airbag - front passenger airbag deactivatable - front and rear side airbags - front and rear curtain airbags)
- Exterior mirrors in Perla Nera Black
- Hill start assist
- On-board computer (outside temperature and maintenance display - average and current fuel consumption - remaining range - distance traveled - average speed)
- Decorative trim on the dashboard and door panels in satin chrome
- Pressure tank system including switch for opening the tank flap
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- High beam assist
- electric parking brake
- Front collision warning
- Cruise control system with speed limiter
- Cup holder in the center console
- Heated rear window
- rear window wiper
- Interior mirror automatically dimming
- Manual child lock
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- Rear headrests (3) (height adjustable and lowerable)
- LED ambient lighting in the front footwell
- LED ceiling light and LED reading lamps (LED ceiling light front and back - 2 LED reading lamps front and back)
- LED headlights (Eco)
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- Rear center armrest with pass-through flap
- Fatigue warning
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - real-time navigation by TomTom Services - operation via touchscreen with 10" HD color screen - map transfer to the digital instrument cluster)
- Upholstery: Fabric/faux leather (Colyn) in black with decorative stitching in mint
- Radio: RCC audio system (Bi-tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Rain sensor
- Tire pressure monitoring system
- Wheels: 18" "Detroit" alloy wheels, two-tone with grey (with 225/55 R 18 tires)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Rear seat backrest split 40/60 and automatically foldable, control element in the boot



- Shift point indicator
- Keyless start system
- Electric power steering
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Stop&Start system (automatic)
- Doors lock automatically when driving off
- Tie-down points in the trunk (4 pieces)
- Immobiliser

Extra equipment

- luggage compartment partition net
- Package: Full leather package (Upholstery: Black "Nappa" leather with grey decorative stitching - Heated front seats - Folding passenger seat)

- Side and rear windows are more heavily tinted.
- Seats: Passenger seat height adjustable
- Seats: Manual lumbar support for driver's seat (2-way)
- 12 Volt power outlet (3) (in the trunk, rows 1 and 2)
- Blind spot assist
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking can be activated from inside using a remote control.

- Paint finish: Special metallic paint
- Seats: Heated front seats (adjustable in 3 stages)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Electrical system	Battery - Empty - Perform diagnosis
2	Equipment	Tirefit filler - Expired - Replace
3	Roof	Roof - dent(s) - Smart repair
4	Instrument panel	Indicator light (Kollisionsgefahrerkennung) - on - Perform diagnosis

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Door - front left side	Door edge - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

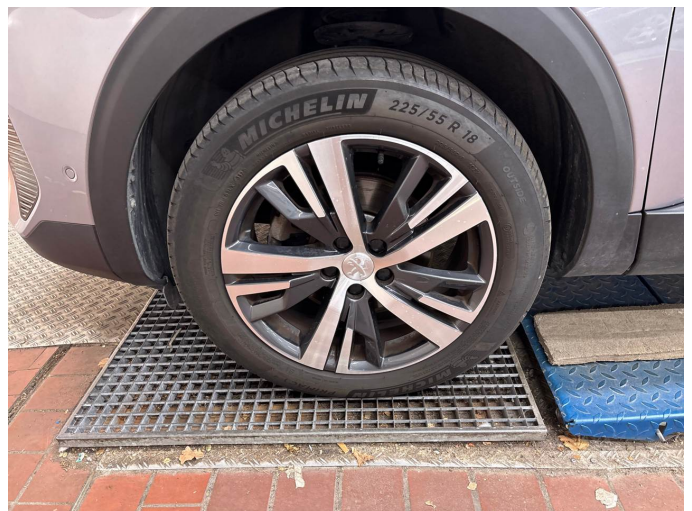


Figure 12: Mounted tyres

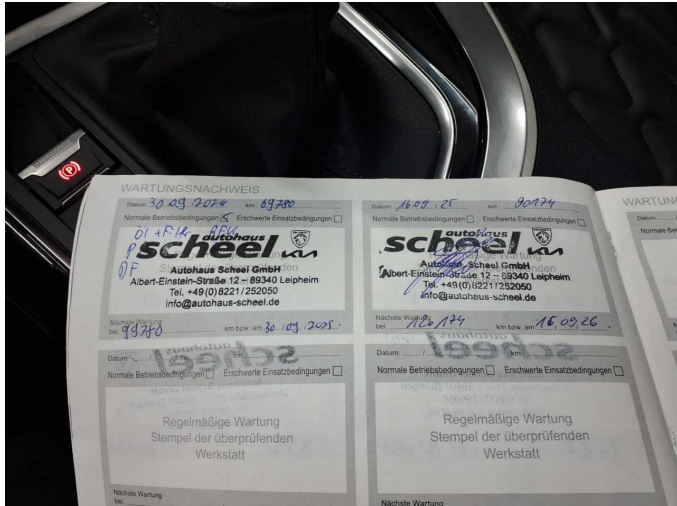


Figure 13: Documents

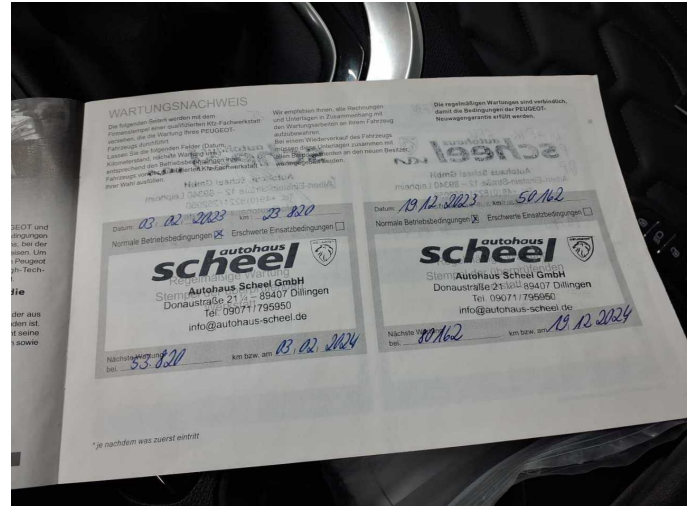


Figure 14: Documents

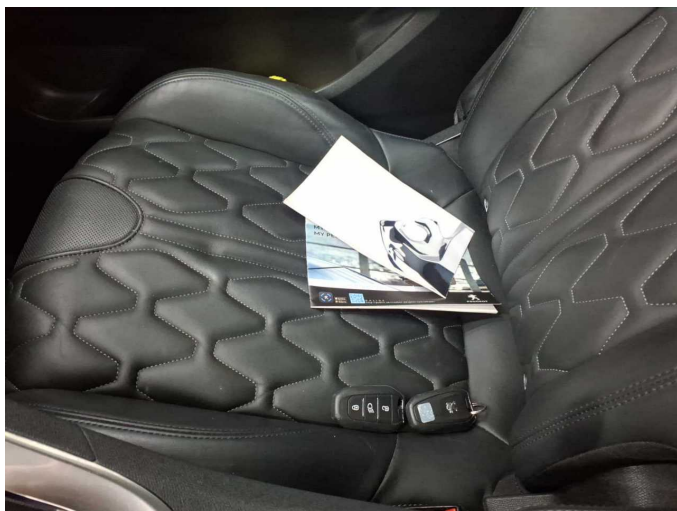


Figure 15: Documents



Figure 16: Documents

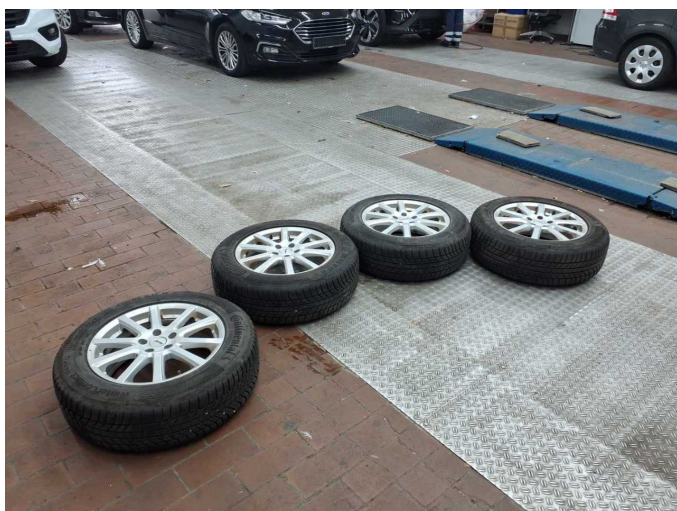


Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

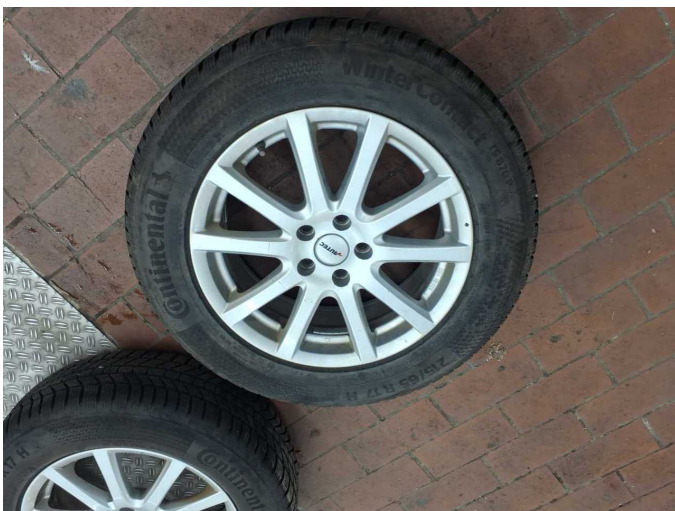


Figure 27: Misc.

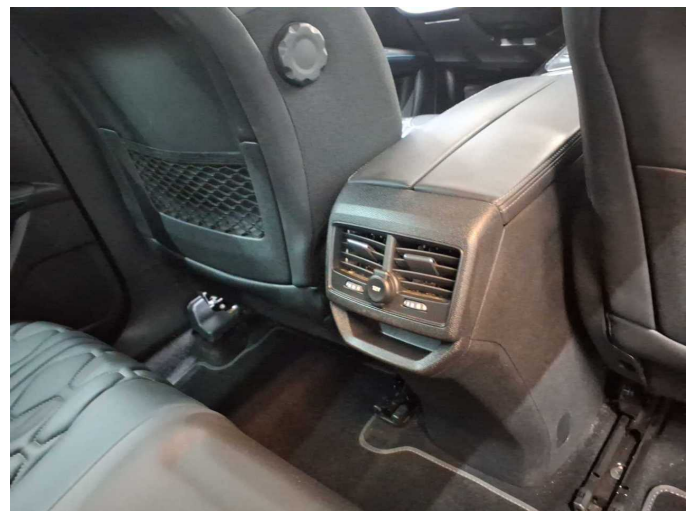


Figure 28: Misc.

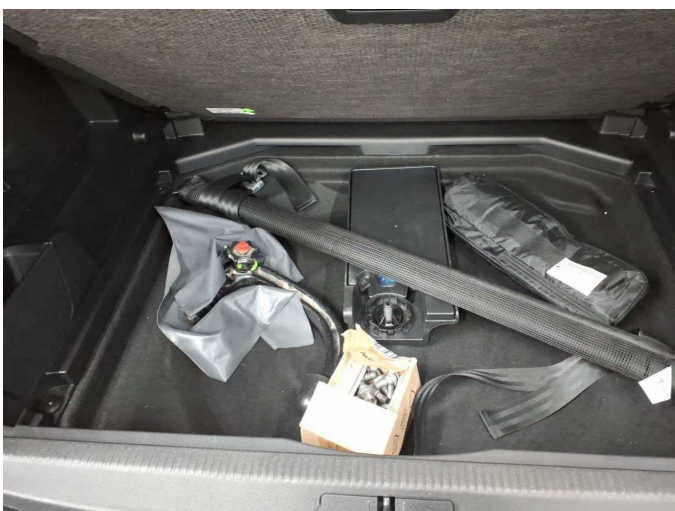


Figure 29: Misc.

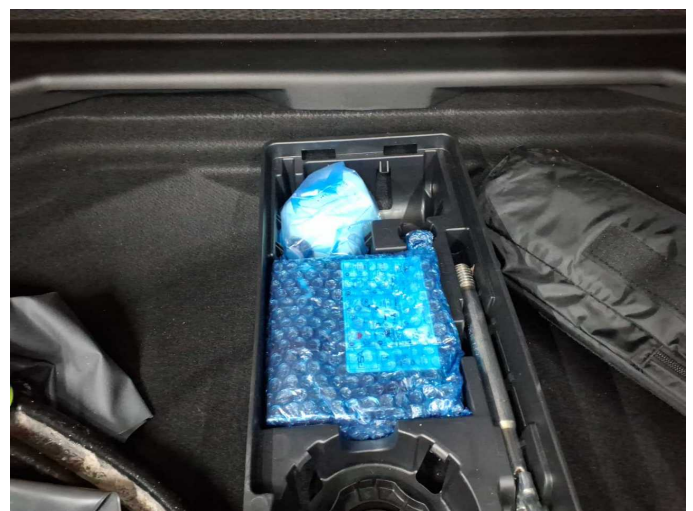


Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.



Damage 2: Equipment: Tirefit filler - Expired - Replace

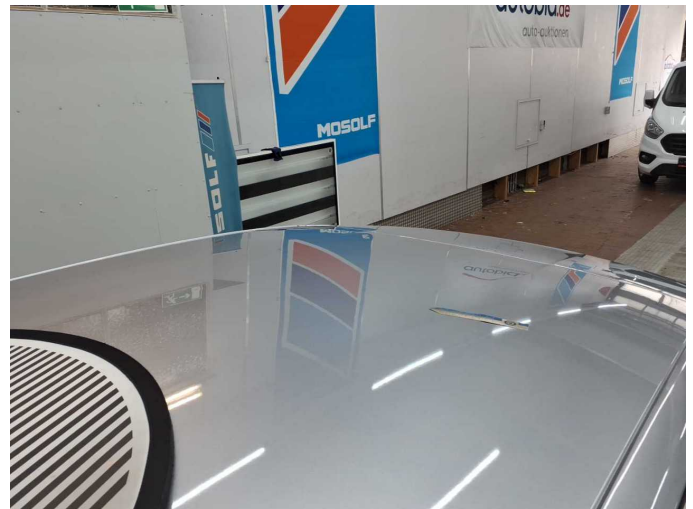


Damage 3: Roof: Roof - dent(s) - Smart repair



Damage 3: Roof: Roof - dent(s) - Smart repair




Damage 4: Instrument panel: Indicator light (Kollisionsgefahrerkennung) - on - Perform diagnosis

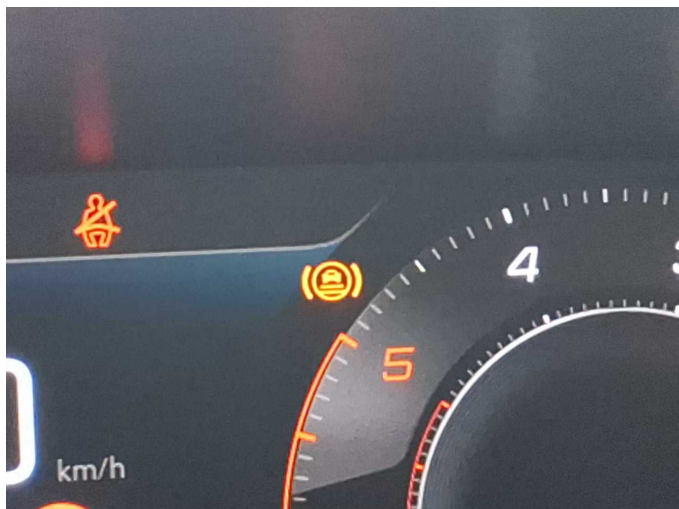

Damage 4: Instrument panel: Indicator light (Kollisionsgefahrerkennung) - on - Perform diagnosis



Wear and tear 3: Door - front left side: Door edge - dent(s) - No deduction

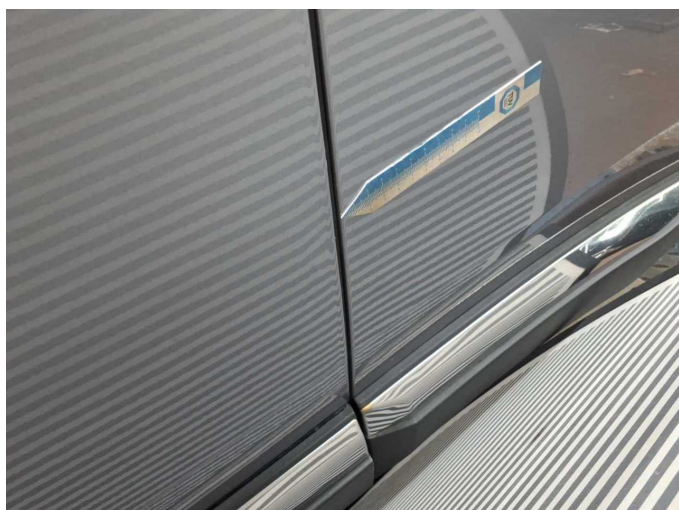

Wear and tear 3: Door - front left side: Door edge - dent(s) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VF3MCYHZMMS254702

Hersteller / Modell: PEUGEOT PEUGEOT 3008 BlueHDi 130 Stop & Start Allure

Datum	KM-Stand	Beschreibung
15.09.2025	90.174	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.07.2025	85.185	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Wartung Sonstiges
04.02.2025	74.260	AU
30.09.2024	69.780	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.12.2023	50.162	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.02.2023	23.820	Motoröl b. Wartung; Regelwartungsdienst