



Seat Ateca (UKL): 2CFX776

Vinnnumber:	VSSZZZ5FZN6534770	Versionname:	Ateca Move! 1.0TSi 110pk/cv 5p
First Registrationdate:	8/07/2022	Fiscalpower:	
Expertise Mileage:	93167	Power Kw:	81
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:	Petrol		
Maintenance	OK		
Maintenance	over 7000 km		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	215/55/17/94 V			
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				215/55 R 17 94 V
Tyre size FR				215/55 R 17 94 V
Tyre size RL				215/55 R 17 94 V
Tyre size RR				215/55 R 17 94 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Repair kit	Yes	Compressor	Yes
Seat cover RR, Dirty, Acceptable			



Engine insulation, Hole, Replace



Windscreen, Stone chip(s), Acceptable



Bonnet, Stone chip(s), Acceptable



Bumper spoiler F, Bad repair, Replace



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Door RL, Dent(s), Acceptable



Wing RL, Scratch(es), Acceptable



Roof pillar L, Dent(s), Acceptable



Alloy rim RL, Scratch(es), Acceptable



Bumper R, Scratch(es), Acceptable



Tailgate / Boot, Dent(s) and scratch(es), Acceptable




Wing trim RR, Scratch(es), Acceptable



Door RR, Dent(s), Acceptable



Alloy rim FR, Scratch(es), Acceptable

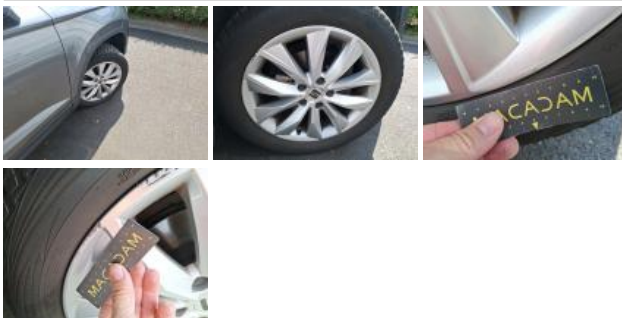

Bodywork, Not original part, Remove lettering



Kenteken	2CFX776
Merk Model	Seat Ateca Move! 1.0TSi 110pk/cv 5p
Brandstofsoort	Benzine
Datum deel1	7/8/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
9/15/25	74,866	klein materiaal	
9/15/25	74,866	remblokken vooraan	Vervangen
9/15/25	74,866	ruitenwisserrubber achter	Vervangen
9/15/25	74,866	ruitenwisserrubber vooraan	Vervangen
9/15/25	74,866	ruitenwisservloeistof	Bijvullen/-laden
9/15/25	74,866	Tussentijdse onderhoudsbeurt (variabel	Uitvoeren
3/18/25	62,345	0139-Aanvulling op onderhoudsbeurt	Uitvoeren
3/18/25	62,345	bougie	Vervangen
3/18/25	62,345	klein materiaal	
3/18/25	62,345	Onderhoudsbeurt (variabel interval)	Uitvoeren
3/18/25	62,345	remvloeistof	Vervangen
3/18/25	62,345	ruitenwisservloeistof	Bijvullen/-laden
10/11/24	50,159	batterij	Vervangen
10/11/24	50,159	klein materiaal	Uitvoeren
10/11/24	50,159	remblokken achter	Vervangen
10/11/24	50,159	ruitenwisserrubber achter	Vervangen
10/11/24	50,159	ruitenwisserrubber vooraan	Vervangen
10/11/24	50,159	ruitenwisservloeistof	Bijvullen/-laden
10/11/24	50,159	Tussentijdse onderhoudsbeurt (variabel	Uitvoeren
2/27/24	32,406	klein materiaal	Uitvoeren
2/27/24	32,406	luchtfiler interieur	Vervangen
2/27/24	32,406	Onderhoudsbeurt (variabel interval)	Uitvoeren
2/27/24	32,406	ruitenwisservloeistof	Bijvullen/-laden
7/24/23	23,192	klein materiaal	Uitvoeren
7/24/23	23,192	ruitenwisserrubber achter	Vervangen
7/24/23	23,192	ruitenwisserrubber vooraan	Vervangen
7/24/23	23,192	ruitenwisservloeistof	Bijvullen/-laden
7/24/23	23,192	Tussentijdse onderhoudsbeurt (variabel	Uitvoeren