



Expertise

Protocol number: 46531153
Order No. / Reference: 26604539
Inspection date: 13 Jul 2026

Manufacturer: Audi	Model: A5 Sportback 40 TFSI S tronic advanced
VIN: WAUZZZF51PA018898	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A5 Sportback 40 TFSI S tronic advanced	
Vehicle Identification number	WAUZZZF51PA018898
Mileage (Read)	27,753 km
First registration	2 Dec 2022
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	150 kw / 1,984 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Gletscherweiss Metallic
Doors / Seats	5 / 4
Upholstery type	Leather
Colour of upholstery	Beige



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,400 km
Last service on / at	05/2026 at 28,580 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP804711
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BUS 00425		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,085 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/40 R18 93H	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	245/40 R18 93H	Summer tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Accent areas matte black
- Drive slip control
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light
- Decorative inlays diamond lacquer silver grey
- Rear parking sensors
- Electromechanical parking brake
- Driver information system
- Electric front windows
- front and rear floor mats
- Cruise control system with adjustable speed limiter
- Interior lighting
- Manual child lock
- Automatic air conditioning
- boot floor mat
- Fuel tank (54 liters)
- LED headlights
- front center armrest
- Otto particulate filter
- Wheel: Alloy wheels "5-V-spoke Y-design"
- Wheel: Tire repair kit
- Radio: MMI Radio Plus
- Radio accessories: Data module Europe
- Electromechanical power steering
- Front seats (standard seats)
- Phone: Bluetooth interface
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service including vehicle control
- Electrically adjustable/heated exterior mirrors
- Outdoor temperature display
- Fabric headliner
- Tachometer
- Door sills with aluminum inlay
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Remote key, without safe lock
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic (7-speed)
- Interior mirror dimming
- ISOFIX and Top Tether child seat anchors for the outer rear seats
- Headrests (4)
- LED taillights
- Mild hybrid
- Non-smoking version
- Package Gloss
- Wheel: Tire pressure monitoring system
- Wheel: Tires optimized for rolling resistance, speed-limited
- Radio accessories: 8 speakers
- Rear seat backrest foldable
- Seat belts: Three-point automatic seat belts for all seats
- Start-stop system
- First aid kit with warning triangle
- Electronic immobilizer
- Green thermal insulation glazing



Extra equipment

- Decorative inlay in grey aluminum ellipse (for dashboard, door panels and center console)
- Deletion of performance/technology lettering
- Paint finish: Metallic
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (height and reach of the leather steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. Includes a leather gearshift/selector lever knob and a leatherette handbrake grip.)
- Interior design selection package (standard front seats including seat covers in leather/artificial leather mono.pur 550 combination with contrast stitching - 3-spoke leather steering wheel with multifunction plus - ambient lighting package plus - aluminum ellipse grey decorative inlays - illuminated front door sill trims with aluminum inlay - interior elements in artificial leather with contrast stitching, color-coordinated with the respective interior color - front floor mats with black piping)
- Parking assistant including parking aid plus (automatic steering during parking. Ultrasonic sensors search for suitable parallel or perpendicular parking spaces. For perpendicular spaces, the entry path is calculated; for parallel spaces, the entry and exit paths are calculated. The driver must accelerate, shift gears, brake, and monitor the parking process. The system handles the steering. Activation is via a button on the center console.)
- Anti-theft alarm system (anti-theft alarm system - switchable ultrasonic interior monitoring - tow-away protection via tilt sensor - battery-powered horn against cable tampering; remote key with Safelock - locks and unlocks doors, luggage compartment and fuel filler flap - including keyless go - including comfort closing/opening of windows)
- Parking Assistance Package (Parking Aid Plus - Parking Assist - Rearview Camera)
- Infotainment package Smartphone in conjunction with navigation package (Audi phone box light - Audi smartphone interface - USB charging interface for rear passengers (additional 2 USB-A charging interfaces for rear passengers in the rear center console))
- Navigation package (Driver information system with color display: high-resolution 7-inch color display, time, mileage, outside temperature - MMI Navigation plus with MMI touch: navigation system on the high-resolution 10.1-inch color display, map updates, 3D city display, MMI search, MMI touch, online traffic information plus - Audi connect Navigation & Infotainment: hazard information, weather information, online voice input, Wi-Fi hotspot, Amazon Alexa integration, online radio)
- Upholstery: Leather/synthetic leather combination (interior design selection) (in conjunction with interior design selection and sports seat (with and without ventilation) with piping woven in silver and with contrast stitching)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Angabe Digitaler Nachweis unplausibel) - No evidence - No deduction
2	Documents	Service book (Letzter Eintrag Unplausibel) - No deduction
3	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Soiled - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book (Digitaler Ausdruck)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- letzter Serviceeintrag im digitalen Servicenachweis unplausibel. Serviceeintrag bei 28580km, KM Stand abgelesen am Tag der Besichtigung: 27753, KM Stand bei HU am 20.05.2026 27626 lt HU Bericht.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

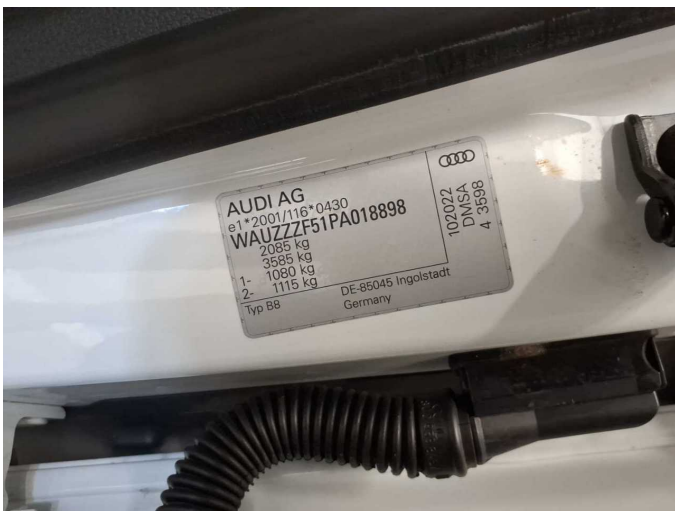


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

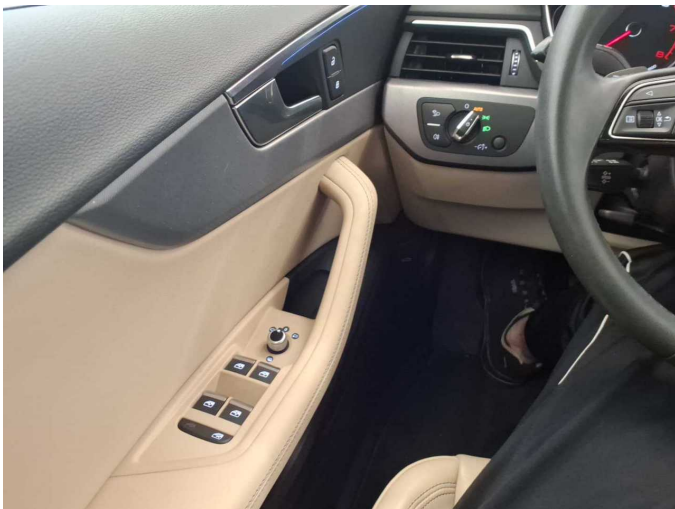


Figure 21: Misc.

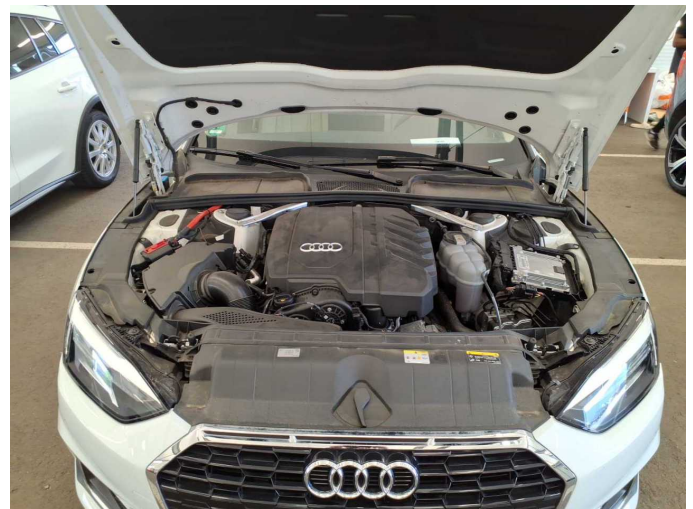


Figure 22: Misc.



Figure 23: Misc.

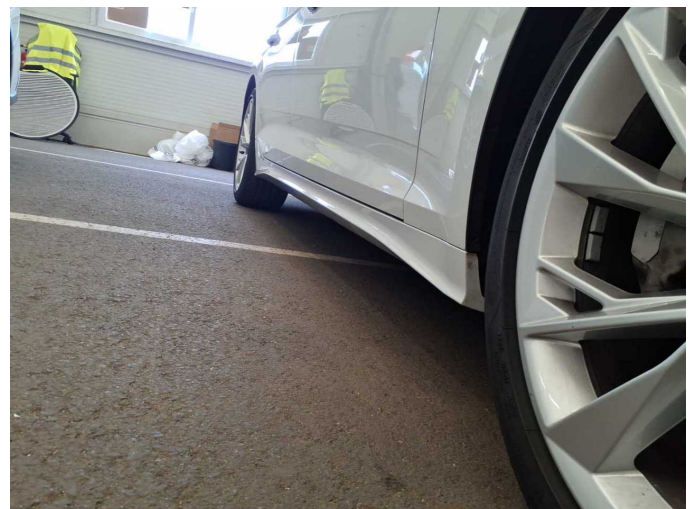


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF51PA018898

Hersteller / Modell: AUDI AUDI A5 Sportback 40 TFSI S tronic advanced

Datum	KM-Stand	Beschreibung
21.05.2026	28.580	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; HU + AU; Regelwartungsdienst
10.09.2025	22.028	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
09.04.2025	17.912	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
16.08.2024	12.949	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges