



Expertise

Protocol number: 46609631
Order No. / Reference: 26276543
Inspection date: 20 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 Performance Upgrade Pro

VIN: WVGZZZE2ZPE023036



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.4 Performance Upgrade Pro	
Vehicle Identification number	WVGZZZE2ZPE023036
Mileage (Read)	90,825 km
First registration	10 Feb 2023
Number of holders	1
Next periodical technical inspection	02/2028
(Report on hand)	
Fuel type	Electric
Power	70 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Mythossschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	192 Tag(e)
Last service on / at	01/2025 at 54,339 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS379011
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLQ 00111		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,540 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	255/50 R19 103T	Summer tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	255/50 R19 103T	Winter tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting, 10 colors
- Electrically adjustable, folding and heated exterior mirrors
- Car2X
- e-Sound
- ESP Electronic Stability Program
- Speed limiter
- Back window, heater
- Interior mirror automatically dimming
- "Climatronic" air conditioning system
- Paint finish: Solid
- Charging: 11 kW AC charging power (alternating current)
- LED headlights with automatic headlight control
- Makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Upholstery: Seat center panels of the front seats and the outer rear seats in "Matrix" fabric
- Tire pressure monitoring system
- LED taillights
- electromechanical power steering
- Seats: Armrest for front seats
- Seats: Driver's seat height adjustable
- Voice control
- Lane keeping assistant "Lane Assist"
- Ambient lighting with logo projection
- Traffic sign recognition
- Green thermal insulation glazing, sides and rear
- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- black roof rails
- Parking assistance
- Driving profile selection
- Transmission: 1-speed automatic
- rear window wiper
- ISOFIX mounting points for child car seats
- Front and rear headrests (5)
- Mode 3 Type 2 charging cable, 16 A
- Charging: 125 kW DC charging power (direct current)
- Steering wheel: Multifunction steering wheel with touch controls
- Navigation system "Discover Pro"
- Emergency call service
- Package: Infotainment Package
- Radio "Ready 2 Discover"
- Radio accessories: 6 + 1 speakers
- Wheels: Steel wheels (4) 8 J x 19
- Keyless Start system
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Rear bench seat undivided, backrest asymmetrically split and foldable
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking including remote control



Extra equipment

- Charging cable: Mains charging cable for household socket
- Package: Comfort Package "Plus" (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-reducing - Luggage net - Luggage compartment floor - "Air Care Climatronic" air conditioning with active combination filter, stationary climate control and 3-zone temperature control - Variable center console with interchangeable inserts for cup holders and storage compartments - Cargo net partition - Rain sensor - Automatically heated front windscreen washers - Heated front seats)
- Package: Infotainment Package "Plus" (Head-up display - Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign recognition, points of interest, App-Connect Wireless, voice control - Radio "Ready 2 Discover Max": DAB+ digital radio reception, diversity antenna for FM reception - Telephone interface "Comfort" with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support - Sound system, 6 loudspeakers, digital channel amplifier, subwoofer, 450 W)
- Foldable towbar (electric release)
- Heat pump for range optimization
- Package: Assistance Package "Plus" including "IQ.DRIVE" in conjunction with Interior Top Sport "Plus" and Style ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote release; Adaptive Cruise Control "Stop & Go", with speed limiter; Anti-theft alarm with interior, backup horn and tow-away function; Driving Assistance "Travel Assist", Lane Keeping Assist "Lane Assist" and "Emergency Assist"; Multifunction leather steering wheel; Parking Assist "Park Assist Plus"; Precise occupant protection; Keyless locking and start system "Keyless Access", with Safe Security; Lane Change Assist "Side Assist"; Surround view "Area View" including reversing camera.)
- Paint finish: Metallic
- Wheels: Alloy wheels (4) "Hamar" 8 J x 19 in black, gloss-turned finish (4 alloy wheels "Hamar" 8 J x 19 in black, gloss-turned surface - tires 235/55 R 19 front and 255/50 R 19 rear - wheel locks with enhanced theft protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
2	Sill - left side	Sill - dent(s) - Smooth repair work
3	Engine	Engine cover - Damage caused by marten / rodent - Replace
4	Trim / covers	Door trim - rear left side - Burn hole (cigarettes) - Smart repair
5	Door - front left side	Door edge - Scratch(es) - Smart repair
6	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
7	Front bumper	Spoiler - Scratched - Replace
8	Rear bumper	Rear bumper (Hinten Rechts) - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Body	Body - Scratch(es) - No deduction
4	2nd wheel set	1 tyre (Fremdkörper) - Broken / torn - No deduction
5	Roof	Roof - dent(s) - No deduction
6	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

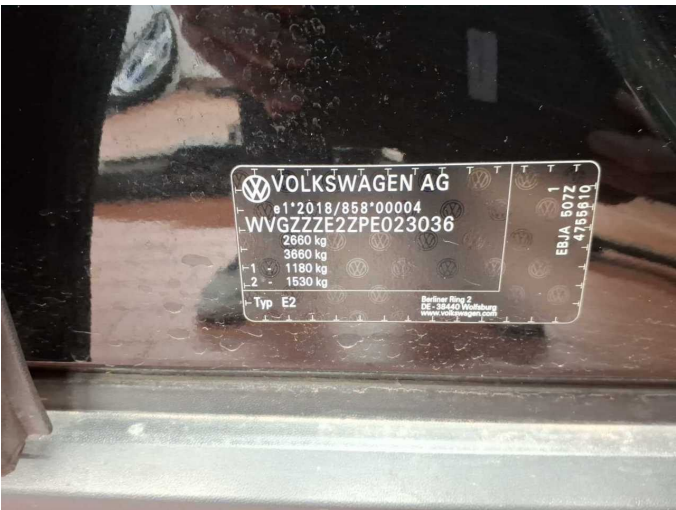


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

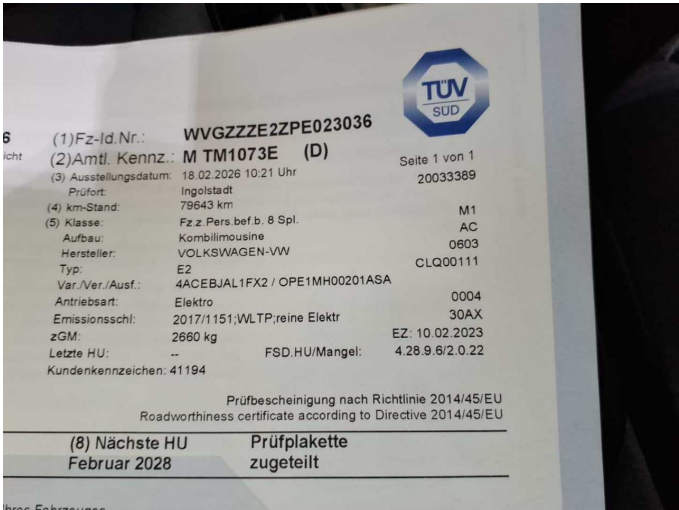


Figure 16: Documents



Figure 17: Additional tyres

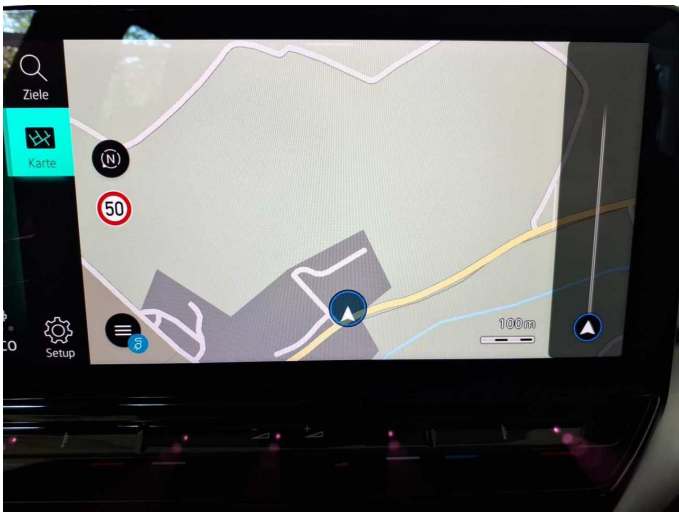


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

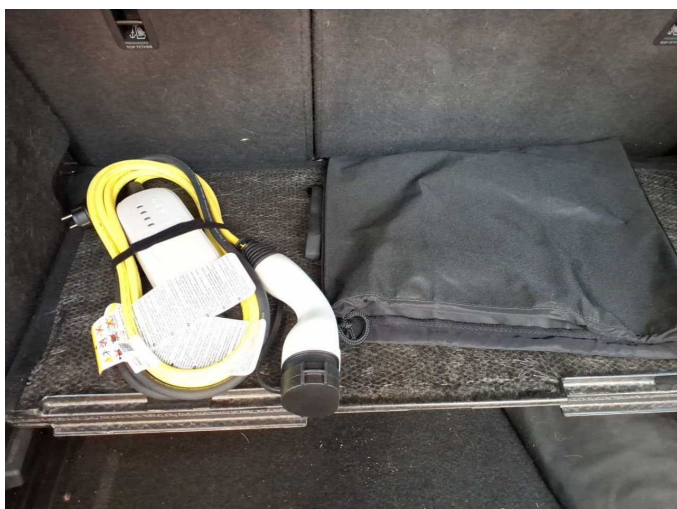


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

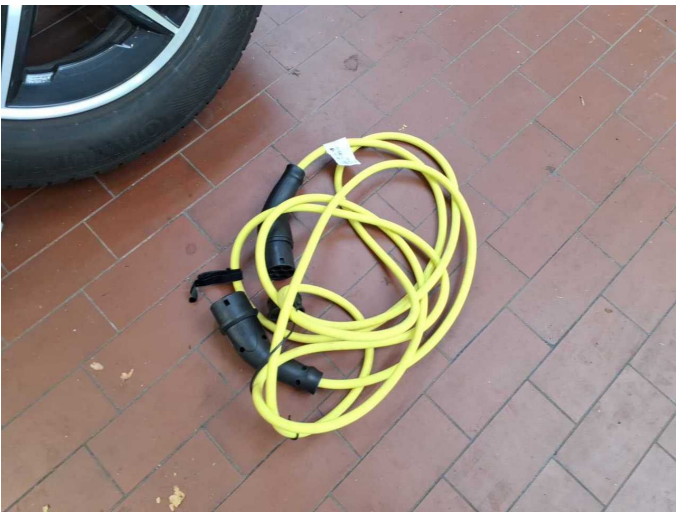


Figure 35: Misc.




Figure 36: Misc.




Figure 37: Misc.



Figure 38: Misc.

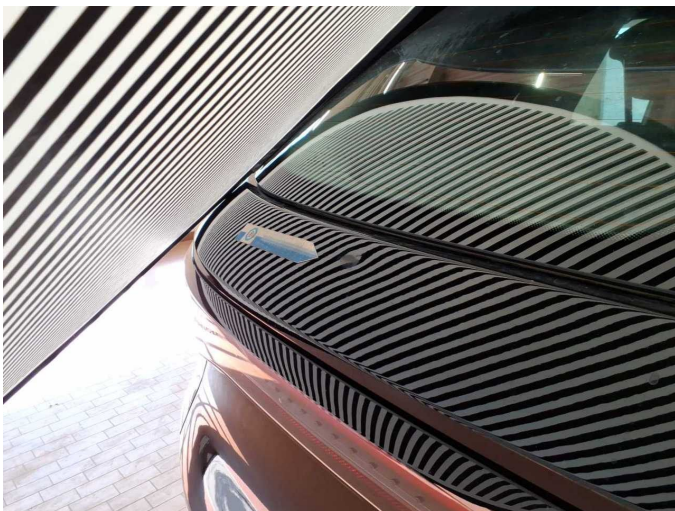

Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

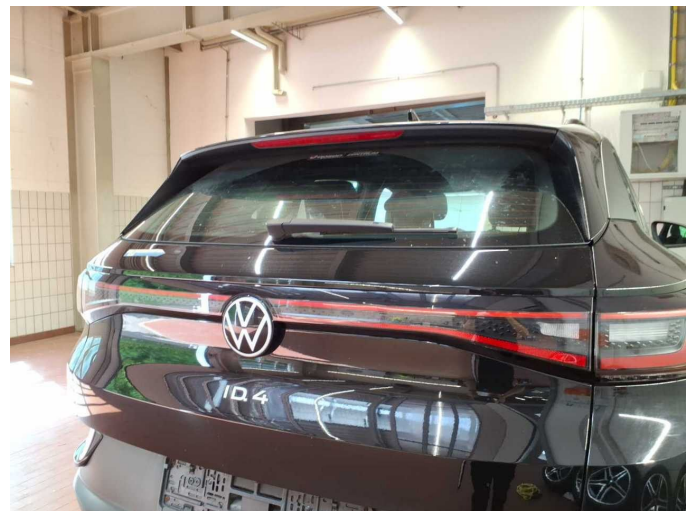

Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 2: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 2: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 3: Engine: Engine cover - Damage caused by marten / rodent - Replace

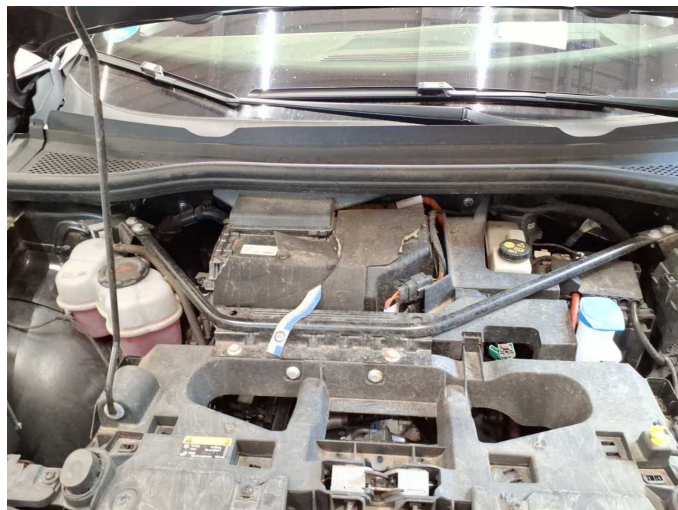

Damage 3: Engine: Engine cover - Damage caused by marten / rodent - Replace



Damage 4: Trim / covers: Door trim - rear left side - Burn hole (cigarettes) - Smart repair




Damage 4: Trim / covers: Door trim - rear left side - Burn hole (cigarettes) - Smart repair



Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair

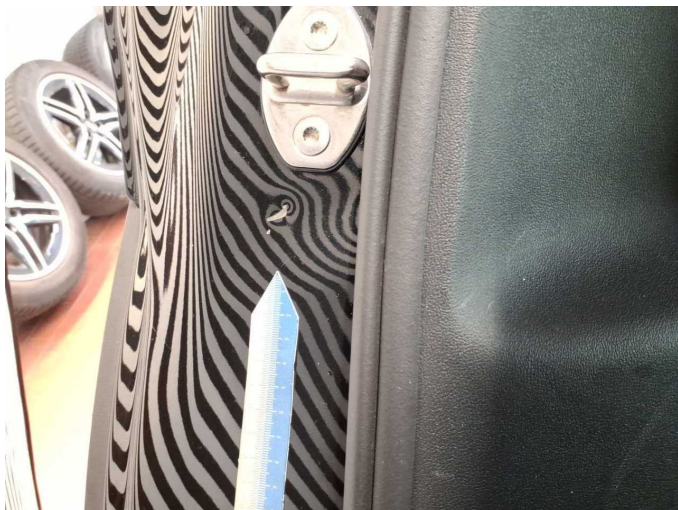


Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

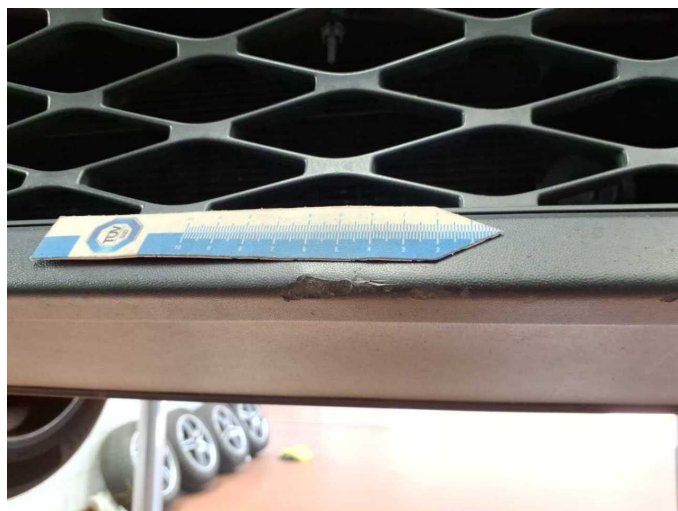

Damage 7: Front bumper: Spoiler - Scratched - Replace




Damage 7: Front bumper: Spoiler - Scratched - Replace



Damage 8: Rear bumper: Rear bumper (Hinten Rechts) - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper (Hinten Rechts) - Scratch(es) - Paint

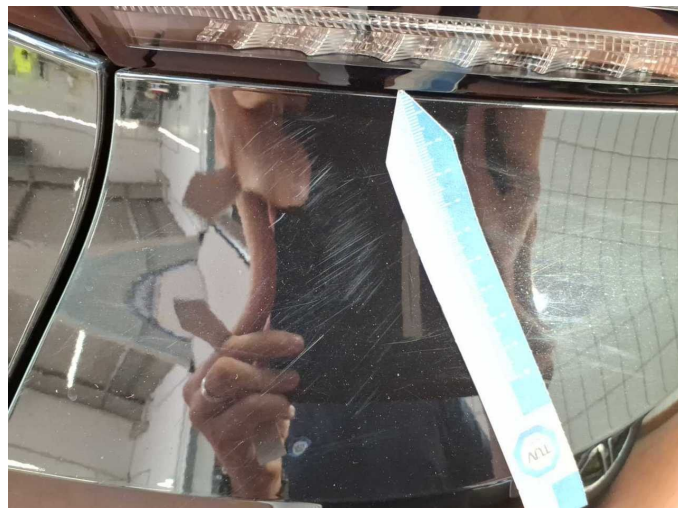

Damage 8: Rear bumper: Rear bumper (Hinten Rechts) - Scratch(es) - Paint



Wear and tear 3: Body: Body - Scratch(es) - No deduction



Wear and tear 3: Body: Body - Scratch(es) - No deduction




Wear and tear 3: Body: Body - Scratch(es) - No deduction



Wear and tear 3: Body: Body - Scratch(es) - No deduction




Wear and tear 3: Body: Body - Scratch(es) - No deduction

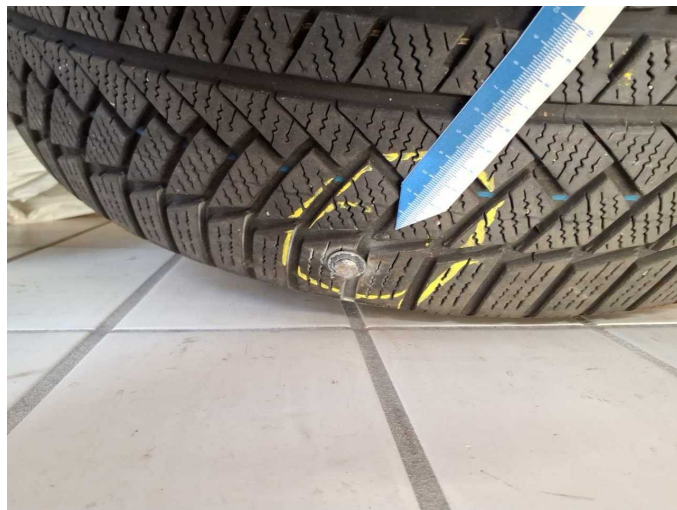


Wear and tear 4: 2nd wheel set: 1 tyre (Fremdkörper) - Broken / torn - No deduction



Wear and tear 4: 2nd wheel set: 1 tyre (Fremdkörper) - Broken / torn - No deduction

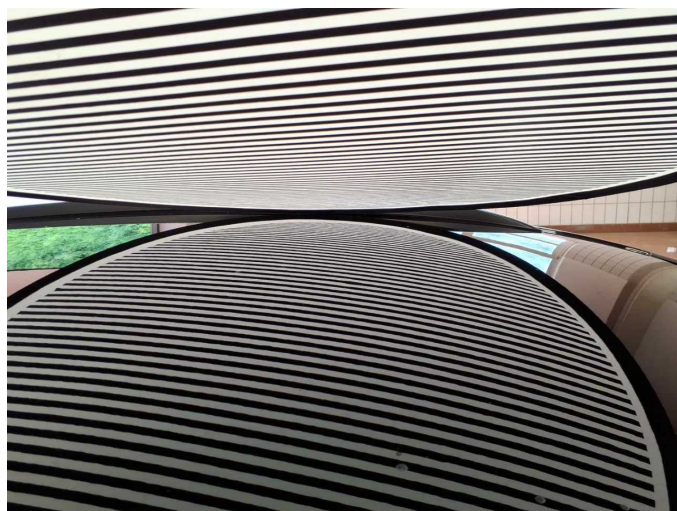

Wear and tear 5: Roof: Roof - dent(s) - No deduction

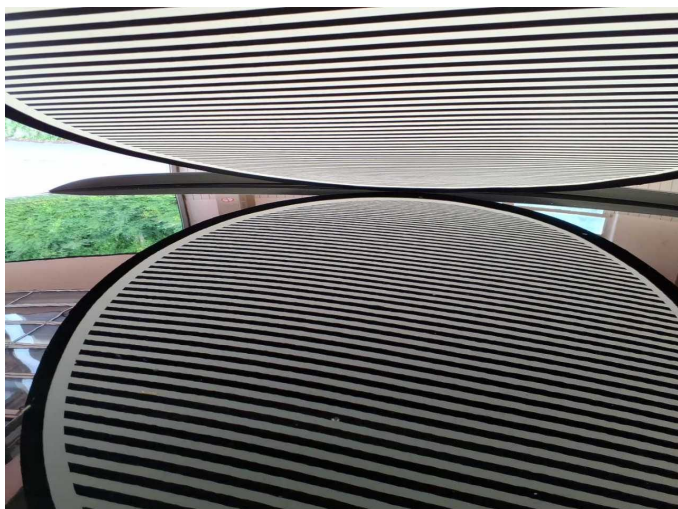

Wear and tear 5: Roof: Roof - dent(s) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZE2ZPE023036

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.4 Performance Upgrade Pro

Datum	KM-Stand	Beschreibung
24.09.2025	71.799	Bremse Sonstiges; Getriebeöl ern/prüfen; Reparatur Sonstiges; Systemtest/ Eigendiagnose
10.07.2025	65.907	Bremse Sonstiges; Bremse Sonstiges; Bremse Sonstiges; Bremsscheiben vorne; Bremsscheiben vorne; Bremsscheiben vorne; Systemtest/ Eigendiagnose; Systemtest/Eigendiagnose
02.05.2025	60.917	Bremse Sonstiges
28.01.2025	54.339	Bremsbelagfühler ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Regelwartungsdienst