



Expertise

Protocol number: 47136362
Order No. / Reference: 26845560
Inspection date: 19 Aug 2026

Manufacturer: Peugeot

Model: 208 GT Elektromotor 136

VIN: VR3UHZKXZPT559224



Vehicle details

Manufacturer / Type / Model / Equipment

Peugeot 208 GT Elektromotor 136

Vehicle Identification number VR3UHZKXZPT559224

Mileage (Read) 39,969 km

First registration 14 Aug 2023

Number of holders 1

Next periodical technical inspection 08/2026
(Report not on hand)

Fuel type Electric

Power 57 kW

Gearbox / Number of gears Direct drive / 1

Type of drive Front drive

Type of vehicle Car hatchback

Colour / colour code Artense Silber Metallic

Doors / Seats 5 / 5

Upholstery type Cloth / leather
combination

Colour of upholstery Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	800 km
Last service on / at	02/2025 at 20,776 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG063955
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / ACH 00039		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	1,910 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/45 R17 88H	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	205/45 R17 88H	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	195/55 R16 91H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- "e" logo on the C-pillar and e208 logo on the tailgate
- ABS (Anti-lock Braking System)
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Acoustic pedestrian warning system (AVAS)
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Hill start assist
- Turn signals with lane change indicator function
- third brake light
- Digital 3D instrument cluster with high-resolution 10" screen, adjustable and customizable
- EBV (Electronic Brakeforce Distribution)
- Rear parking aid, acoustic and visual
- Front parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- Driving mode selector (Sport - Normal - Eco)
- Electric front windows (with comfort operation and anti-pinch protection)
- electric parking brake
- Front collision warning
- Full LED headlights (automatic headlight range control - LED turn signals at the front)
- Transmission: Direct drive
- Green decorative stitching on the dashboard, steering wheel and the armrests of the front and rear doors
- rear window wiper
- Rear spoiler, glossy black
- Frameless interior mirror
- Map pockets on the front seatbacks
- Automatic climate control with activated carbon filter
- Radiator grille with applications in body color
- LED ambient lighting on the dashboard and door panels (adjustable in 8 colors)
- LED ceiling lighting at the front (2 reading lights at the front and rear)
- Steering wheel adjustable for height and reach
- light sensor
- Illuminated makeup mirrors for driver and front passenger
- Fatigue warning
- Emergency brake assist (with automatic activation of the hazard warning lights)
- On-board charger 7.4 kW, 1-phase
- Aluminum pedals and stainless steel door sills (with PEUGEOT lettering)
- Peugeot Connect Box (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Pollen filter
- Storage compartment with smartphone holder
- Active Safety Brake
- Airbag: Front side airbag
- Airbag: Curtain airbags front and rear
- Electrically folding exterior mirrors with LED approach lighting
- Exterior mirror caps Perla Nera Black
- Trim panel between the taillights in glossy black
- On-board computer
- Black headliner
- Three-point seat belts at all seating positions (three-point seat belts with belt locks, pyrotechnic belt tensioners, warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger, three-point seat belts, belt force limiters on the side seats, Isofix child seat anchors on the outer seats, warning light and warning signal when the seat belt is released)
- Electric rear windows (with comfort operation and anti-pinch protection)
- High beam assist
- Follow-me-home function (automatic)
- noise-reducing windshield
- Front and rear floor mats with decorative stitching in green
- Cruise control system with speed limiter
- Cup holder in the center console
- GT logo on the trunk lid
- Heated rear window
- Rear apron in black
- Interior mirror automatically dimming
- ISOFIX child seat anchors (on the front passenger seat)
- Manual child lock
- Headrests (5)
- Charging cable: Mode 3 charging cable (Type 2, up to 7.4 kW), 6 meters long
- White LED lighting on the center console and in the front footwell
- LED taillights
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- Front center armrests (with storage compartment)
- Navigation system: 3D navigation system NAC incl. 3D instrument cluster (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone & media - touchscreen operation - map transfer to the digital 3D instrument cluster - real-time navigation. TomTom service - multifunctional touchscreen. 10" HD color screen - incl. PEUGEOT Connect Box with the free telematics services PGT Connect SOS & PGT Connect Assistance - GPS module - integrated European SIM card - speaker and microphone - emergency battery)
- Upholstery: Fabric/faux leather (Capy)
- Radio accessories: Digital radio reception DAB+



- Radio: RCC audio system (mono tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Wheel arches in glossy black
- Rain sensor
- Tire pressure monitoring system
- Wheels: 17" "Bronx" alloy wheels, two-tone (tires 205/45 R17 81H)
- Rear seat backrest 40/60 split folding
- Side and rear windows are more heavily tinted.
- Seats: Passenger seat height adjustable
- Seats: Heated front seats, adjustable in three stages
- 12-volt socket in the trunk
- Electric version technology (Combo connector (Combined Charging System CCS) on the vehicle - heat pump to reduce energy consumption and increase range in real everyday use)
- Immobiliser
- Decorative strip below the side windows in glossy black

- Radio accessories: Mirror Screen (transmission of multimedia content and apps from a compatible smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps - Android Auto and Mirror Link (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple))
- Reversing camera with 180° surround view
- Keyless start system
- Electric power steering
- Seats: Driver's seat height adjustable
- Lane keeping assist with steering intervention
- Daytime running lights: LED daytime running lights
- Door handles painted in car color
- Doors lock automatically when driving off
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster)
- Central locking system, activatable from inside via remote control (doors lock automatically when driving off)

Extra equipment

- Adaptive Cruise Control (ACC) with Stop & Go function (including Lane Positioning Assistant and Active Safety Brake Plus)
- Blind spot assist

- Paint finish: Special metallic paint
- On-board charger 11 kW, 3-phase
- Radio accessories: Multifunctional touchscreen with 10" HD color screen (capacitive screen - 7 piano key "toggle switches")

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - Scratched - Smart repair
2	Door - front left side	Door edge - Scratched - Smart repair
3	Door - rear right side	Door (Einschlüsse) - Paint defect - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

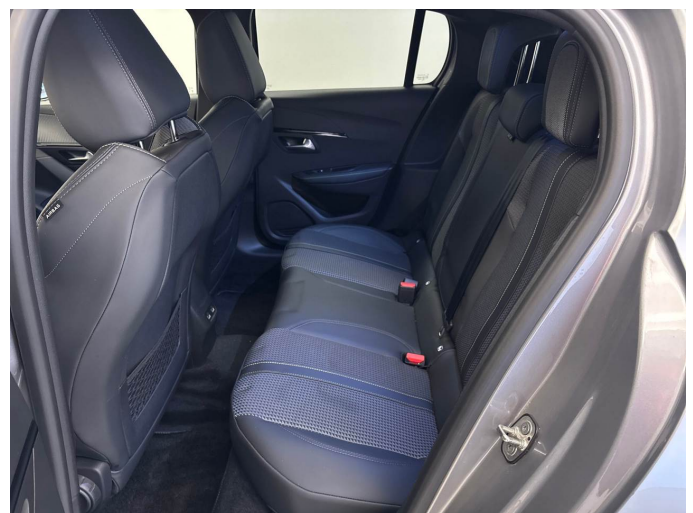


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

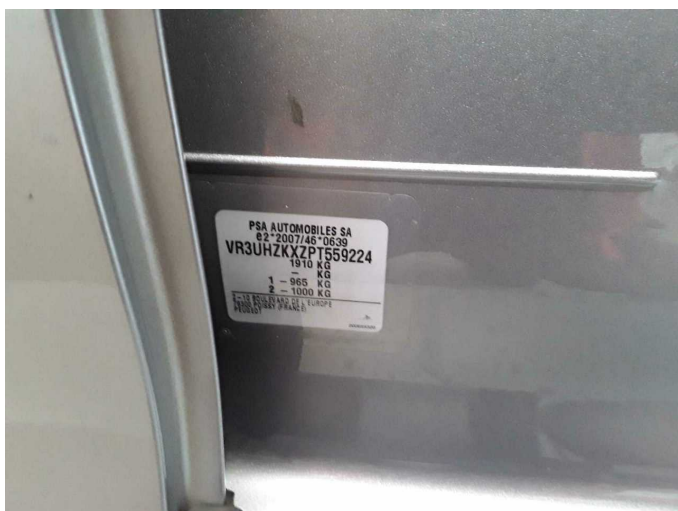


Figure 11: VIN



Figure 12: Mounted tyres

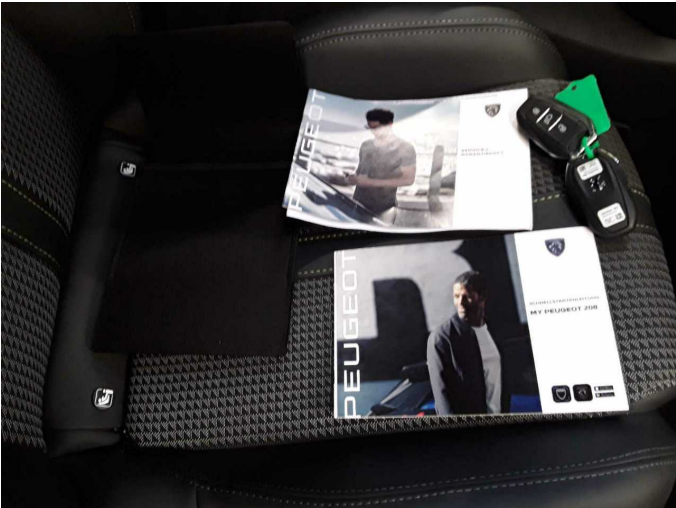


Figure 13: Documents

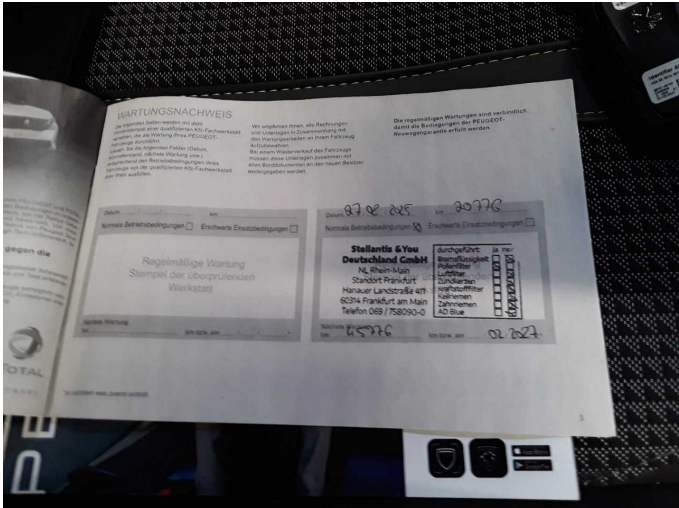


Figure 14: Documents

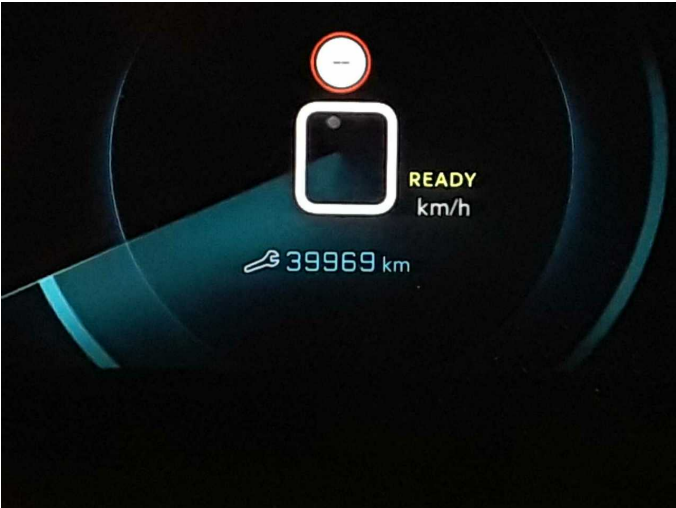


Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres

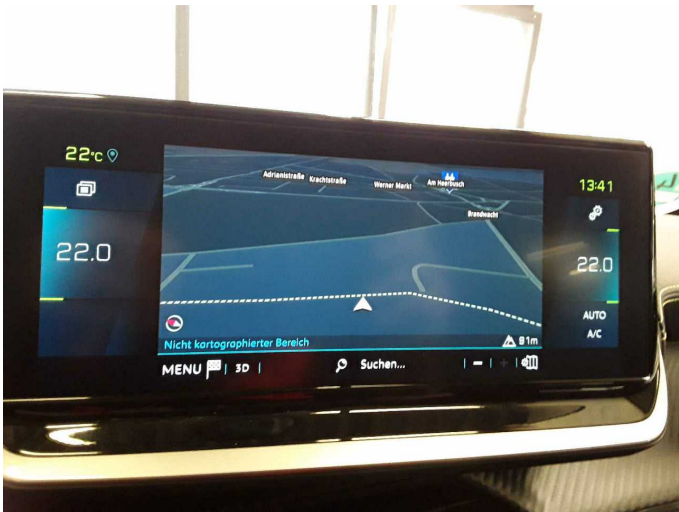


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

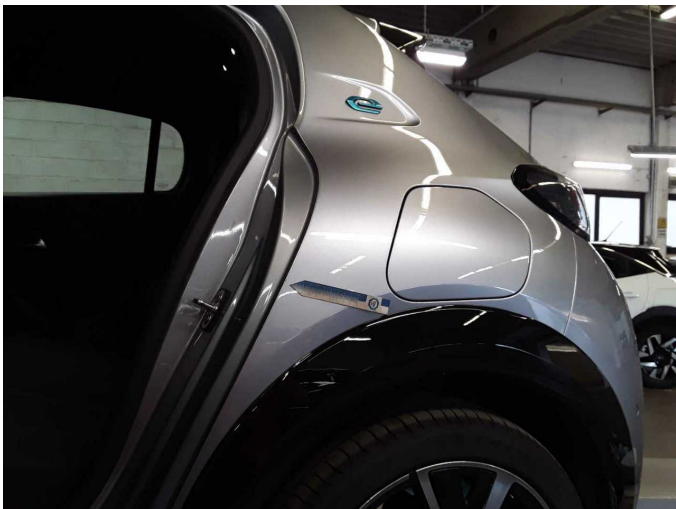

Damage 1: Side panel - rear left side: Side panel - Scratched - Smart repair



Damage 1: Side panel - rear left side: Side panel - Scratched - Smart repair



Damage 2: Door - front left side: Door edge - Scratched - Smart repair



Damage 2: Door - front left side: Door edge - Scratched - Smart repair




Damage 2: Door - front left side: Door edge - Scratched - Smart repair




Damage 3: Door - rear right side: Door (Einschlüsse) - Paint defect - Paint



Damage 3: Door - rear right side: Door (Einschlüsse) - Paint defect - Paint

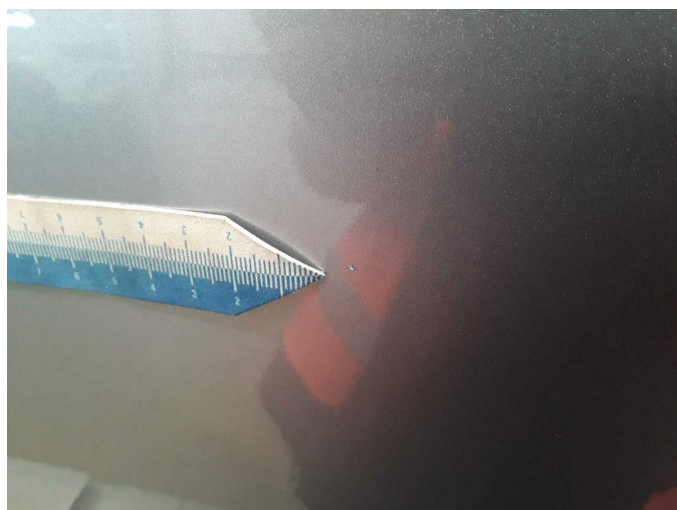

Damage 3: Door - rear right side: Door (Einschlüsse) - Paint defect - Paint

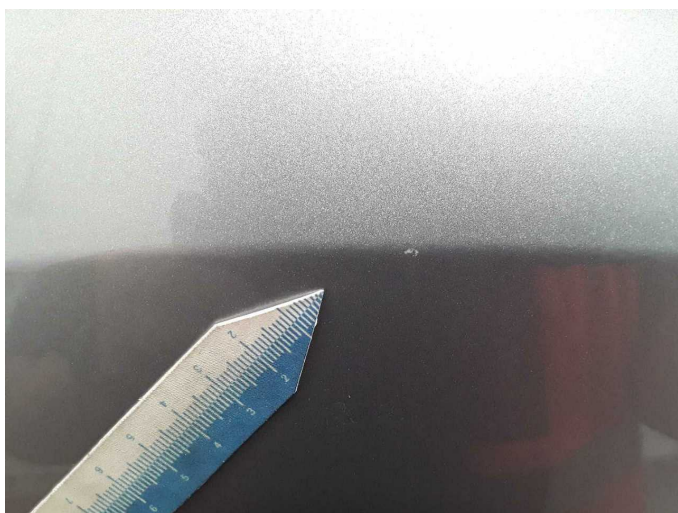

Damage 3: Door - rear right side: Door (Einschlüsse) - Paint defect - Paint



Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction