



Expertise

Protocol number: 46826944
Order No. / Reference: 26703274
Inspection date: 29 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC 300 de 4Matic 9G-TRONIC AMG Line

VIN: W1N2539111F981700



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 300 de 4Matic 9G-TRONIC AMG Line	
Vehicle Identification number	W1N2539111F981700
Mileage (Read)	181,668 km
First registration	5 Aug 2021
Number of holders	1
Next periodical technical inspection	09/2026
(Report on hand)	
Fuel type	Hybr.D/E ext.aufl
Engine displacement / Cylinder	1,950 ccm / 4
Power	143 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	OBSIDIANSCHWARZ - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	197 Tag(e)
Last service on / at	02/2026 at 165,784 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC620533
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASV 00037		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,650 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101V	Summer tyres on Light alloy	Bridgestone	0mm / 0mm
2)	235/55 R19 101V	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Continental	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Chassis with higher ground clearance (In this chassis variant, the body is raised by 20 mm)
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Communication module (LTE) for using Mercedes me connect services (The communication module (LTE) offers you a clear increase in comfort and safety. It constantly connects the vehicle to the internet – so that you can use helpful services such as the Live Traffic Information from Mercedes me connect. Two mobile antennas and an LTE-enabled SIM card ensure a fast connection.)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather (with black decorative stitching, flattened at the bottom, deeply embossed in the grip area, touch control buttons and steering wheel trim in silver chrome galvanized)
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Package: OFF-ROAD Exterior (lower part of the front bumper silver-chromed, radiator grille with chrome trim strips, 45.7 cm (18") 5-spoke alloy wheels painted tremolite grey and polished with 235/60 R 18 tires on 8 J x 18 ET 38 rims, suspension with increased ground clearance, front bumper with increased approach angle)
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
- Seats: Folding rear seat backrests (40/20/40 split including Easy Pack Quickfold and center armrest with double cupholder and storage compartment)
- Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)
- Decorative elements: black piano lacquer finish/light longitudinally brushed aluminum
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Electric window regulator, 4-way (with comfort operation and anti-pinch protection)
- Black floor mats with AMG lettering
- Heated rear window (with timer)
- Black fabric headliner
- Climate: THERMATIC automatic climate control with 2 climate zones (The THERMATIC automatic climate control with 2 climate zones offers individual climate comfort in the front seats: driver and front passenger can set the temperature separately for their side. Thanks to the automatic climate control and the sensitive sensor system, this is kept constant without any manual adjustments.)
- Headrests adjustable in 5 ways (4-way for driver and front passenger, and 2-way in the rear)
- Charging system: AC on-board charger (AC charging)
- LED High Performance headlights (with integrated daytime running lights, LED taillights)
- Steering column mechanically adjustable in height and length
- Steering: Sport direct steering
- Mercedes-Benz emergency call system
- Package: Storage (map pockets on the back of the front seats - net on the load floor - folding box under the load floor - 12V socket in the load compartment on the left - cargo bars - two USB-C ports in the rear)
- Package: Interior lighting (More light, more atmosphere, better orientation: The interior lighting package provides more comprehensive direct and indirect lighting. The additional light elements create a pleasant atmosphere and make operation easier.)
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio: MBUX multimedia system
- Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
- Windscreen wipers with rain sensor
- Power steering
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Seats: Front seats electrically adjustable (with electric adjustment for seat height and backrest angle, as well as mechanical adjustment for longitudinal adjustment and headrests)
- High-visibility vest for drivers
- Immobiliser
- Central locking (with interior switch, automatic locking (can be deactivated) and crash sensor with emergency opening)
- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)



- Active Brake Assist (can help avoid rear-end collisions with vehicles ahead, whether moving or stationary, as well as collisions with moving pedestrians and cyclists. In addition to distance and collision warnings, it primarily offers brake boosting – up to and including autonomous emergency braking.)
- 4MATIC all-wheel drive
- ATTENTION ASSIST (can detect typical signs of fatigue through driver behavior and warn the driver of increasing fatigue or inattentiveness)
- On-board computer
- Brake system with larger brake discs on the front axle (drilled front brake discs and front brake calipers with Mercedes-Benz lettering).
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant

Extra equipment

- Head-up display
- Charging cable for wallboxes and public charging stations, 8m, smooth, Type 2, Mode 3, 3-phase
- Package: Advanced Infotainment (Media display with touch operation, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can not only recognize speed limits, no-overtaking zones and their cancellation, but also displays no-entry signs and warns you of wrong-way driving.)
- Package: Advanced Park (Parking package with reversing camera, active parking assistant with PARKTRONIC)
- Package: Business (for plug-in hybrid vehicles) (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats)
- Package: Public Charging (includes the Mercedes me Charge service and the Mode 3 charging cable)
- Package: Mirrors (Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function)
- Remote and Charging Services Plus (The Remote and Charging Services Plus package connects you to the vehicle. You can locate it if desired and remotely control selected functions. With Mercedes me Charge, you can charge your vehicle at many public charging stations with maximum cost transparency. You only need to register once and receive a single, centralized bill.)
- Wheels: Complete summer wheel sets fitted at the factory
- TIREFIT with tire inflation compressor
- Partition net for luggage compartment separation (and occupant protection)
- Decorative elements: open-pore black ash wood / light longitudinally brushed aluminum

- Acoustic environmental protection (To ensure that your vehicle does not become a danger to pedestrians and cyclists even when driving purely electrically and almost silently, the acoustic environmental protection generates a Mercedes-Benz specific sound outside the vehicle up to a speed of 30 km/h.)
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Roof rails in polished aluminum
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Paint finish: Metallic
- Navigation accessories: Pre-installation for Live Traffic Information (With Live Traffic Information, your navigation system receives real-time traffic data and optimizes dynamic route guidance. Thanks to precise and up-to-date information on traffic jams, stop-and-go traffic, and more, you are supported in reducing travel times.)
- Package: Advanced Light (LED High Performance headlights and adaptive LED taillights, Adaptive Highbeam Assist)
- Package: AMG Line Exterior (Plug-in Hybrid) (AMG Styling, consisting of AMG front apron with sporty air intakes and chrome trim element, AMG rear apron in diffuser look with black insert, diamond grille with chrome pins, integrated Mercedes star and matte iridium silver louvre with chrome inlay, 19-inch (48.3 cm) AMG light-alloy wheels in 5-twin-spoke design, painted tremolite grey and high-sheen finish with 235/55 R19 tires on 8 J x 19 ET 38 rims, 2 visible tailpipe trims permanently integrated into the bumper)
- Package: Comfort (Seat heating for driver and front passenger, electric and manual adjustment options for driver and front passenger seats, electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat, electric seat cushion tilt adjustment, electric height adjustment, electric backrest adjustment, mechanical seat cushion depth adjustment by 6 cm with leg rest pad, mechanical longitudinal adjustment, mechanical headrest adjustment)
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4-piece set in 5-twin-spoke design (high-gloss black painted and polished with 235/55 R19 tires on 8 J x 19 ET 38 rims)
- Wheels: Winter complete wheels M+S 4x 45.7 cm (18") light alloy wheels in 5-spoke design (additionally vanadium silver painted (82R) with 235/60 R 18 on 8 J x 18 ET 38)
- Heat-insulating dark tinted glass all around from the B-pillar back
- AMG Line interior



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	Underbody (Verölt) - Leaking - Perform diagnosis
2	Sill - right side	Sill - Scratched - Smart repair
3	Front axle	Axles / undercarriage (wegen der einseitig abgefahrenen Reifen) - Specify findings - Measure
4	Wheel / tyres	Tyre - front (einseitig abgefahren) - Worn - Replace
5	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
6	Wheel / tyres	Alloy rim - front left side - Damaged - Loss in value
7	Wheel / tyres	Alloy rim - front right side - Damaged - Loss in value
8	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
9	Boot lid / rear door	Boot lid - Scratch(es) - Paint
10	Rear bumper	Rear bumper - Scratched - Paint
11	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Indicator - front	Mirror - right side - Scratched - No deduction
2	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
3	Side panel - rear left side	Sill - Scratched - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Mudguard - right side, Bonnet

Paint coat thickness measurement

Mudguard - left side	167 µm	Mudguard - right side	175 µm
Bonnet	163 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

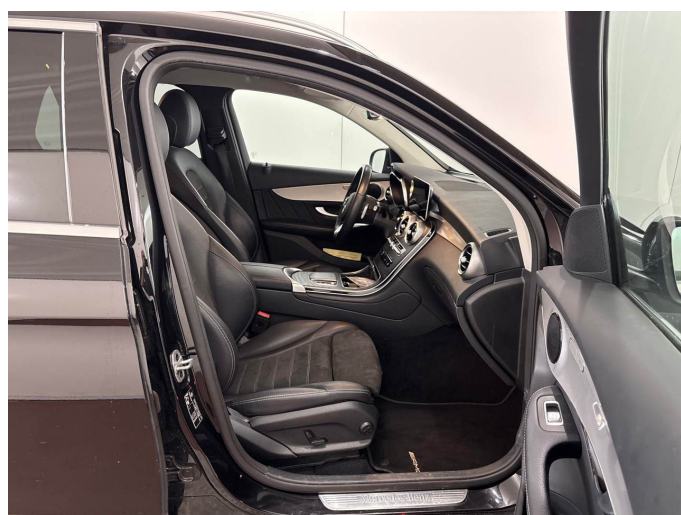


Figure 5: Interior - front

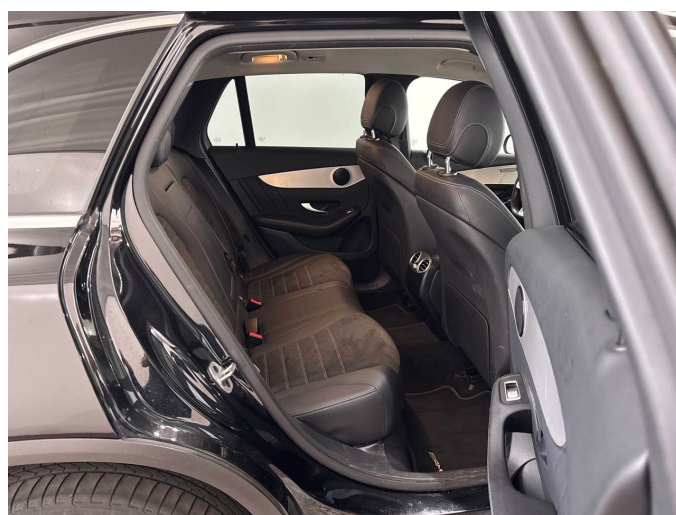


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

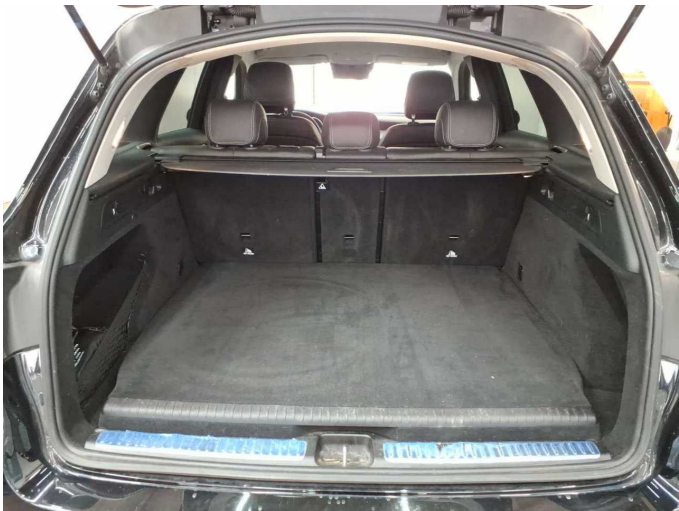


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

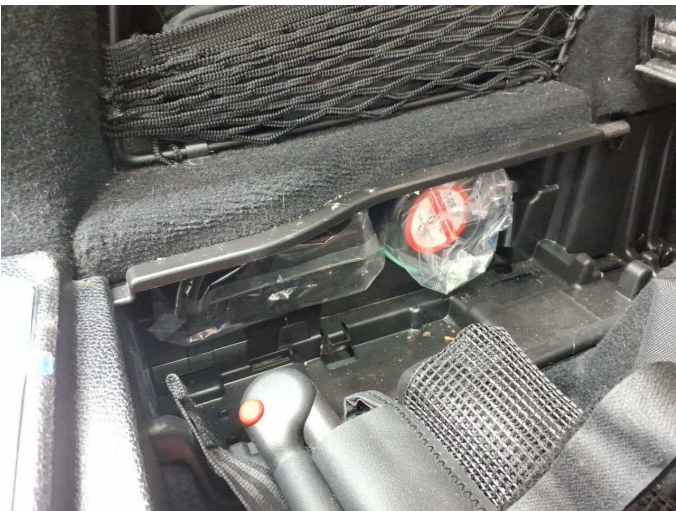



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

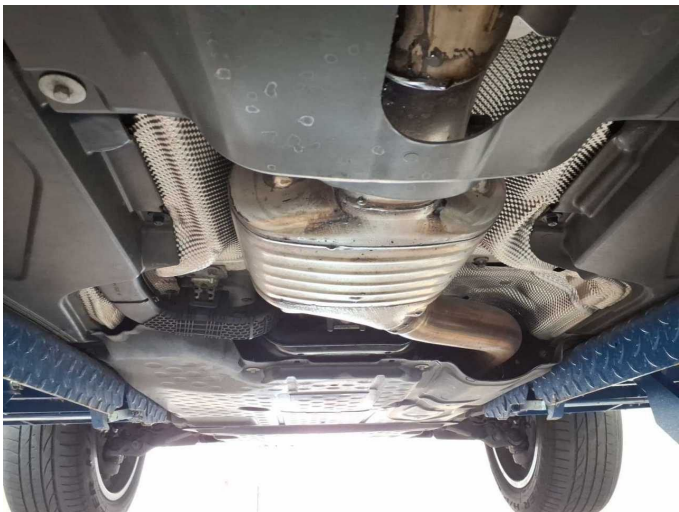

Damage 1: Body: Underbody (Verölt) - Leaking - Perform diagnosis




Damage 1: Body: Underbody (Verölt) - Leaking - Perform diagnosis




Damage 1: Body: Underbody (Verölt) - Leaking - Perform diagnosis




Damage 1: Body: Underbody (Verölt) - Leaking - Perform diagnosis

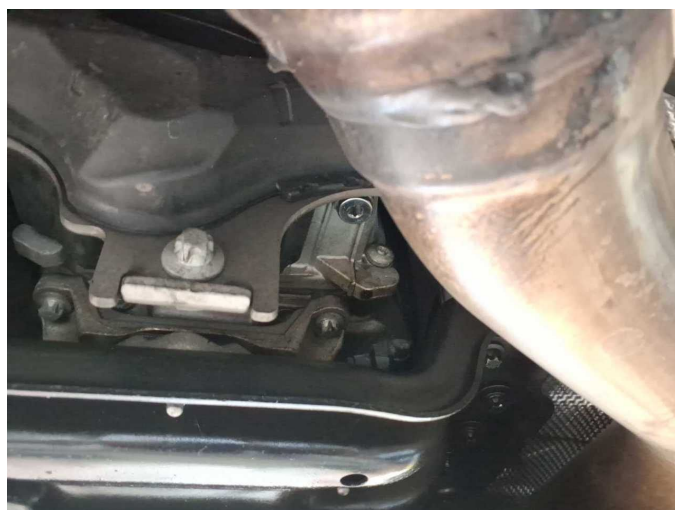

Damage 1: Body: Underbody (Verölt) - Leaking - Perform diagnosis

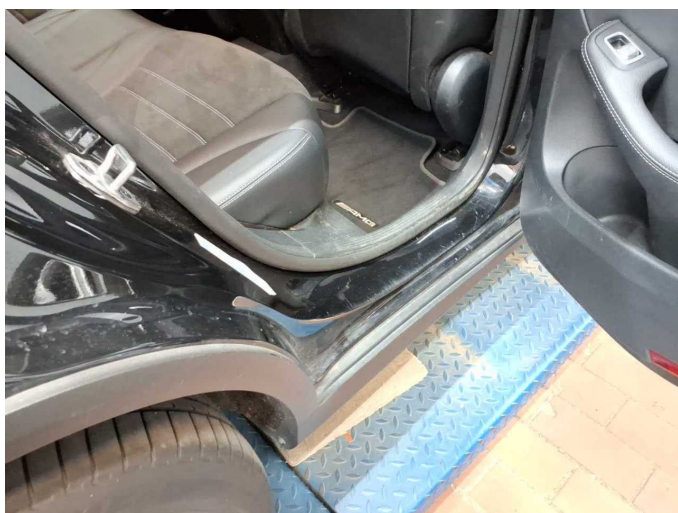

Damage 2: Sill - right side: Sill - Scratched - Smart repair

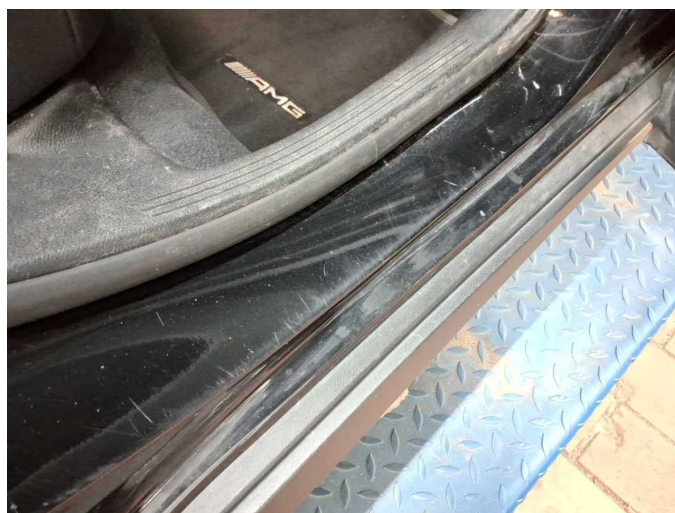

Damage 2: Sill - right side: Sill - Scratched - Smart repair



Damage 4: Wheel / tyres: Tyre - front (einseitig abgefahren) - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front (einseitig abgefahren) - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front (einseitig abgefahren) - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front (einseitig abgefahren) - Worn - Replace



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 6: Wheel / tyres: Alloy rim - front left side - Damaged - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Damaged - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Damaged - Loss in value

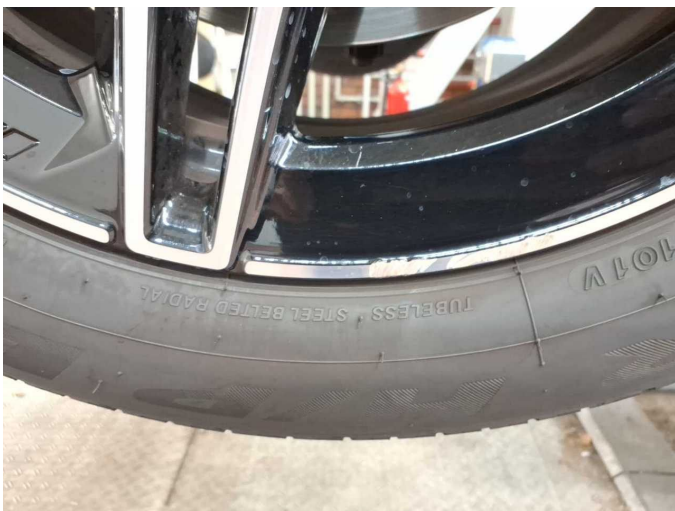

Damage 6: Wheel / tyres: Alloy rim - front left side - Damaged - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front left side - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Damaged - Loss in value



Damage 8: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 8: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 8: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint




Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 9: Boot lid / rear door: Boot lid - Scratch(es) - Paint

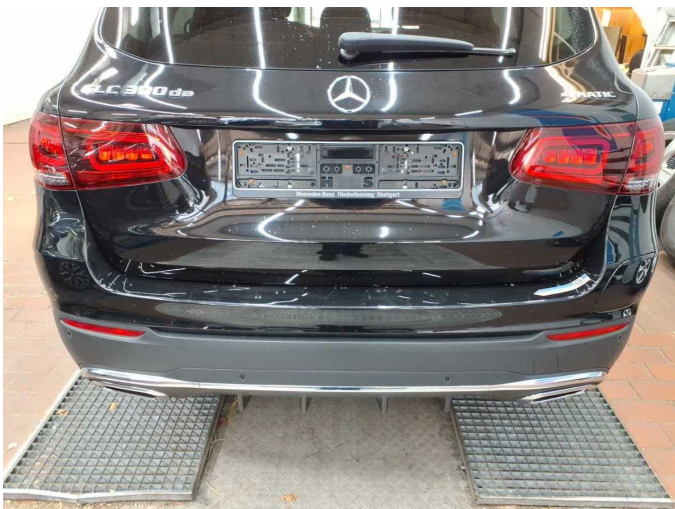

Damage 10: Rear bumper: Rear bumper - Scratched - Paint



Damage 10: Rear bumper: Rear bumper - Scratched - Paint



Damage 10: Rear bumper: Rear bumper - Scratched - Paint




Damage 11: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 11: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 11: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

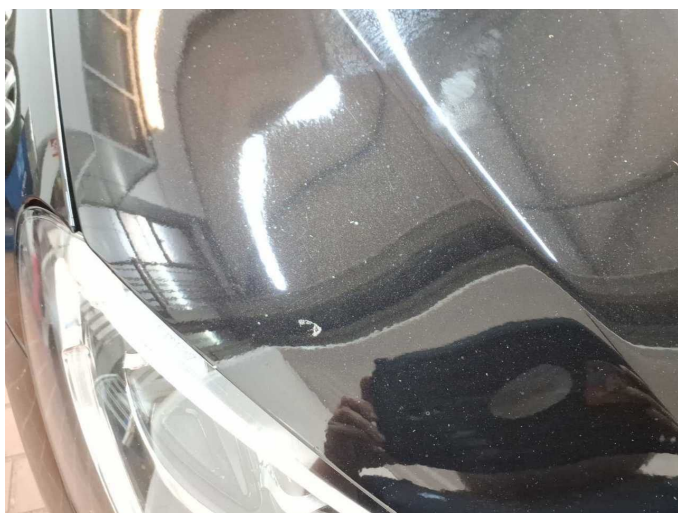

Damage 11: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 11: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 11: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Wear and tear 1: Indicator - front: Mirror - right side - Scratched - No deduction




Wear and tear 1: Indicator - front: Mirror - right side - Scratched - No deduction



Wear and tear 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

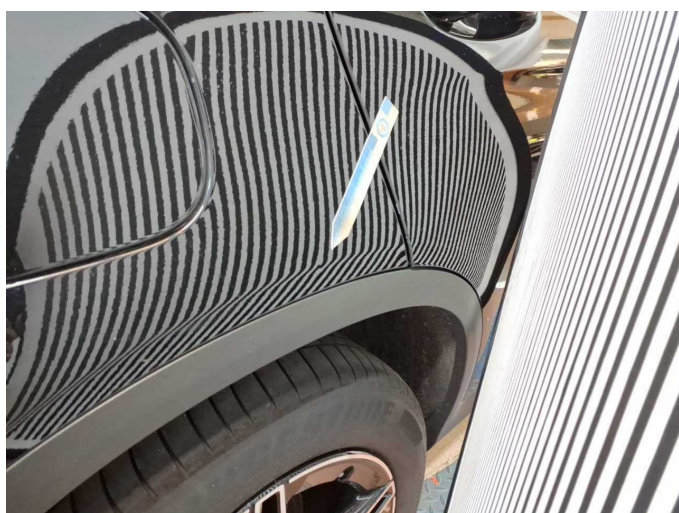

Wear and tear 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

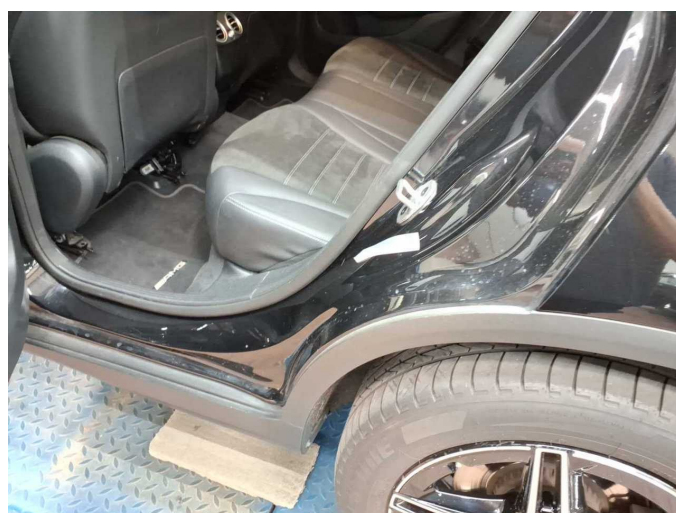

Wear and tear 3: Side panel - rear left side: Sill - Scratched - Smart repair



Wear and tear 3: Side panel - rear left side: Sill - Scratched - Smart repair



Mudguard - left side: 167 µm



Mudguard - right side: 175 µm



Bonnet: 163 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539111F981700

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 300 de 4Matic 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
11.02.2026	165.784	Regelwartungsdienst; Systemtest/Eigendiagnose
03.02.2026	165.784	Bremsscheiben vorne; Regelwartungsdienst
01.07.2025	140.274	Regelwartungsdienst
18.01.2025	118.545	Bremsklötze hinten
17.12.2024	112.965	Systemtest/Eigendiagnose
03.12.2024	112.965	Regelwartungsdienst
30.09.2024	106.677	HU + AU
13.02.2024	85.268	Regelwartungsdienst
20.06.2023	60.495	Regelwartungsdienst
31.08.2022	23.942	Regelwartungsdienst