



Expertise

Protocol number: 46605278
Order No. / Reference: 26692239
Inspection date: 14 Jul 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1T5PW027773



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Touran 2.0 TDI SCR DSG Comfortline

Vehicle Identification number WVGZZZ1T5PW027773

Mileage (Read) 59,026 km

First registration 30 Jun 2023

Number of holders 1

Fuel type Diesel

Engine displacement / Cylinder 1,968 ccm / 4

Power 110 kW

Gearbox / Number of gears Automatic / 7

Type of drive Front drive

Type of vehicle Van

Colour / colour code Dolphin grey metallic

Doors / Seats 5 / 5

Upholstery type Alcantara / cloth

Colour of upholstery Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	27,900 km
Last service on / at	05/2026 at 58,825 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV238890
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWR 00468		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Dunlop	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel rim with wheel cover	Dunlop	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger (with front passenger airbag deactivation, including driver's side knee airbag)
- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- Exterior mirror housings and door handles in body color
- third brake light
- black roof rails
- Decorative inlays "Piano Black" (for center console)
- Diesel particulate filter
- Tachometer
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Automatic headlight control with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage management package (with luggage net that can be fixed to rails)
- Additional luggage compartment lighting (removable and usable as a flashlight)
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats (device for attaching child seats to the rear seats)
- Black radiator grille with chrome strips on the slats
- Headlight range control
- Front center armrest (height and length adjustable - with removable storage box - 2 rear air vents)
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16 (tires 205/60 R 16)
- Gearshift knob in leather
- Keyless start system without safe locking
- Electromechanical power steering (speed-dependent control)
- Seats: 3 individual seats in the 2nd row (longitudinal adjustment, backrest tilt adjustment, armrest and "EasyFold" folding function)
- Seats: Lumbar support in the front
- Seats: Front seats are height-adjustable
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- Electrically folding exterior mirrors (dimming on the driver's side, ambient lighting and passenger-side mirror lowering)
- Headliner in Storm Grey
- Decorative inserts "New Brushed Design" (for instrument panel and front door trim)
- Digital Cockpit, multi-colored (various info profiles selectable)
- Electronic parking brake including auto-hold function
- Electronic Stability Program (ESP) with counter-steering support (Incl. ABS with brake assist, ASR (traction slip control), EDS (electronic differential lock), MSR (engine drag torque control) and trailer stabilization)
- Pedestrian and cyclist detection as well as active front hood
- Luggage compartment cover (with comfort opening, extendable, removable and stowable)
- Luggage compartment floor height adjustable (with fixing element)
- Glove compartment with cooling option
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Headrests (3) in the 2nd row of seats (height adjustable)
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery in fabric
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Rain sensor
- Wheels: Tire pressure monitoring system
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear (and seat belt tensioners in the rear)
- Seats: Front passenger seat backrest folds down completely (with table and pass-through function)
- Seats: Folding tables on the backs of the front seats (tilt adjustable)
- Lane keeping assistant "Lane Assist"
- Start-stop system (with brake energy recuperation)
- 12V power outlet on the rear center console (and in the luggage compartment)
- Bumpers in body color
- Telephone interface
- Textile floor mats (front and rear)
- USB-C interface (charging power up to 45 W)



- Lane change assistant "Side Assist" and parking assistant (warns the driver of vehicles that could pose a danger during lane changes by means of visual signals in the respective exterior mirror - monitors the area behind and beside the vehicle when reversing out of a parking space - issues visual and acoustic warning signals when a vehicle is detected crossing the parking space path - can initiate emergency braking to reduce the severity of a collision or to prevent a collision altogether)
- Warning tone and light for unfastened front seat belts (warning light for unfastened rear seat belts)
- Electronic immobilizer
- Green heat-insulating glazing (sides and rear)
- Black trim strips on the side windows

- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus" (online information is transmitted directly to the car (e.g. navigation with point-of-interest search, online traffic information, parking information, etc.))
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Ambient lighting (ambient lighting, light strips on the front door trim, illuminated door handles and front door armrests - "Piano Black" decorative inlays for the instrument panel and front door trim - interior lights with delayed shut-off and dimming function, 2 LED reading lights front and rear - LED light in the front footwell)
- High beam assistant "Light Assist"
- Tailgate with electric opening and closing
- Paint finish: Metallic
- Package: Business Premium incl. Navigation (DSG) (Air Care Climatronic air conditioning - Lumbar support front, electrically adjustable on driver's side, massage function driver's side - Multifunction leather steering wheel with shift paddles - Cargo net partition - Automatically heated windshield washer nozzles front - Headlight cleaning system - Drawer under the right front seat - Microfleece seat center panels "ArtVelours" - Top comfort seats front - Heated front seats - Height-adjustable front seats, ergoActive seat on the driver's side - Washer fluid level warning light)
- Rear side windows and rear window tinted
- Seats: ergoActive seat with 14-way adjustment and massage function in front in conjunction with Business Package Premium (ergoActive front seats height-adjustable, seat and backrest tilt adjustable - lumbar support in front electrically adjustable and with massage function - without drawers under the front seats - seat center panels in microfleece "ArtVelours" - top comfort seats in front - heated front seats)
- Traffic sign recognition

- Towbar, foldable with electric release
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Reversible luggage compartment mat, foldable and removable
- Steering wheel: Multifunction leather steering wheel, heated, with paddle shifters
- Package: Driver Assistance Package
- Package: Mirrors in conjunction with driver assistance package
- Package: Winter package (automatically heated front windshield washer nozzles - headlight cleaning system - heated front seats - washer fluid level warning lights)
- Park Assist (automatically steers the vehicle into parallel and perpendicular parking spaces and also parks out of parallel parking spaces)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Voice control
- Auxiliary heating and ventilation (auxiliary heating and ventilation with radio remote control and timer)
- 230V power outlet in the luggage compartment on the left (additional luggage compartment lighting, removable and usable as a flashlight)
- "Comfort" telephone interface with inductive charging function (hands-free system)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door (Blende oben) - Scratch(es) - Loss in value
2	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
3	Sill - left side	Sill - dent(s) - Smart repair
4	Door - rear left side	Door - dent(s) - Smart repair
5	Door - front left side	Door - Dent / paintcoat damage - Smart repair
6	Front bumper	Front bumper - Dent / paintcoat damage - Smart repair
7	Rear bumper	Rear bumper - Scratch(es) - Smart repair
8	Instrument panel	Air nozzle - centre (Hinten) - Broken / torn - Replace
9	Body	A-pillar - right side - Corrosion - Repair and paint
10	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
11	Side panel - rear right side	Side panel - Deformed - Repair and paint
12	Door - rear right side	Door - Scratch(es) - Paint
13	Door - front right side	Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint
14	Boot lid / rear door	Boot lid - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 17 Oct 2025	6.395,63 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent
2	Door - front right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	289 µm	Door - front right side	171 µm
--------	--------	-------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

-Der montierte Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

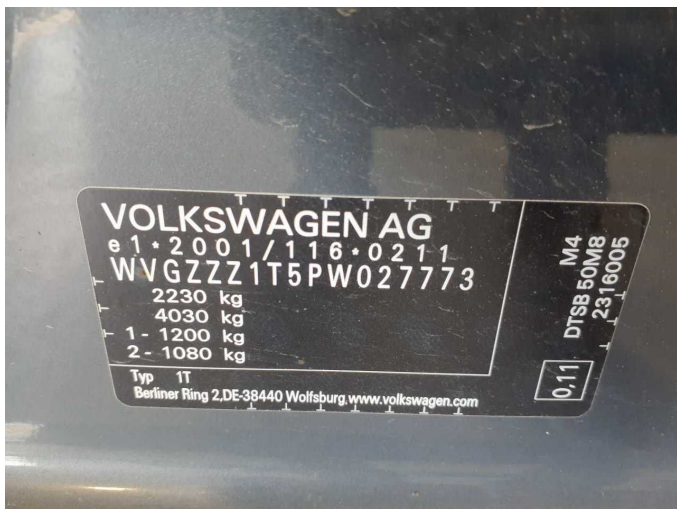


Figure 11: VIN



Figure 12: Mounted tyres

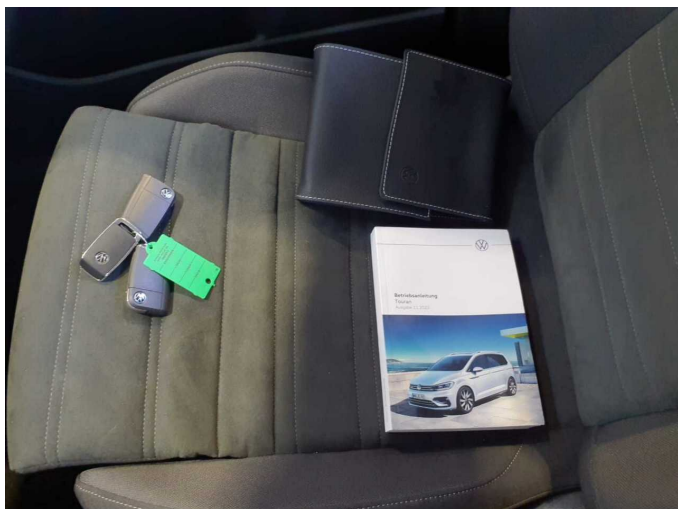


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 1: Door - front left side: Door (Blende oben) - Scratch(es) - Loss in value



Damage 1: Door - front left side: Door (Blende oben) - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 3: Sill - left side: Sill - dent(s) - Smart repair



Damage 3: Sill - left side: Sill - dent(s) - Smart repair




Damage 4: Door - rear left side: Door - dent(s) - Smart repair




Damage 4: Door - rear left side: Door - dent(s) - Smart repair



Damage 5: Door - front left side: Door - Dent / paintcoat damage - Smart repair

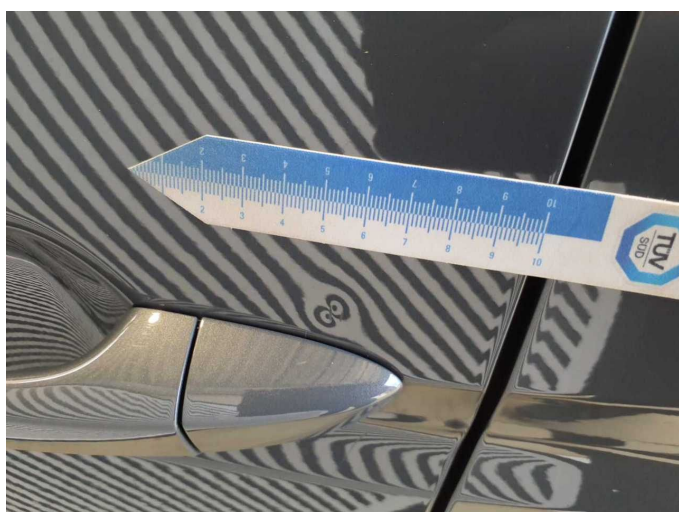

Damage 5: Door - front left side: Door - Dent / paintcoat damage - Smart repair

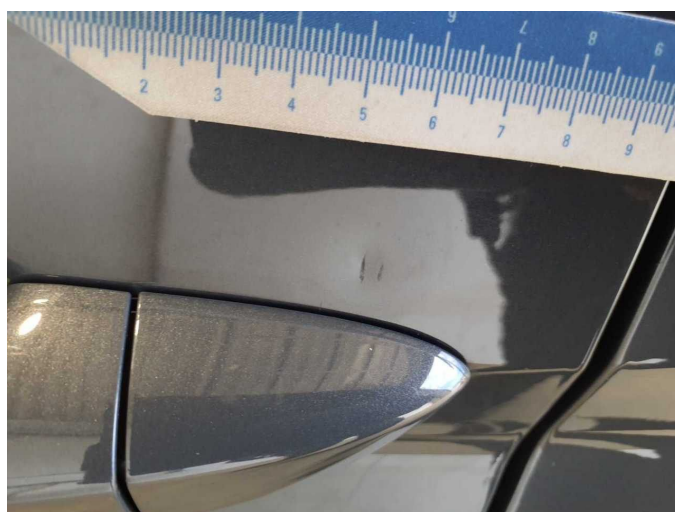


Damage 5: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 6: Front bumper: Front bumper - Dent / paintcoat damage - Smart repair




Damage 6: Front bumper: Front bumper - Dent / paintcoat damage - Smart repair

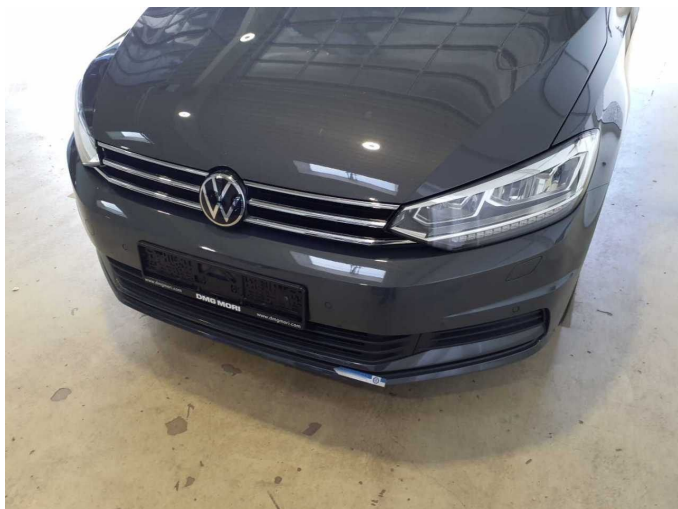


Damage 6: Front bumper: Front bumper - Dent / paintcoat damage - Smart repair



Damage 7: Rear bumper: Rear bumper - Scratch(es) - Smart repair

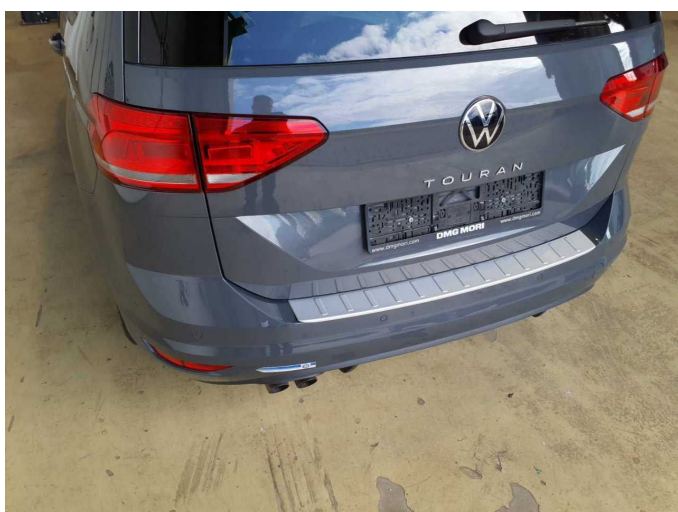

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Smart repair

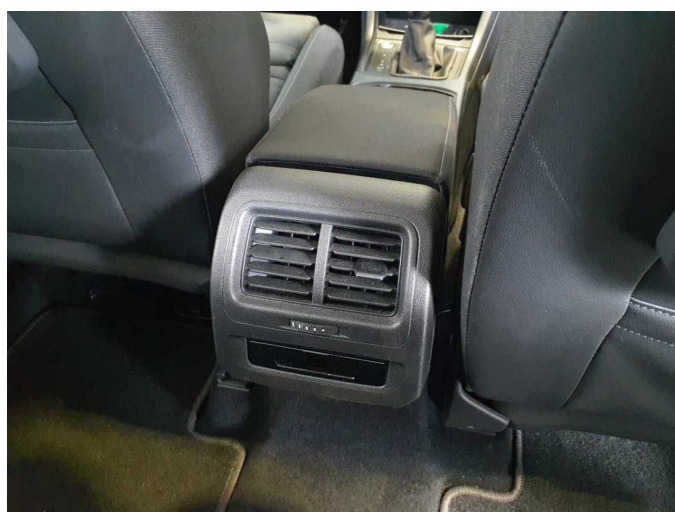


Damage 8: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 8: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 9: Body: A-pillar - right side - Corrosion - Repair and paint

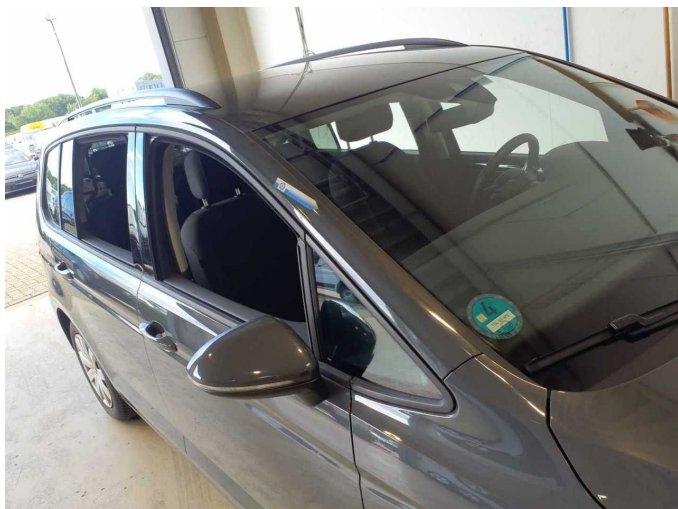


Damage 9: Body: A-pillar - right side - Corrosion - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

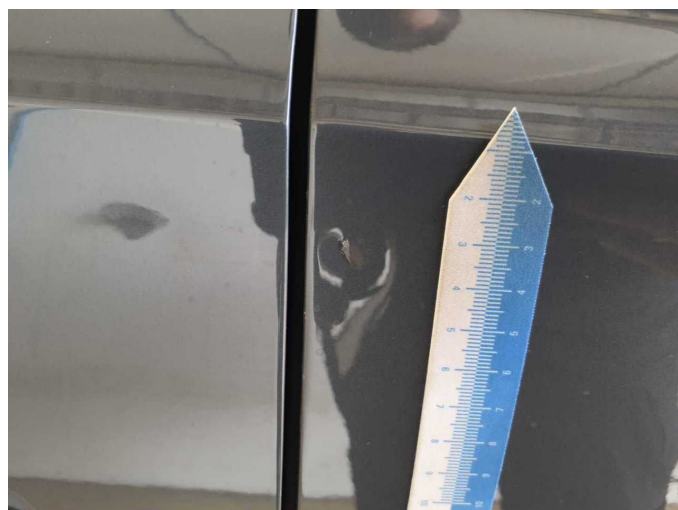

Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 10: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 11: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 11: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 11: Side panel - rear right side: Side panel - Deformed - Repair and paint




Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 13: Door - front right side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint

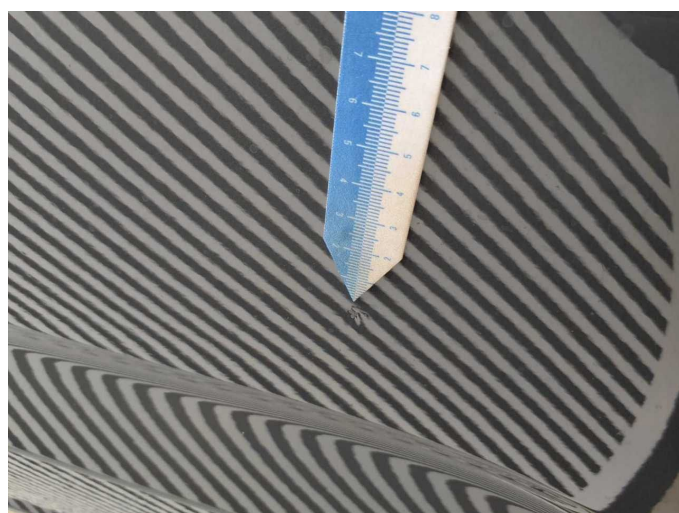

Damage 13: Door - front right side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint



Damage 13: Door - front right side: Door (Spachtelmasse eingefallen) - Unprofessionally repaired - Repair and paint




Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint

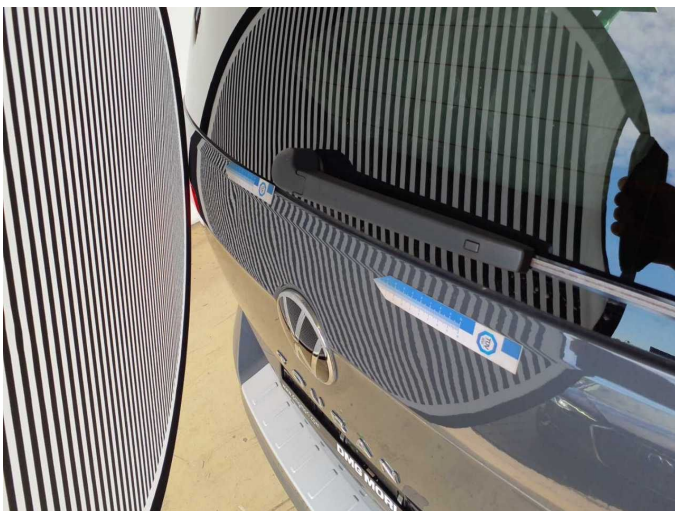

Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 14: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Repainting 1: Bonnet



Repainting 1: Bonnet



Repainting 2: Door - front right side



Repainting 2: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1T5PW027773

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
Comfortline

Datum	KM-Stand	Beschreibung
29.05.2026	58.825	AU; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
23.01.2025	25.770	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges