



Expertise

Protocol number: 46822905
Order No. / Reference: 26775015
Inspection date: 29 Jul 2026

Manufacturer: Skoda
VIN: TMBAH7NP6P7013297

Model: Superb 2.0 TDI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb 2.0 TDI DSG Style	
Vehicle Identification number	TMBAH7NP6P7013297
Mileage (Read)	134,282 km
First registration	19 Dec 2022
Number of holders	1
Next periodical technical inspection	01/2028
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	moonweiss-metallic (S9R)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Beige
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	12,000 km
Last service on / at	04/2026 at 127,682 km		
Key is / should be	2 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	G449580
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / APK 01901		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,148 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Dashboard in black / black, door trim in black, headliner in grey
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors with boarding lights - automatically dimming on the driver's side
- Hydraulic brake assist (HBA)
- Decorative inlay Dark Brushed
- Digital Cockpit Plus 10.2"
- Third brake light
- Easy Start (start-stop button instead of ignition lock)
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front and rear footwell lighting
- Cruise control system including speed limiter
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- Heated rear window
- Interior mirror automatically dimming
- Child safety lock for the rear doors and windows
- Air Care Climatronic (2-zone) air conditioning system - fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter and air-conditioned glove compartment
- LED taillights in crystal glass look and animated turn signals
- Steering wheel: Steering wheel with multifunction buttons including paddle shifters
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB ports at the front (Type-C) and USB charging port (Type-A) in the center armrest
- Umbrella compartments in the front side doors
- Tire mobility kit - tire repair spray incl. compressor
- Gearshift and handbrake levers in leather
- Heated windshield washer nozzles
- Superb safety belts - Height-adjustable three-point front seat belts with pretensioners - Three three-point rear seat belts - Seat belt reminder indicator for all seats
- Storage compartments, ticket holder on the windshield, 4 roof grab handles (rear with coat hooks), coat hooks on the B-pillar, holders for safety vests in the front doors, sunglasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5L bottle holders, cup holders in the front center console with easy-open bottle opening, storage pockets on the front seatbacks, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk.
- Exterior mirrors and door handles in body color
- Illuminated glove compartment
- Hill start assist
- Grey headliner
- Diesel particulate filter and SCR catalyst
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electric tailgate opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (Easy Light Assist), coming and leaving home function and tunnel light
- Front radar assist including city emergency braking function: The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to vehicles ahead using a radar sensor integrated into the radiator grille.
- ISOFIX preparation on the outer rear seats, including top tether
- Front and rear headrests are height-adjustable.
- Radiator grille slats, frame and window surround chrome-plated
- LED reading lights at the front and rear of the headliner
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Height and reach adjustable leather steering wheel
- Matrix LED headlights - dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - animated turn signals
- Multifunctional storage compartment under the boot cover
- LED fog lights with integrated cornering lights
- Upholstery: Cloth
- Radio accessories: Voice control
- Radio accessories: Wireless SmartLink, Apple CarPlay, Android Auto
- Tire pressure monitoring
- Wheels: 17" Drakon alloy wheels - 6.5J x 17" ET 41 with 215/55 R17 tires - anthracite, polished
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats - driver's seat and exterior mirrors with memory function
- Seats: Height-adjustable front seats



- Seats: Electric operation of the front passenger seat from the rear
- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Sunset (rear window and rear side windows tinted dark)
- Telephone: Bluetooth hands-free system
- Door sill plates
- Chrome-plated elements on air vents, light switches, music or navigation systems, air conditioning
- Immobiliser

- SKODA Care Connect SOS emergency call function (emergency call including automatic activation in the event of an accident with airbag deployment), mobility service (connection for rapid assistance in case of breakdown), information service (connection to the hotline for all questions regarding vehicle functions), free remote vehicle access for 1 year with access to vehicle data and functions via smartphone, e.g., parking position, hazard warning lights activation, current fuel level
- Glazing: Acoustic glazing in the front side windows
- Lashing eyes in the trunk
- Central locking with remote control

Extra equipment

- Swiveling trailer hitch including trailer stabilization
- Paint finish: Pearl effect
- Steering wheel: Heated steering wheel including paddle shifters
- Paket: Komfort Plus (Limousine, Style) - 3-Zonen Climatronic - beheizbare Vorder- und Rücksitze - Kessy - 3. Fahrzeugschlüssel - Komfortöffnung für die Heckklappe - beheizbares Lenkrad (mit Schaltwippen) - Sonnenschutzrollo für Heckscheibe - Dekorleiste Argento-Zebrano - Ambientbeleuchtung
- Front and rear parking sensors
- Reversing camera with washer nozzle

- Anti-theft alarm system with SAFE system, interior monitoring and tilt sensor
- Package: Business Columbus - Columbus navigation system - Voice control - Wi-Fi hotspot - Wireless SmartLink for Apple CarPlay - 9.2" capacitive touchscreen in glass design - Phonebox - Traveller assistance system (traffic sign recognition, predictive lane keeping assist ACC, adaptive lane keeping assist, emergency and traffic jam assist, capacitive steering wheel with hands-off detection) - 230V socket and 3 USB ports, tablet holder - Infotainment Online (3-year subscription)
- Auxiliary heater with radio remote control

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trailer hitch	Trailer hitch (Seilzug der AnhängerKopplung) - Damaged - Replace
2	Front bumper	Front bumper - Scratched - Paint
3	Rear bumper	Rear bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Interior	Interior - Soiled - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description

Documents - Log book

Equipment - Vehicle key (3. Schlüssel)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 5 Jun 2023	2.754,70 €
2	Side right, Provided by user / customer, from 27 Jan 2023	3.107,40 €

Repainting

No. Repainting

- Side panel - rear right side
- Door - rear right side

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

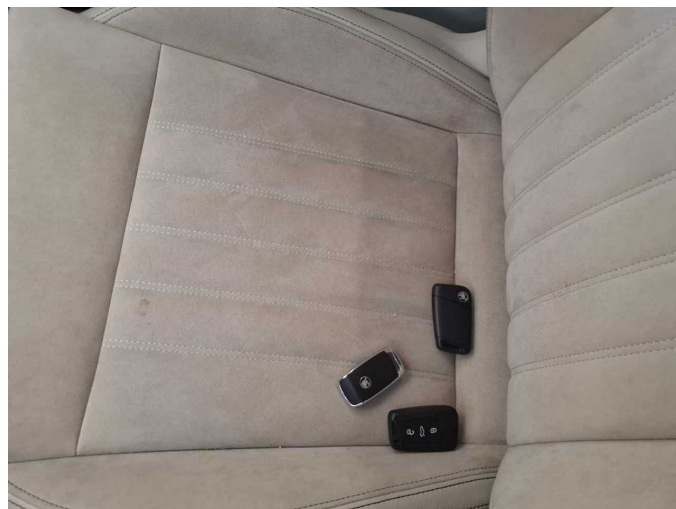


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

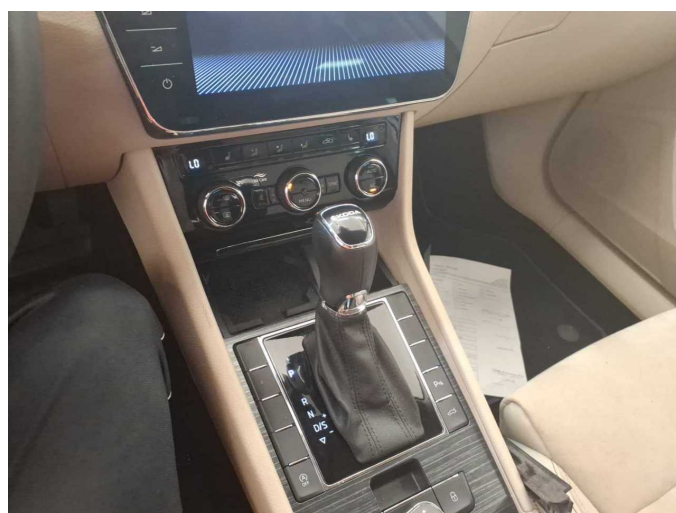


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

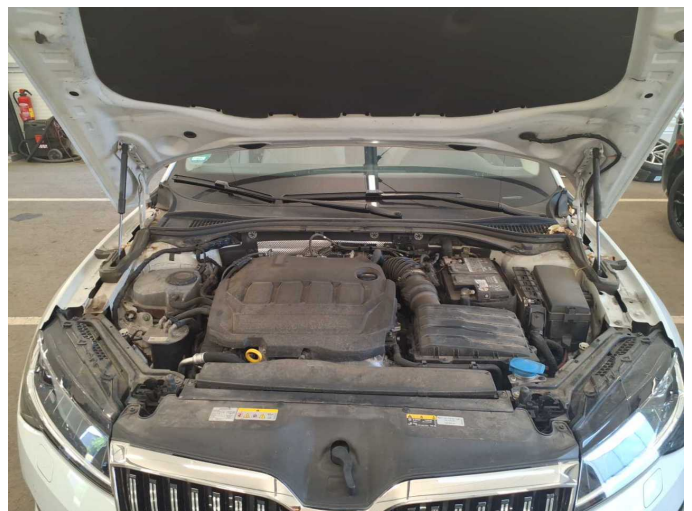


Figure 22: Misc.

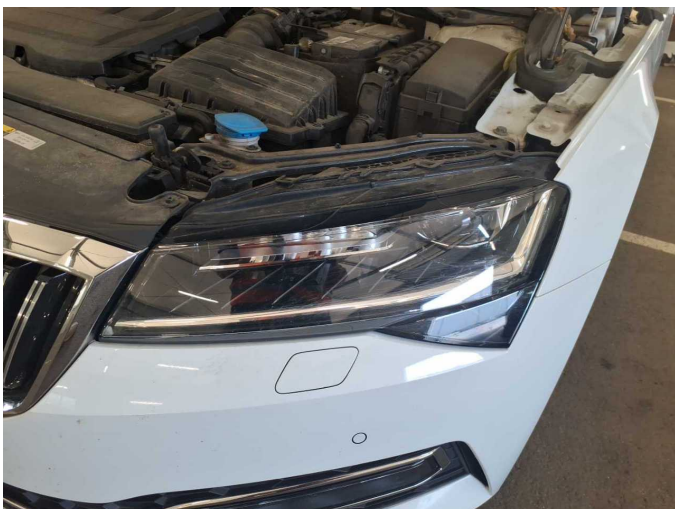


Figure 23: Misc.

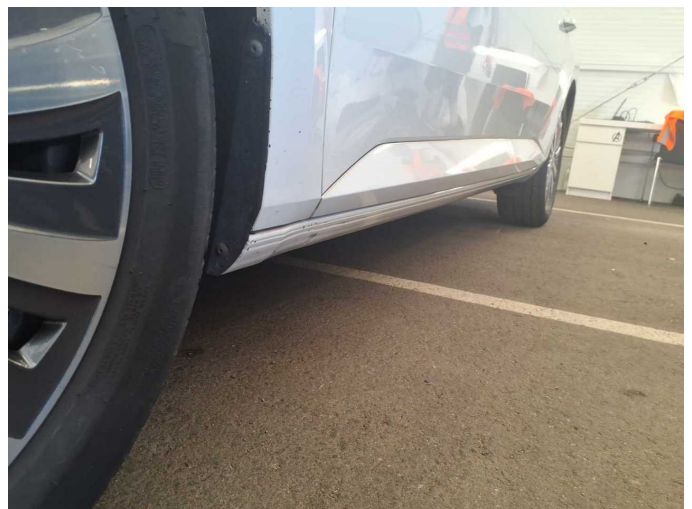


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

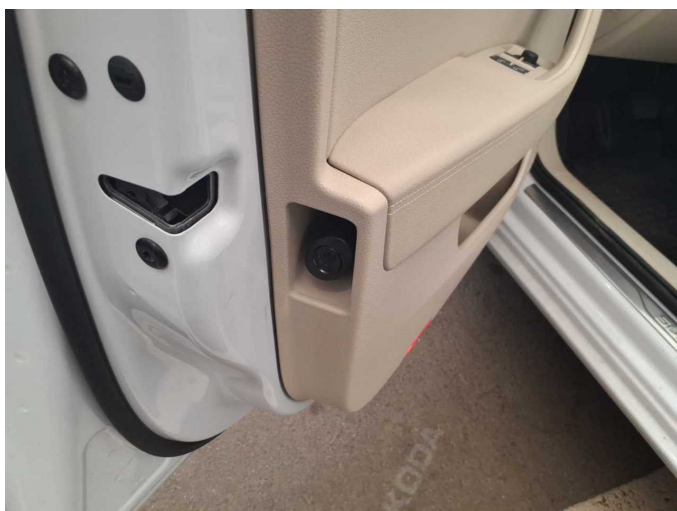



Figure 29: Misc.



Figure 30: Misc.




Damage 1: Trailer hitch: Trailer hitch (Seilzug der AnhängerKopplung) - Damaged - Replace

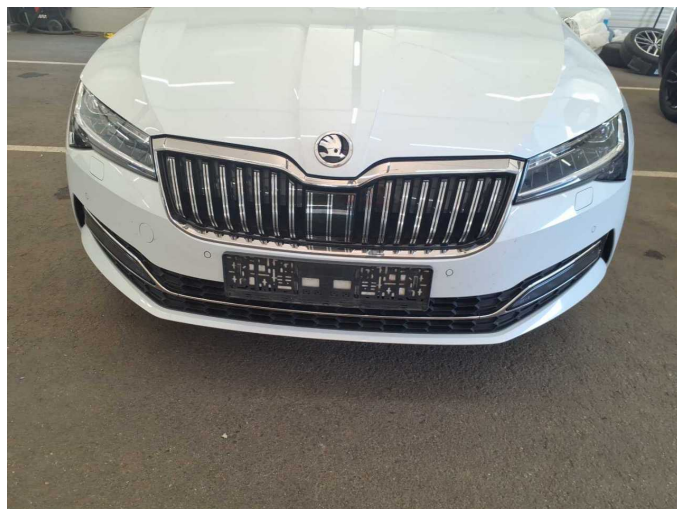

Damage 2: Front bumper: Front bumper - Scratched - Paint




Damage 2: Front bumper: Front bumper - Scratched - Paint

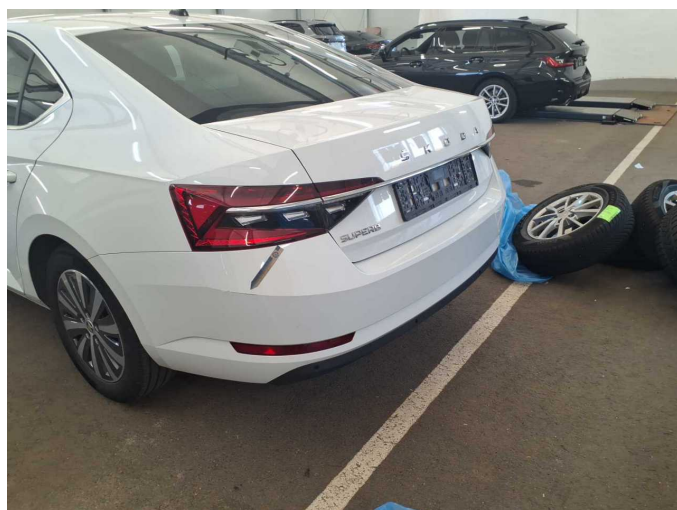

Damage 3: Rear bumper: Rear bumper - Scratched - Paint



Damage 3: Rear bumper: Rear bumper - Scratched - Paint

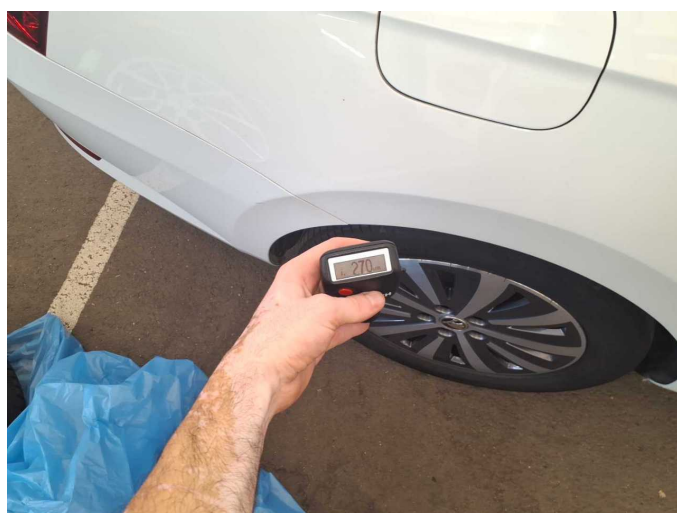

Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Repainting 2: Door - rear right side



Repainting 2: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBAH7NP6P7013297
Hersteller / Modell: SKODA SKODA Superb 2.0 TDI DSG Style

Datum	KM-Stand	Beschreibung
24.04.2026	127.682	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
22.01.2026	117.965	AU; Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges
29.08.2025	105.202	Bremse Sonstiges; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Wartung Sonstiges
06.03.2025	90.630	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
13.11.2024	77.650	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
10.07.2024	60.371	Regelwartungsdienst; Wartung Sonstiges
12.04.2024	50.428	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.11.2023	31.941	Regelwartungsdienst; Wartung Sonstiges
25.08.2023	25.452	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges