



Expertise

Protocol number: 46384060
Order No. / Reference: 26543789
Inspection date: 7 Jul 2026

Manufacturer: Audi	Model: A5 Sportback 40 TDI quattro S tronic S line
VIN: WAUZZZF51MA060578	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A5 Sportback 40 TDI quattro S tronic S line	
Vehicle Identification number	WAUZZZF51MA060578
Mileage (Read)	172,459 km
First registration	1 Jul 2021
Number of holders	1
Next periodical technical inspection	09/2026
(Report not on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Saloon car
Colour / colour code	Quantumgrau (X7B)
Doors / Seats	5 / 4
Upholstery type	Leather
Colour of upholstery	Brown



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,000 km
Last service on / at	11/2025 at 159,329 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC398835
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BWO 00245		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,210 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/35 R19 96Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	255/35 R19 96Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Drive slip control
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light
- Decorative inlays diamond lacquer silver grey
- Tachometer
- Rear parking sensors
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Suspension (sports suspension)
- Remote key, without safe lock
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic (7-speed)
- Interior mirror dimming
- ISOFIX and Top Tether child seat anchors for the outer rear seats
- Headrests (4)
- LED headlights
- Mild hybrid
- front center armrest
- Package Gloss
- Wheel: Alloy wheels "5-twin-spoke design" (S-design)
- Wheel: Tire repair kit
- Radio: MMI Radio Plus
- Radio accessories: Data module Europe
- Electromechanical power steering
- Front seats (standard seats)
- Phone: Bluetooth interface
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Airbag for driver and front passenger
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service including vehicle control
- Electrically adjustable/heated exterior mirrors
- Outdoor temperature display
- Fabric headliner
- Diesel particulate filter (DPF) with DeNox catalyst and AdBlue tank
- Door sill trims with aluminum inlay at the front, illuminated, with S lettering
- Driver information system
- Electric front windows
- front and rear floor mats
- Cruise control system with adjustable speed limiter
- Interior lighting
- Manual child lock
- Automatic air conditioning
- boot floor mat
- LED taillights
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Non-smoking version
- Upholstery: Fabric finish Index
- Wheel: Tire pressure monitoring system
- Wheel: Tires optimized for rolling resistance, speed-limited
- Radio accessories: 8 speakers
- Rear seat backrest foldable
- Seat belts: Three-point automatic seat belts for all seats
- Start-stop system
- First aid kit with warning triangle
- Electronic immobilizer
- Green thermal insulation glazing

Extra equipment

- Auxiliary heater/ventilation (The auxiliary heater warms the interior and defrosts the windows without starting the engine. The auxiliary ventilation system supplies fresh air and lowers the interior temperature. Both functions can be activated via a timer and separate remote control. An intelligent control system with timer and departure time programming calculates the heating duration efficiently in terms of time and energy. Two heating modes are selectable: - defrost (defrost mode for the windows only) - warm (warm mode for preheating the interior)
- Black fabric headliner
- Comfort automatic climate control 3-zone (in addition to the automatic climate control: - climate control unit with large TFT display and capacitive rocker switches - electronically regulates the air temperature and distribution individually for driver and front passenger - additional climate control unit for setting the rear passenger compartment temperature in the rear center console - automatic recirculation control via air quality sensor, with dust and odor-removing allergen filter - ventilated glove compartment - dust and odor-removing cabin air filter - residual heat utilization)
- Deletion of model name and technology lettering
- Driving Assistance Package (Audi active lane assist - Audi adaptive cruise control - Audi pre sense rear and basic - Traffic jam assist - Predictive efficiency assist - Evasive steering assist - Left turn assist - High beam assist - Driver information system with color display - Camera-based traffic sign recognition - Lane change warning)
- Front sports seats (with manual adjustment of seat height, seat longitudinal position, seat tilt, backrest tilt, headrest and belt height; with pronounced seat side bolsters for better lateral support in curves, extendable thigh support)
- Head-up display (projects driver-relevant information from assistance systems, navigation or warning messages onto the windshield in the driver's direct field of vision. The height-adjustable head-up display enables a high-contrast, multi-colored display within the driver's field of vision.)
- Infotainment package Smartphone (Audi phone box light - Audi smartphone interface - USB charging interface for rear passengers (additional 2 USB-A charging interfaces for rear passengers in the rear center console))
- Package: Ambient Lighting Package (in addition to the interior lighting: - approach lighting in the exterior door handles - entry lights on the underside of the front doors - illuminated front cupholders - front footwell lighting - illuminated interior door handles - ambient door lighting - ambient lighting in the front center console)
- Panoramic glass roof (electric operation for tilting and opening the glass element, automatic opening and closing, tinted glass insert with continuously adjustable electric sunshade. Comfort opening and closing from the outside via the remote key; the extra-large glass surface provides a pleasant, light-flooded interior ambience, good acoustics when the roof is tilted or fully open. Integrated wind deflector reduces wind noise when the roof is open.)
- AdBlue tank (24 liters)
- Audi virtual cockpit with 12.3" color display (Innovative, fully digital instrument cluster for flexible and needs-based display of relevant information according to driver requirements: speed/RPM, map display, Audi connect services, radio/media information, etc.; the VIEW button on the multifunction steering wheel allows switching between two different-sized displays of the round instruments. The display with smaller instruments enables large, clear graphics of the on-board computer and MMI content)
- Business package (front seat heating - comfort package mirrors - infotainment package smartphone - navigation package - leather steering wheel in 3-spoke design with multifunction plus)
- Comfort key with sensor-controlled luggage compartment unlocking (wireless communication between the key and the vehicle allows opening the doors and luggage compartment lid, and locking via the sensors on the door handles. The comfort key simply needs to be carried with the vehicle. The engine is started and stopped using the engine start/stop button. The luggage compartment lid can also be conveniently unlocked with a foot gesture by kicking the rear of the vehicle if your hands are full.)
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Matrix LED headlights with Audi laser light (Matrix LED headlights with Audi laser light, dynamic light styling and dynamic turn signals - LED taillights with dynamic light styling and dynamic turn signals - headlight cleaning system)
- Package: Black Optics Package (adds black accents to the exterior in the area of the Audi Singleframe grille, the trim strips on the side windows, and the front and rear bumpers. Design varies depending on model and equipment.)
- Paint finish: Solid color special paint finish
- Parking Assistance Package (Parking Aid Plus - Parking Assist - Rearview Camera)
- Parking assistant including parking aid plus (automatic steering during parking. Ultrasonic sensors search for suitable parallel or perpendicular parking spaces. For perpendicular spaces, the entry path is calculated; for parallel spaces, the entry and exit paths are calculated. The driver must accelerate, shift gears, brake, and monitor the parking process. The system handles the steering. Activation is via a button on the center console.)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)



- Surround view cameras (The four wide-angle surround view cameras cover the entire area immediately around the vehicle and offer a variety of different views for even more convenient maneuvering. The driver can select different views on the MMI display, making it easier to position the vehicle in the parking space. Virtual top view, reversing camera view, panoramic front and rear view, curb view)
- Upholstery: Leather/synthetic leather combination (for standard and sport seats: - center section of the front seats and the two outer rear seats, as well as the driver's side side bolster in the entry area in leather; for sport seats with seat ventilation: - center section of the front seats, non-ventilated center section of the two outer rear seats in perforated leather, as well as the driver's side entry bolster in leather in atlas beige, rock grey, okapi brown or black)
- Seats: Sport seats plus front (electric adjustment of seat height, seat fore/aft position, seat and backrest tilt; manual adjustment of belt height - pronounced seat side bolsters for better lateral support in curves - extendable thigh support - pneumatic backrest bolster adjustment - pneumatic lumbar support with massage function - integrated front headrests - L-shaped headrests for 3 rear seats - S-embossing in the backrests of the front seats - with diamond stitching)
- Telephone: Audi Phone Box (Up to two smartphones can be paired with the vehicle simultaneously via Bluetooth, allowing you to either play music through the vehicle or make phone calls from one of the two smartphones. It connects to the vehicle's antenna, improving both reception and call quality. Additionally, the smartphone can be charged wirelessly using the Qi standard or via USB if it is still in the storage compartment.)
- Wheel: Light alloy wheels in multi-spoke design, graphite grey, polished (8.5 J x 19 with tires 255/35 R 19)
- Winter package (windscreen with climate comfort and acoustic glazing, wirelessly heated - leather steering wheel in 3-spoke design with multifunction plus and steering wheel heating - seat heating front and rear)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Seat - front	Seat - left side (Abdeckung hinten) - Scratch(es) - Smart repair
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Front bumper	Air-inlet grille (Rechts, Rahmen) - Scratched - Replace
5	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
6	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
7	Vehicle glazing	Windscreen (Kleber zu sehen) - Unprofessionally repaired - Un- / install
8	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
9	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Electronic systems	Front camera - Stone chips - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction
4	Side panel - rear right side	Side panel - Stone chips - No deduction
5	Trim / covers	Floor mats - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

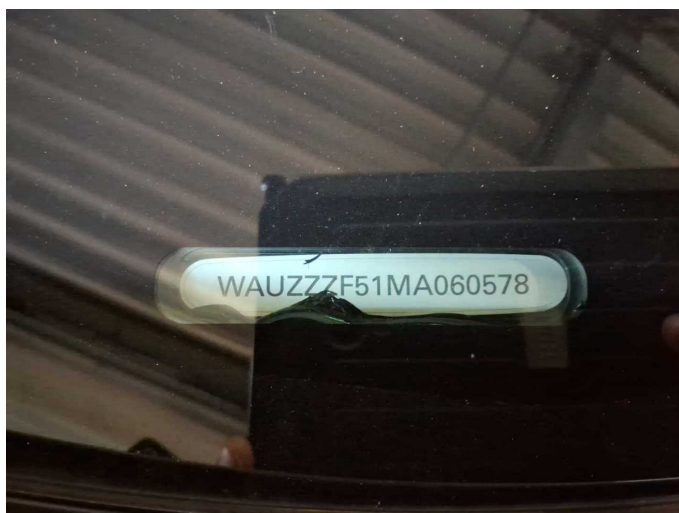


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Navigation

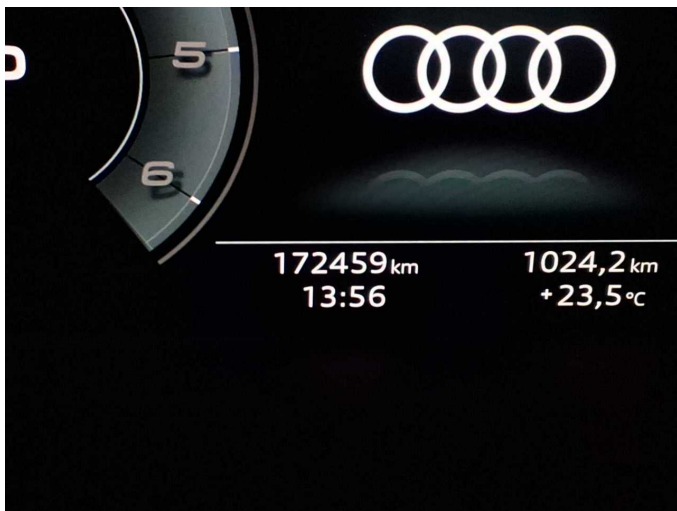


Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

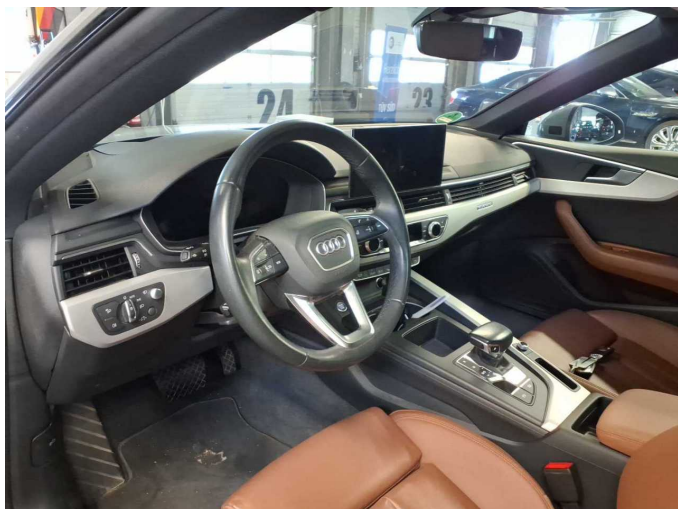


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

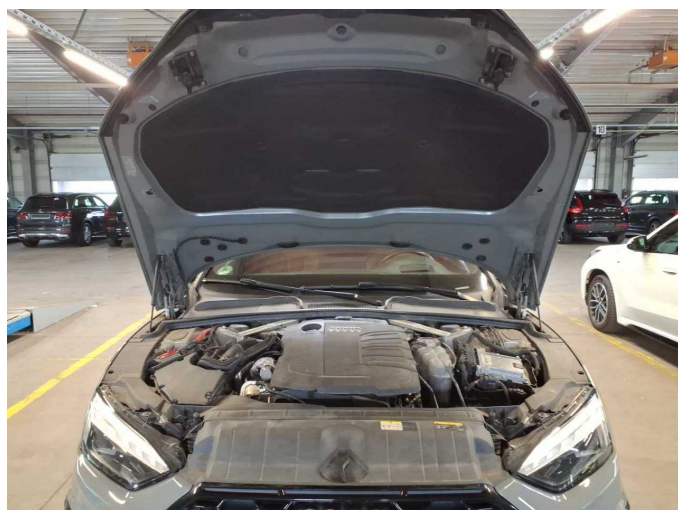


Figure 22: Misc.



Figure 23: Misc.




Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.

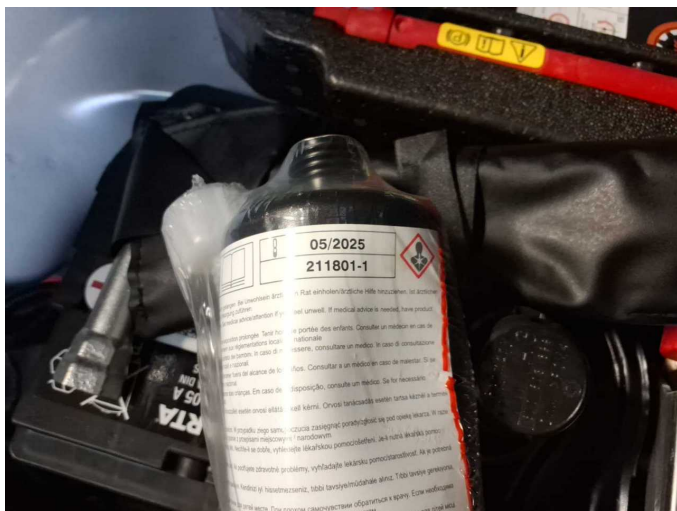

Damage 1: Equipment: Tirefit filler - Expired - Replace

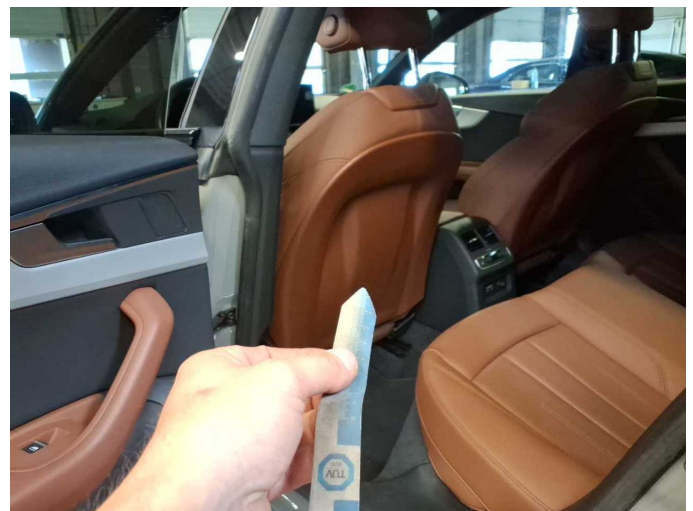

Damage 2: Seat - front: Seat - left side (Abdeckung hinten) - Scratch(es) - Smart repair



Damage 2: Seat - front: Seat - left side (Abdeckung hinten) - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Front bumper: Air-inlet grille (Rechts, Rahmen) - Scratched - Replace



Damage 4: Front bumper: Air-inlet grille (Rechts, Rahmen) - Scratched - Replace



Damage 4: Front bumper: Air-inlet grille (Rechts, Rahmen) - Scratched - Replace



Damage 4: Front bumper: Air-inlet grille (Rechts, Rahmen) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




Damage 6: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 6: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 6: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

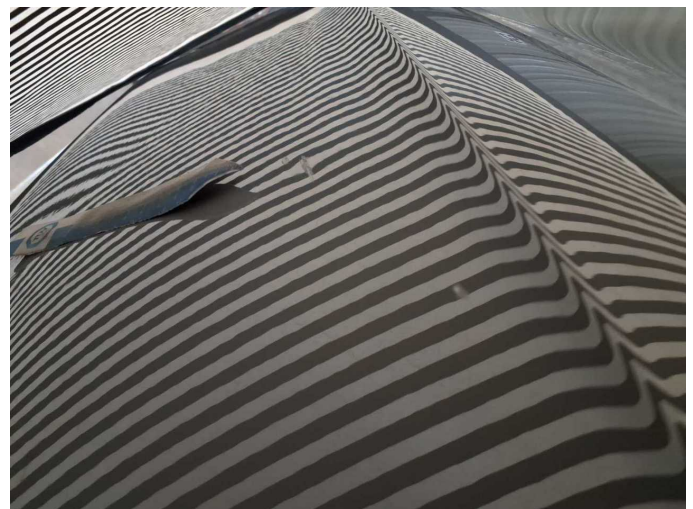


Damage 6: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Vehicle glazing: Windscreen (Kleber zu sehen) -
Unprofessionally repaired - Un- / install



Damage 7: Vehicle glazing: Windscreen (Kleber zu sehen) -
Unprofessionally repaired - Un- / install

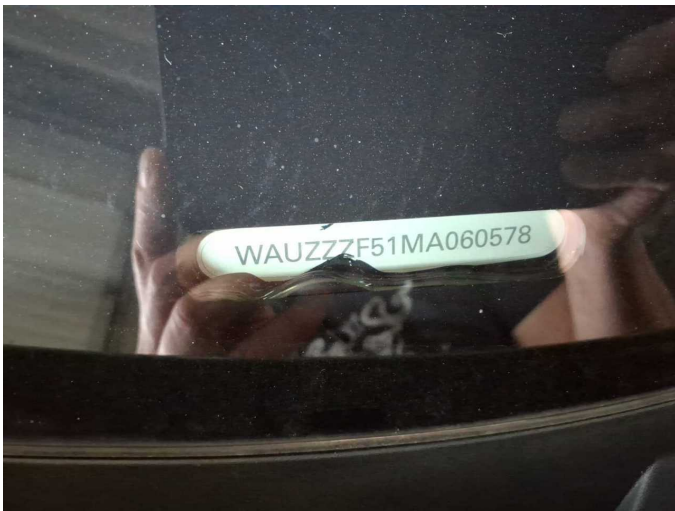

Damage 7: Vehicle glazing: Windscreen (Kleber zu sehen) -
Unprofessionally repaired - Un- / install



Damage 7: Vehicle glazing: Windscreen (Kleber zu sehen) -
Unprofessionally repaired - Un- / install



Damage 8: Door - front right side: Door - Dent / paintcoat damage -
Repair and paint



Damage 8: Door - front right side: Door - Dent / paintcoat damage -
Repair and paint



Damage 8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

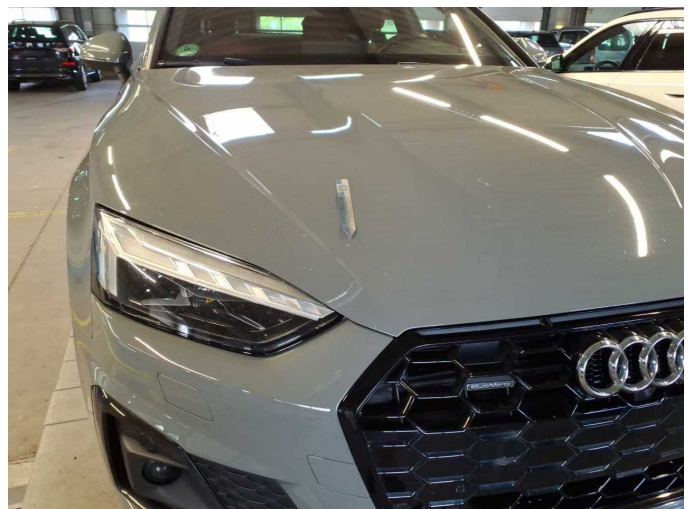

Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear 2: Electronic systems: Front camera - Stone chips - No deduction



Wear and tear 2: Electronic systems: Front camera - Stone chips - No deduction

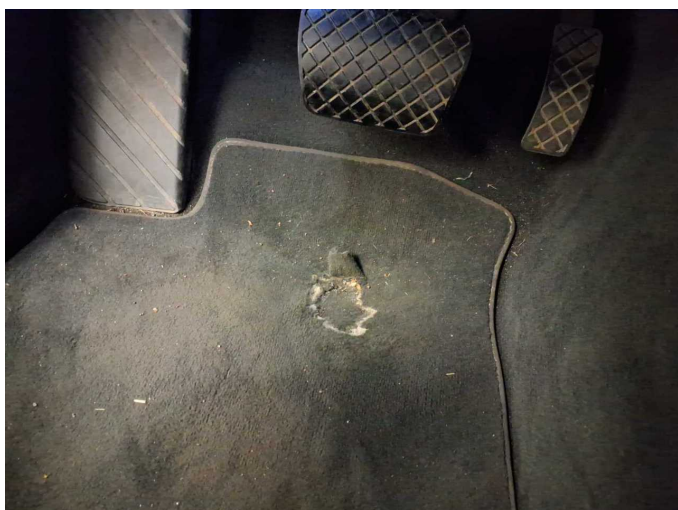

Wear and tear 5: Trim / covers: Floor mats - Broken / torn - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF51MA060578
Hersteller / Modell: AUDI AUDI A5 Sportback 40 TDI quattro S tronic S line

Datum	KM-Stand	Beschreibung
26.11.2025	159.329	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
04.08.2025	146.510	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
15.07.2025	144.429	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.10.2024	117.633	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.09.2024	111.557	AU
30.07.2024	109.930	Systemtest/Eigendiagnose
30.01.2024	97.385	Systemtest/Eigendiagnose
27.09.2023	88.164	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.07.2023	79.558	Bremsflüssigkeit; Bremsflüssigkeit ern
22.11.2022	59.856	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Regelwartungsdienst
15.02.2022	29.273	Motoröl b. Wartung; Regelwartungsdienst