



Expertise

Protocol number: 45821778
Order No. / Reference: 26402910
Inspection date: 5 Jun 2026

Manufacturer: Mercedes-Benz
VIN: W1N4M1DB9RW339883

Model: GLB 200 d 4Matic 8G-DCT Progressive Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 200 d 4Matic 8G-DCT Progressive Advanced	
Vehicle Identification number	W1N4M1DB9RW339883
Mileage (Read)	50,725 km
First registration	6 Dec 2023
Number of holders	1
Next periodical technical inspection	12/2026
(Report not on hand)	
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	NACHTSCHWARZ UNILACK
Doors / Seats	5 / 7
Upholstery type	Artificial leather
Colour of upholstery	Beige-Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	180 Tag(e)
Last service on / at	11/2025 at 43,870 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY547605
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / AHX 00173		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,285 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Bridgestone	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100W	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R18 100W	Summer tyres on Light alloy	Continental	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- Rear armrest
- Automatic passenger airbag deactivation
- Basic services
- On-board computer
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- EASY-PACK tailgate
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis
- Velour floor mats
- Speed Limit Assistant
- Rear window heated
- rear window wiper
- Climate: THERMATIC automatic climate control
- Headrests (2)
- Rear headrests (3)
- Paint finish: Solid
- LED High Performance Headlights
- Steering column mechanically adjustable lengthwise and heightwise.
- Hood with power domes
- Package: Light and Visibility Package
- Package: Seating comfort
- Package: USB Package Plus
- Radio accessories: Digital radio
- Wheels: 45.7 cm (18") light alloy wheels in a 5-twin-spoke design
- Side panels in black grained finish with chrome insert
- Seats: 4-way lumbar support for driver and front passenger
- Seats: Comfort seats
- 12V power outlet in center console
- Front and rear underride protection
- High-visibility vest for drivers
- Decorative elements Star Pattern
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Chrome trim strip
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric window regulators (4)
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Interior headliner fabric crystal grey
- Communication module (LTE) for the use of Mercedes me connect services
- Fuel tank with larger volume 60 l
- Cargo area cover (roller blind)
- Steering wheel: Multifunction sports steering wheel in leather
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Package: Progressive Line Advanced
- Package: Mirror Package
- Upholstery: ARTICO leatherette/fabric
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Windscreen wipers with rain sensor
- Power steering
- Seats: Rear seat backrests foldable
- Seats: Rear seat backrests foldable
- Cruise control
- Pre-installation for digital key handover
- Immobiliser



Extra equipment

- Active Parking Assist
- Package: Progressive Line Advanced Plus (KEYLESS-GO Comfort Package (incl. HANDS-FREE ACCESS and KEYLESS-GO) - Ambient lighting - Wireless charging system for mobile devices in the front - Fully digital instrument display - Individualization package)
- Seats: Electrically adjustable driver's seat with memory function (the memory programming includes all seat adjustment options such as seat height and fore/aft position, seat cushion tilt, and backrest tilt – exterior mirrors and the optional head-up display are also integrated – dynamic seating while driving. Small movements of the seat cushion and backrest in three programs and two speeds)
- Interior headliner fabric macchiato beige
- Panoramic sunroof
- Upholstery: ARTICO two-tone leatherette
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete set LM 5-DpSp.Des. 17" 4R9
- Seats: 3rd row of seats for 2 people
- Seats: Front right seat electrically adjustable with memory function (memory programming with seat adjustment options such as height and longitudinal direction, seat cushion tilt and backrest tilt - Motion Seating with three programs and two speeds)
- Type designation removed from luggage compartment lid

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - Scratch(es) - Cover / polish
2	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
3	Door - front right side	Door - Dent / paintcoat damage - Smart repair
4	Door - front left side	Door edge - Scratch(es) - Smart repair
5	Body	B-pillar - left side - Dent / paintcoat damage - Smart repair
6	Body	B-pillar - right side - Dent / paintcoat damage - Smart repair
7	2nd wheel set	2 tyres - Damaged - Replace
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Door - rear right side	Door - Scratch(es) - Paint
10	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
11	Bonnet	Bonnet - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

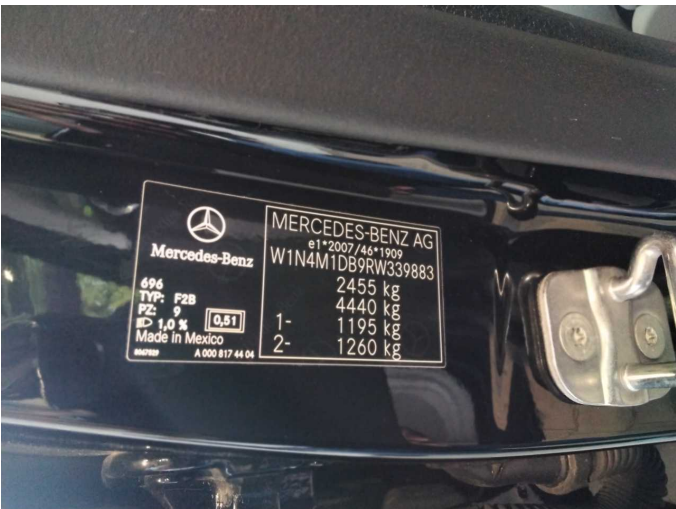


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation

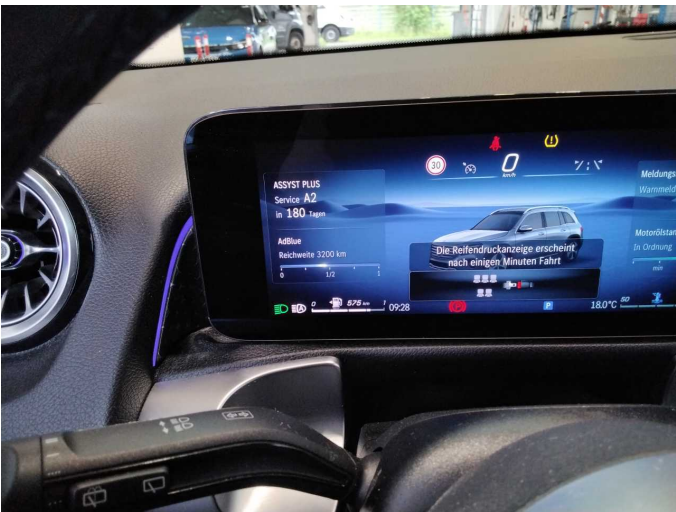


Figure 17: Misc.



Figure 18: Misc.

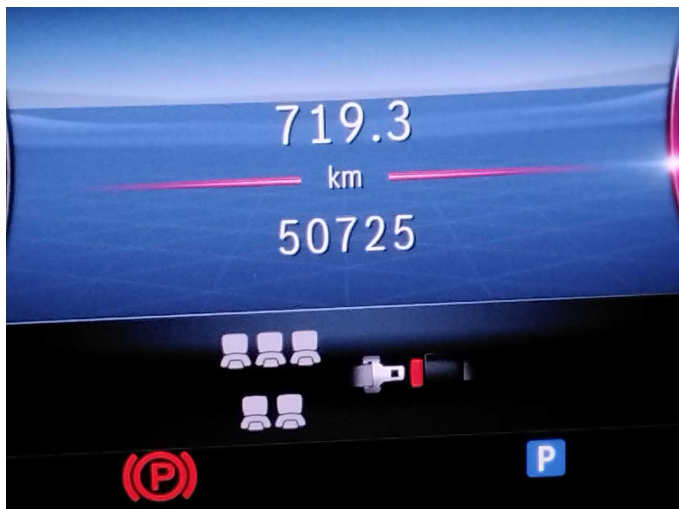


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

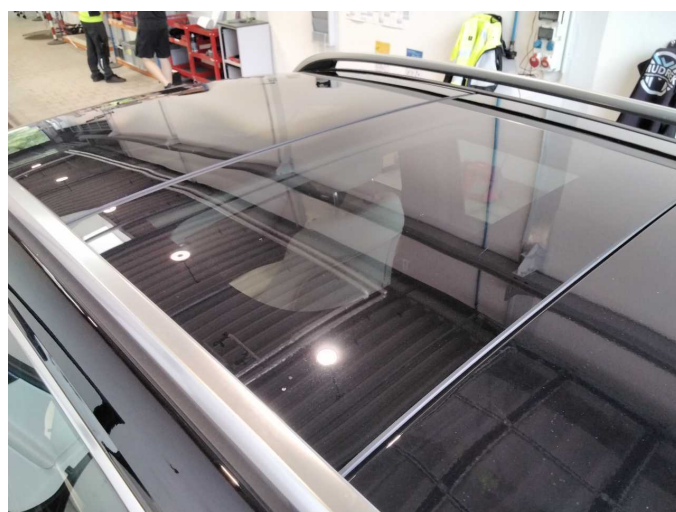


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

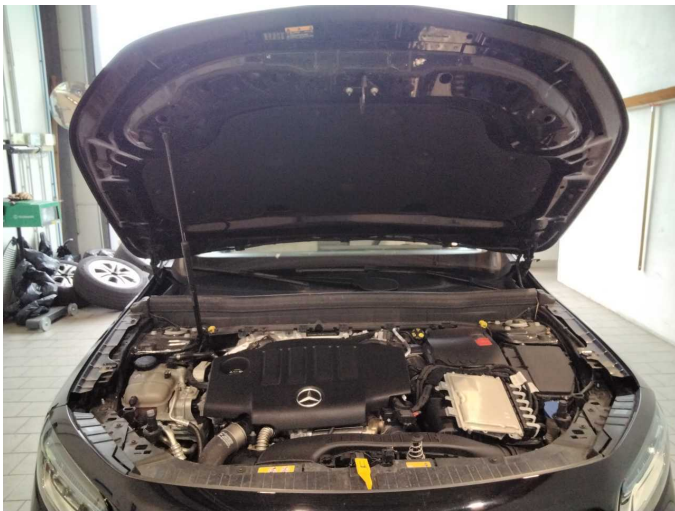


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.


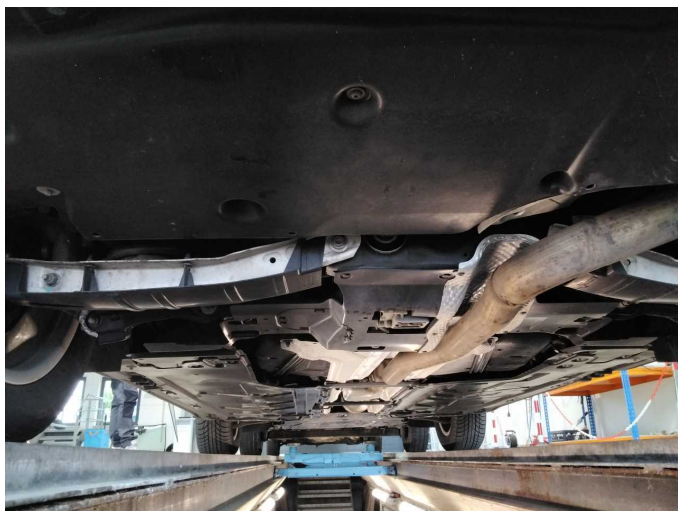


Figure 31: Misc.



Damage 1: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish

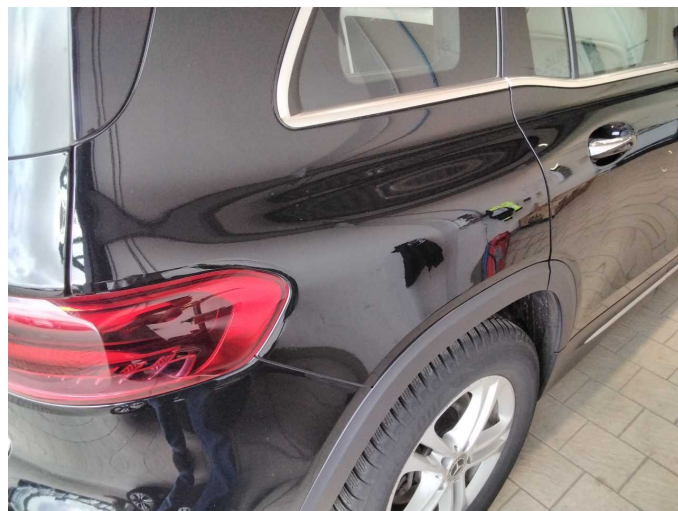

Damage 1: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 3: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair

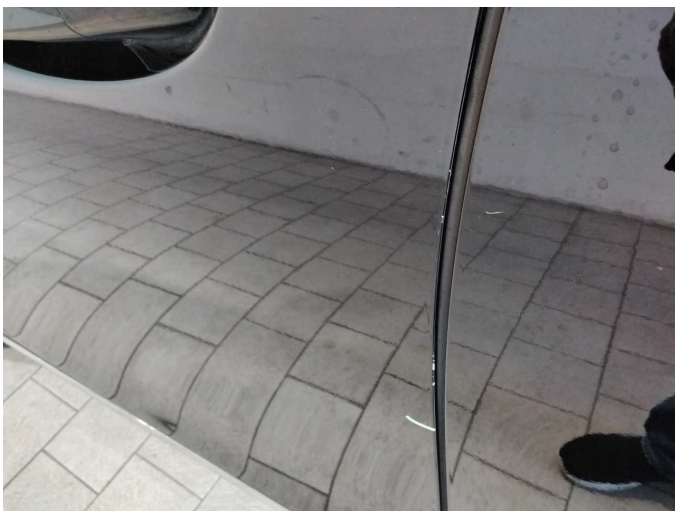

Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 5: Body: B-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 5: Body: B-pillar - left side - Dent / paintcoat damage - Smart repair



Damage 6: Body: B-pillar - right side - Dent / paintcoat damage - Smart repair



Damage 6: Body: B-pillar - right side - Dent / paintcoat damage - Smart repair



Damage 7: 2nd wheel set: 2 tyres - Damaged - Replace



Damage 7: 2nd wheel set: 2 tyres - Damaged - Replace




Damage 7: 2nd wheel set: 2 tyres - Damaged - Replace



Damage 7: 2nd wheel set: 2 tyres - Damaged - Replace



Damage 7: 2nd wheel set: 2 tyres - Damaged - Replace

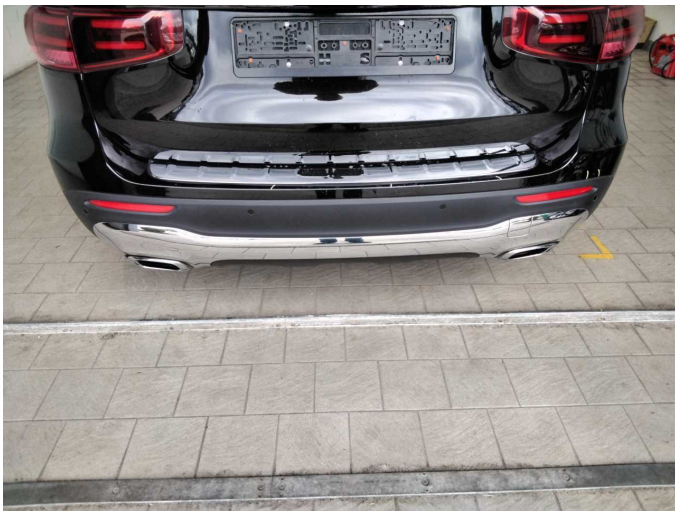

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Door - rear right side: Door - Scratch(es) - Paint




Damage 9: Door - rear right side: Door - Scratch(es) - Paint



Damage 9: Door - rear right side: Door - Scratch(es) - Paint



Damage 10: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

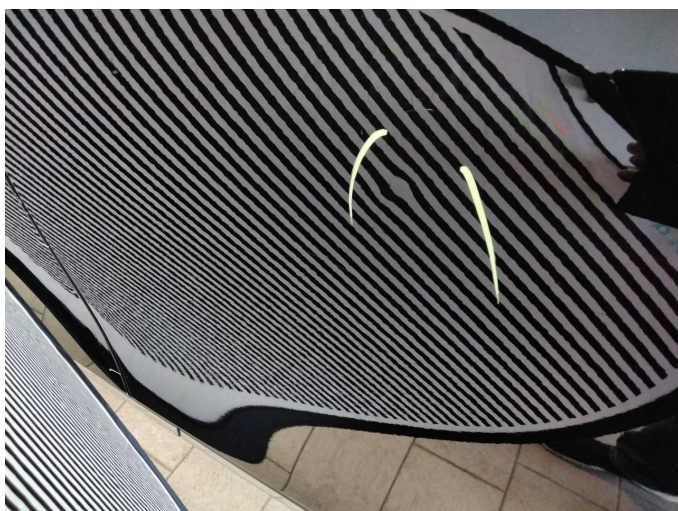

Damage 10: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 10: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 10: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 10: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

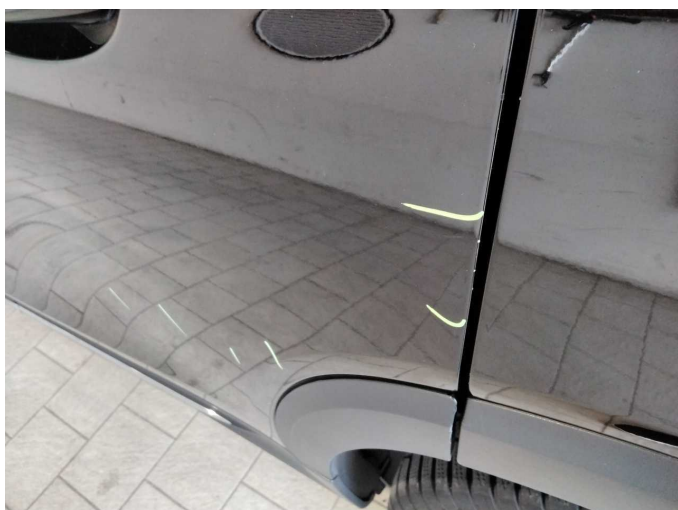

Damage 10: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Bonnet: Bonnet - Scratch(es) - Paint

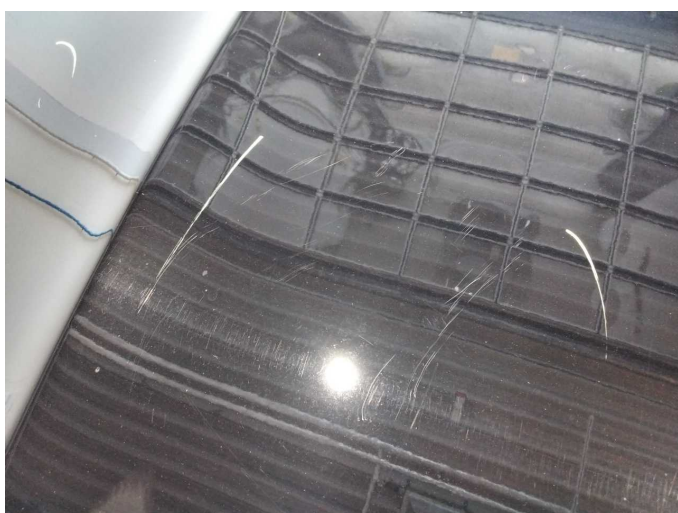

Damage 11: Bonnet: Bonnet - Scratch(es) - Paint




Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Damage 11: Bonnet: Bonnet - Scratch(es) - Paint



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

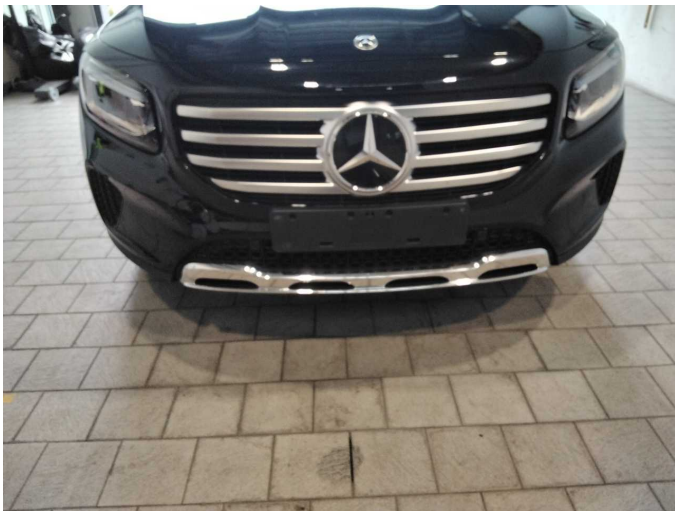

Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M1DB9RW339883

Hersteller / Modell: MERCEDES-BENZ MB GLB 200 d 4Matic 8G-DCT Progressive
Advanced

Datum	KM-Stand	Beschreibung
18.11.2025	43.870	Bremsinspektion vo + hi; Regelwartungsdienst
26.11.2024	22.103	Regelwartungsdienst