

INFORME DE INSPECCIÓN

VEHÍCULO 1503NGN / WBA81GE0007U29046 / 7U29046

Datos vehículo:

Marca:	BMW	Combustible:	DIESEL
Modelo:	120 F70	Transmisión:	NO DETERMINADO
Versión:	120 F70	Color:	NO DETERMINADA
Tapicería:	NO DETERMINADA	Kilómetros:	10.939

Controles específicos:

Llaves principales:	1	Llaves secundarias:	0
Llaves especiales:	0	Tipo transmisión:	Automática
Revisión:	Sin libro		

DOCUMENTACION ORIGINAL

CARPETA MANUALES

MANUAL PROPIETARIO

TUERCA ANTIRROBO

Información neumáticos

1503NGN Neumático	Marca	Medidas	Índice carga	Índice velocidad	Runflat
DD	NEXEN	225/45/18	95	Y	-
DI	NEXEN	225/45/18	95	Y	-
RP					-
TD	NEXEN	225/45/18	95	Y	-
TI	NEXEN	225/45/18	95	Y	-

Datos Inspección:

Tipo Inspección:	COMERCIAL	Ubicación Inspección:	BAL TARRAGONA
Fecha Inspección:	29/04/2026	RaC:	SIXT RENT A CAR
Comentarios:			

Daños no valorables:

1503NGN COMPONENTE	ACCIÓN		COMENTARIO						
1503NGN COMPONENTE	TIPO DAÑO	ACCIÓN	CARROC.	MONTAJE	PINTURA	MAT. PINTURA	RECAMBIO	%DTO	IMPORTE
1. Emblema paragolpes dl - 82 MM - Nueva	-	REEMPLAZAR	0.08 h.			0,00	46,81	10,00	45,20 €
2. Neumático dl iz - BRIDGESTONE LM005 - Nueva	-	REEMPLAZAR	0.50 h.			0,00	123,25	10,00	130,17 €
3. Paragolpes dl	Pintar Reparado Combinada no	DESMONTAR Y MONTAR		1.74 h.	1.92 h.	8,13	0,00		149,04 €
4. Paragolpes tr	Pintar Reparado Combinada no	DESMONTAR Y MONTAR		0.92 h.	1.33 h.	5,63	0,00		92,25 €
5. Rejilla paragolpes dl	-	REPARAR	0.75 h.			0,00	0,00		28,87 €
6. Puerta tr dr	Pintar Reparado Pieza montada	REPARAR	0.20 h.		4.00 h.	16,94	0,00		178,64 €
7. Spoiler paragolpes tr	-	REPARAR	1.50 h.			0,00	0,00		57,75 €
8. Manilla exterior puerta tr dr	-	DESMONTAR Y MONTAR		0.08 h.		0,00	0,00		3,08 €
9. Cejilla ext puerta tr dr	-	DESMONTAR Y MONTAR		0.17 h.		0,00	0,00		6,54 €
10. Luna parabrisas	-	SR Cristales				0,00	0,00		70,00 €
11. Llanta rueda tr dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
12. Aleta dl iz	-	SR Pintura				0,00	0,00		40,00 €
13. Llanta rueda dl iz	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
14. Llanta rueda dl dr	-	PINTURA LLANTA PULIDA				0,00	0,00		150,00 €
TOTAL INSPECCIÓN								(IVA no incluido)	1251,54 €

* Faltantes en color naranja

(IVA no incluido)

1503NGN RESUMEN PERITACIÓN	TIEMPO	EUROS
Total Mano de Obra Carrocero	5,94 h.	228,68 €
Total material pintura	-	30,70 €
Total Mano de Obra Pintura	7,25 h.	279,12 €
Total Recambios	-	153,05 €
Descuento recambios aplicado	-	17,01 €
Total Faltantes	-	0,00 €
Total Smart Repair	-	560,00 €













The digital instrument cluster displays the following information:

- Speedometer:** A needle-style gauge with a scale from 0 to 260 km/h. The current speed is 0 km/h.
- Fuel Gauge:** Located at the bottom left, showing 766 km of range.
- Power Meter:** Located at the top right, showing Power % 100 and a secondary gauge with a value of 75.
- Consumption:** 2.4 l/h.
- Navigation:** A small map icon showing the car's current position.
- Warning Messages:** A blue box at the bottom right displays the message: "Tapa del malet. abierta. Ciérrela, por favor." (Trunk lid open. Please close it).
- Vehicle Status:** A central icon of a white car is shown above the text "Total 10939 km → 10807.3 km".
- Bottom Bar:** Contains icons for parking (P), ABS, engine oil, seatbelts, and a "WARM-UP" indicator.

MEDIA
TEL
NAV









A close-up photograph of a black plastic engine cover. The cover features a circular oil filler cap at the top center. A prominent white decal is centered on the cover, consisting of three horizontal stripes on the left, the word "BMW" in a bold, sans-serif font, and three horizontal stripes on the right. The engine bay is dark, with various hoses, wires, and mechanical components visible around the cover. A white label is attached to a hose on the right side of the engine.

BMW







Power to 100
P
Puerto abierto
+24.8

MEDIA
TEL
NAV

Mis destinos

Búsqueda

CAD-100 12:55

19° SYNC

19° SYNC





NEXEN

5.40







4.46

225/45R18

Continental
ContiSportContact 5















BMW LED

NEXEN













0 1 2 3 4 5 6 7 8 9 10
cm
Manheim
COIL AUTOMOTIVE





0 1 2 3 4 5 6 7 8 9 10
cm
Manheim
City Automotive




P ZERO R18



Manheim
COIL ALUMINUM



Manheim
CO. & ASSOCIATES

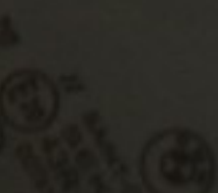



0 1 2 3 4 5 6 7 8 9 10
cm
Manheim
Car Automotive

BMW

E 1303





0 cm 1 2 3 4 5 6 7 8 9 10
Manheim
USA, Made in China