









PEUGEOT 308 SW: GJ-381-HG

Vinnumber:	**VR3FCYHZLNY578157**	Versionname:	**PEUGEOT 308 SW BlueHDi 130 ACTIVE PACK VP [5P] bvm 6-130CH-7cv (break)**
First Registrationdate:	**7/09/2022**	Fiscalpower:	
Expertise Mileage:	**130067**	Power Kw:	**96**
Bodytype:	**Break**	Body colour	**Green**
Gearbox:	**MAN 6 VIT**	Paint type	**Metalic**
Transmission:	**Front**	Interior colour	**Black**
Fueltype:	**Diesel**	Type of rims (mounted)	**Aluminium**
Engine functioning	**Yes**	Dashboard color	**Black**
Battery functioning	**Yes**		
Vehicle running	**Yes**		
Number of doors	**5**		
Number of seats	**5**		
Number head rests	**5**		
Type of rims (mounted)	**Aluminium**		
Category	**Passenger Car**		

Options

Number of keys total	**1**	Radio	
Number keys remote	**1**	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Windows electric R		Rear parking sensors	
Cruise Control		Seat cover lining	**Lining Other**
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	**Autom climate control**		

Tyres

Summer tyres:	**205/55/16/94 V**			
	Fr.L.	**Michelin: 25%**	Fr.R.	**Michelin: 25%**
	Re.L.	**Other: 50%**	Re.R.	**Other: 50%**

Tyre profile depth FL	**6.7**
Tyre profile depth FR	**6.5**
Tyre profile depth RL	**5.0**
Tyre profile depth RR	**4.8**
Tyre size FL	**205/55 R 16 94 V**
Tyre size FR	**205/55 R 16 94 V**
Tyre size RL	**205/55 R 16 94 V**
Tyre size RR	**205/55 R 16 94 V**
Tyre type FL	**All seasons**
Tyre type FR	**All Seasons**
Tyre type RL	**All seasons**
Tyre type RR	**All Seasons**
Tyre make FL	**261**
Tyre make FR	**261**
Tyre make RL	**263**
Tyre make RR	**263**

Assistance equipment

Interior, Stain, Chemical cleaning











Remote ignition key (no insert), Missing, Repair/replace (lump sum)



Alloy rim FL, Scratch(es), Replace




Alloy rim RL, Scratch(es), Repair/replace (lump sum)





Outside rear-view mirror base L, Scratch(es), Replace




Outer door handle FL, Scratch(es), Acceptable




Door FL, Scratch(es), Paint




Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)





Wing RL, Dent(s), Repair and paint (complete)




Roof pillar L, Dent(s), Repair and paint (complete)



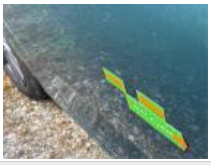

Bumper F, Scratch(es), Paint




Wing RR, Scratch(es), Paint




Door RR, Dent(s), Repair and paint (complete)

Outer door handle FR, Scratch(es), Acceptable




Bumper R, Scratch(es), Paint






Bumper R, Scratch(es), Acceptable




Rear light L, Waterinfiltration, Replace




ALPHABET

Historique Maintenance

Immatriculation: **GJ-381-HG** Date de 1ère immatriculation: **07/09/2022**

Modèle: **Peugeot 308 SW BlueHDi 130 ACTIVE PACK VP [5P] bvm 6-130CH-7cv (break)**

Date	Kilométrage	Fournisseur	Descriptif
24/09/2026	128.289	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS 4 SAISONS
			REMPLACEMENT PNEUS 4 SAISONS
12/05/2026	117.615	SAMA	BALAIS ESSUIE GLACE AV
			SOUFFLET DE CARDAN RPLT
			REVISION
18/11/2025	101.222	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS HIVER
09/09/2025	95.137	SAMA	REVISION
			FILTRE CLIM RPLT
			RECYCLAGE
14/08/2025	93.448	SAMA	DISQUES PLAQUETTES AV RPLT
14/08/2025	92.870	SAMA	EMBRAYAGE RPLT
02/06/2025	88.955	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS ETE
16/12/2024	73.451	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS HIVER
19/09/2024	65.022	SAMA	FILTRE A AIR RPLT
			REVISION
			RECYCLAGE
			REVISION
			FILTRE CLIM RPLT
			LIQUIDE DE FREIN
23/07/2024	59.291	FLEET SOLUTIONS FRANCE	PERMUTATIONS PNEUS
22/03/2024	47.228	SAMA	RECYCLAGE
			BALAI ESSUIE GLACE AR
			BALAIS ESSUIE GLACE AV
27/12/2023	40.023	NORAUTO SAS (PRODUIT SPE)	REMPLACEMENT PNEUS HIVER
01/08/2023	28.531	SAMA	RECYCLAGE
			FILTRE CLIM RPLT
			REVISION
18/07/2023	24.092	NORAUTO SAS (PRODUIT SPE)	REMPLACEMENT PNEUS ETE