



Expertise

Protocol number: 46667291
Order No. / Reference: 26701614
Inspection date: 23 Jul 2026

Manufacturer: Volkswagen

Model: Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

VIN: WVVZZZ3CZME138120



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE	
Vehicle Identification number	WVVZZZ3CZME138120
Mileage (Read)	197,675 km
First registration	8 Jul 2021
Number of holders	1
Next periodical technical inspection	09/2026
(Report on hand)	
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,395 ccm / 4
Power	115 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mangangrau-metallic (B7R)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,300 km
Last service on / at	05/2026 at 191,890 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC390915
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BRZ 00078		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm
2)	215/55 R17 94V	Summer tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	215/55 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Cup holders (2) front
- third brake light
- Headliner in Mistral Grey
- Tachometer
- Parking aid - warning signals for obstacles in the front and rear area
- Automatic headlight control
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 6-speed DSG
- Interior mirror automatically dimming
- Air conditioning system "Air Care Climatronic" with 3-zone temperature control and allergen filter
- Paint finish: Solid
- LED headlights with daytime running lights
- Headlight range control
- Front center armrest, height and length adjustable, with storage box
- Navigation system "Discover Media" incl. "Streaming & Internet"
- Non-smoking version
- Emergency call service
- Package: Light and Sight Package "Plus"
- Proactive occupant protection system in conjunction with "Front Assist"
- Wheels: 4 "Montpellier" alloy wheels 7 J x 17
- Keyless start system without safe locking
- Power steering
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Start-stop system
- Bumpers in body color
- Textile floor mats
- Warning tone and light for unfastened seat belts front and rear
- Airbag, head airbag system for front and rear passengers
- App-Connect Wireless
- Electrically adjustable and heated exterior mirrors, ambient lighting
- Hill start assist
- Chrome trim on the side windows
- black roof rails
- e-Sound
- Entry/warning lights in LED technology in the front doors
- Electronic parking brake including auto-hold function
- Remote release for luggage compartment lid
- Pedestrian detection
- Adjustable luggage compartment floor
- Interior lights with delayed shut-off and dimming function
- ISOFIX mounting points
- Rear headrests (3)
- Front headrests
- LED taillights
- Steering wheel: Multifunction sports steering wheel in leather, with paddle shifters
- "Premium" multifunction display with multicolor screen
- Fatigue detection
- Mains charging cable for household socket
- Mesh partition
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery: Fabric "Weave"
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system (passive)
- Rear bench seat, undivided, backrest asymmetrically split and foldable, with center armrest
- Seat belts: Three-point automatic seat belt
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12V power outlet on the rear of the center console
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer



Extra equipment

- Towbar, foldable (with electric release)
- Anti-theft alarm system (interior monitoring, backup horn and tow-away protection - illuminated make-up mirror in the sun visors, extendable sun visors)
- Luggage net
- Cable for AC charging station (incl. standard mains charging cable for household socket)
- Paint finish: Metallic
- Navigation system "Discover Pro" incl. "Streaming & Internet" (4x20 Watt App-Con. Wireless Digital Cockpit. Operation with proximity sensor. Dual tuner with phase differentiation. DAB. Vehicle menu. Speed. Volume adjustment. Gestures. 32 GB SSD hard drive. Map 2D display. Tone control. 3-way TFT display with touchscreen. MP3. Navigation for Europe. Voice control. Telephone contact. Address. Telephone interface. "Comfort" with inductive charging. 2 USB iPod/iPhone. Traffic sign recognition. "We Connect Plus" incl. "We Connect". Dynamic route guidance. RDS. TMC tuner. Mobile key pre-activation, vehicle via smartphone.)
- Package: "Easy Open & Close" package including safe locking (extendable and removable luggage compartment cover with electric opening - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking)
- Package: Leather package "Vienna" with top comfort seats in the front in conjunction with Business Premium package (seat center panels and inner side bolsters of the front seats and the outer rear seats in leather "Vienna" - top comfort seats in the front - heated front seats - automatically heated windshield washer nozzles)
- Package: Winter
- Panoramic tilt/slide sunroof (with panoramic roof at the rear)
- Keyless locking and starting system "Keyless Access" with safe locking (automatic locking and starting system where the vehicle key must be carried but not handled - if you carry the vehicle key and approach the vehicle, it is automatically unlocked; the engine is conveniently started via a start button)
- Voice control
- Roof rails, silver anodized
- Chassis: Adaptive chassis control DCC including driving profile selection (allows the driver to choose between a comfortable, sporty or normal chassis setting at the touch of a button - reacts continuously to different driving situations and takes braking, steering and acceleration processes into account - body lowered by approx. 10 mm)
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, 1 USB-C charging port in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping system, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Package: Ambient lighting "Plus" (multicoloured ambient lighting - LED entry/warning lights in all doors - interior lights with switch-off delay and dimming function, 2 LED reading lights each in the front and rear)
- Package: Driver Assistance Package "Plus" incl. IQ.LIGHT - LED matrix headlights in conjunction with Business Package (Dynamic Light Assist high beam control, Travel Assist, Lane Assist and Emergency Assist, LED matrix headlights, LED daytime running lights, cornering lights and dynamic turn signals, LED taillights with dynamic turn signals, dynamic headlight range control with dynamic cornering lights, rear fog lights on both sides, reversing lights on both sides, Park Assist including parking aid, Side Assist lane change assistant and Rear Traffic Alert)
- Wheels: Tire Mobility Set omitted
- Rear side windows and rear window tinted
- Seats: ergoComfort seat with 14-way electric adjustment, memory and massage on driver's side in conjunction with Business Package (electrically folding exterior mirrors, auto-dimming on driver's side, ambient lighting and memory - electrically adjustable lumbar support in front, massage function on driver's side - electrically adjustable front seats, ergoComfort seat on driver's side, with memory function and comfort entry)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Sill - left side	Trim - Scratched - Smart repair
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Door - front left side	Door - dent(s) - Smooth repair work
5	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
6	Front structure	Emblem - Broken / torn - Replace
7	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
8	Side panel - rear right side	Elbow - Dent / paintcoat damage - Repair and paint
9	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
10	Front bumper	Front bumper (+ Blende Rechts+links) - Scratched - Paint
11	Headlight	Headlight - right side - Broken / torn - repair according to calculation
12	Rear bumper	Rear bumper - Dent / paintcoat damage - Replace

Wear and tear

No.	Component group	Description
1	Door - front right side	Door - Scratch(es) - No deduction
2	Sill - left side	Sill - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Trim / covers	Rear interior trim - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

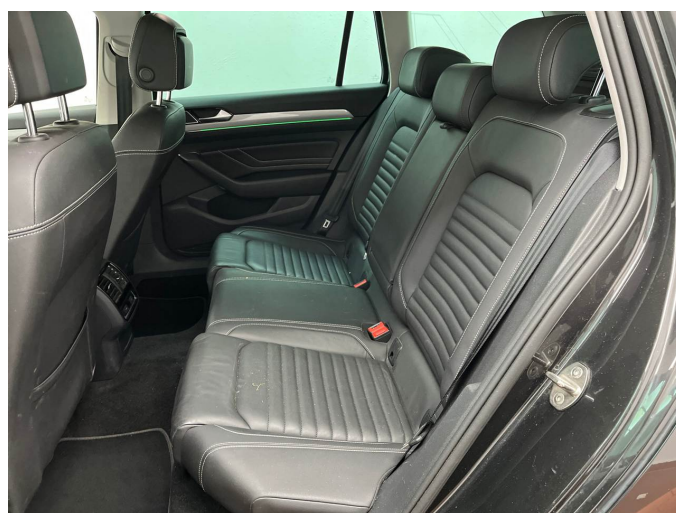


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

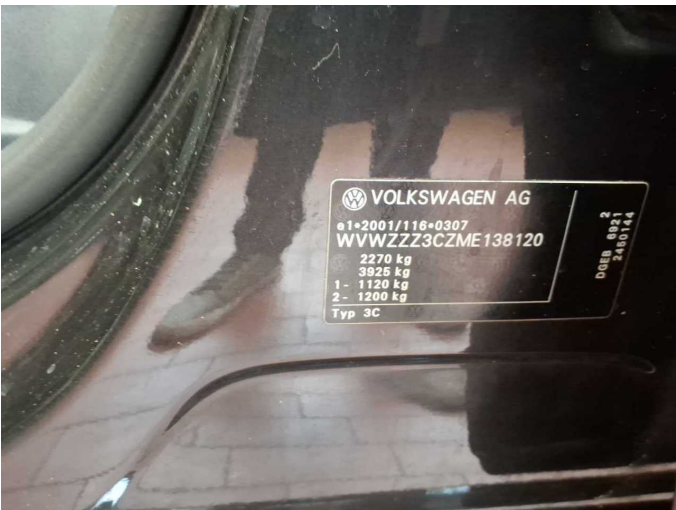


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

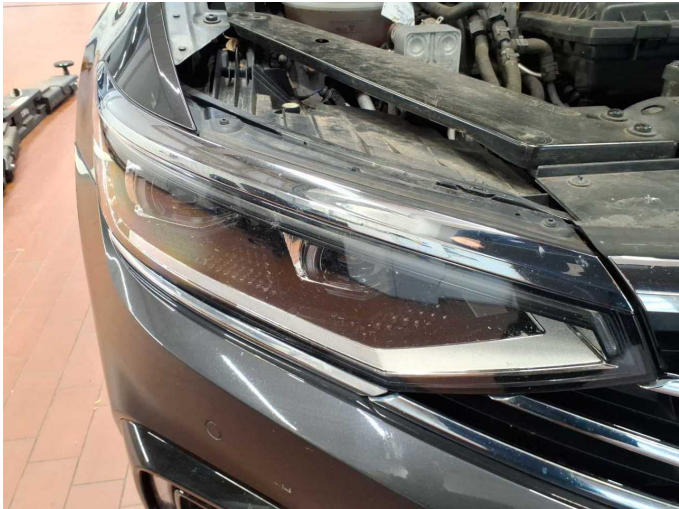


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

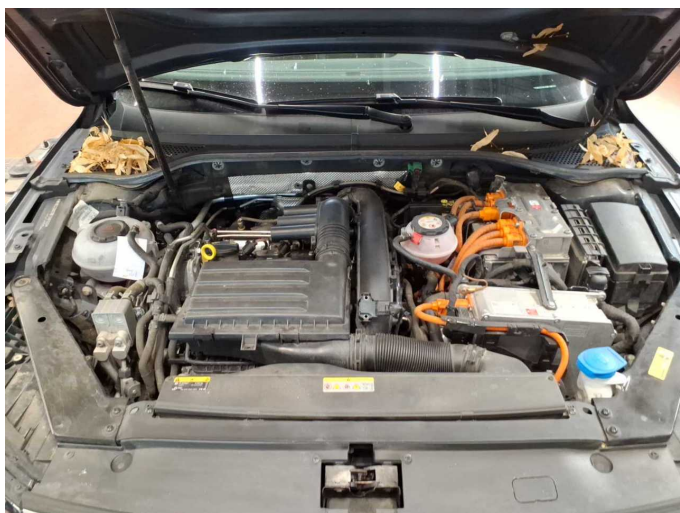


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Sill - left side: Trim - Scratched - Smart repair



Damage 2: Sill - left side: Trim - Scratched - Smart repair




Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door - dent(s) - Smooth repair work

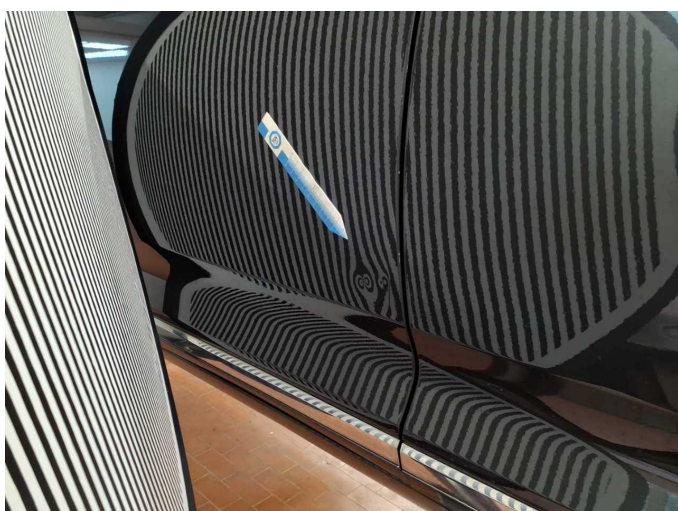

Damage 4: Door - front left side: Door - dent(s) - Smooth repair work

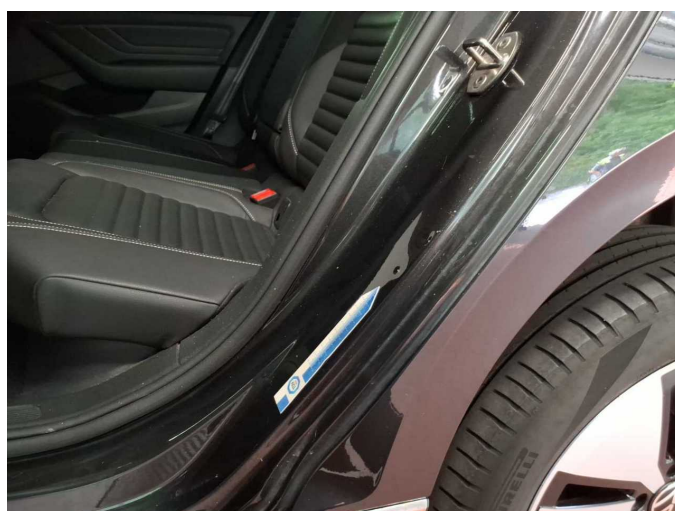

Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Front structure: Emblem - Broken / torn - Replace



Damage 6: Front structure: Emblem - Broken / torn - Replace

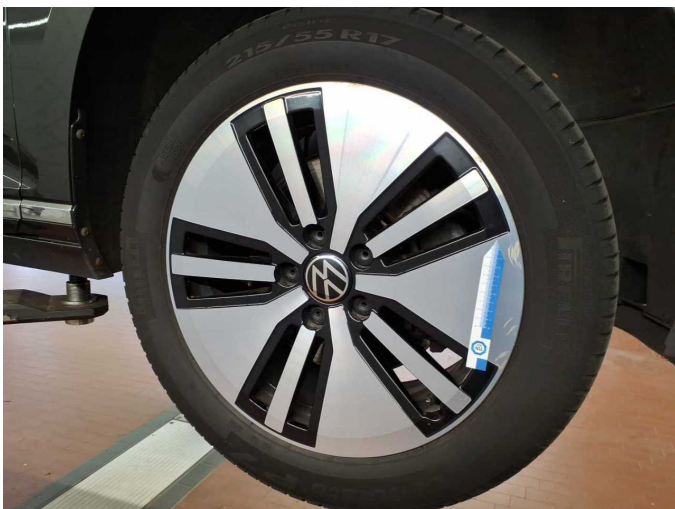

Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 8: Side panel - rear right side: Elbow - Dent / paintcoat damage - Repair and paint




Damage 8: Side panel - rear right side: Elbow - Dent / paintcoat damage - Repair and paint




Damage 8: Side panel - rear right side: Elbow - Dent / paintcoat damage - Repair and paint



Damage 9: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

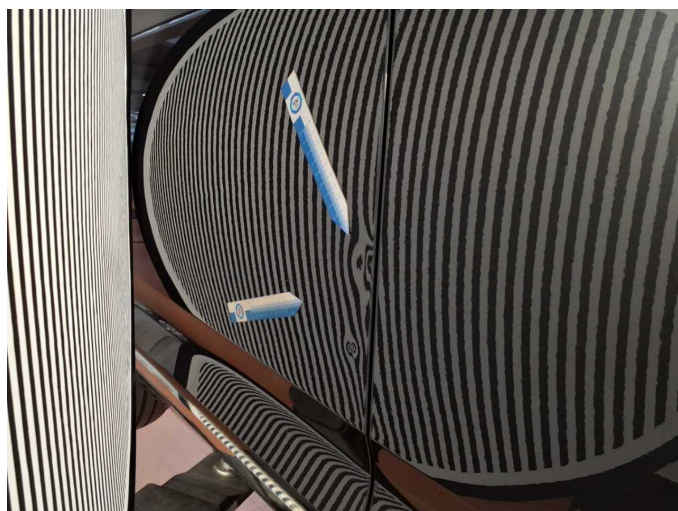


Damage 9: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

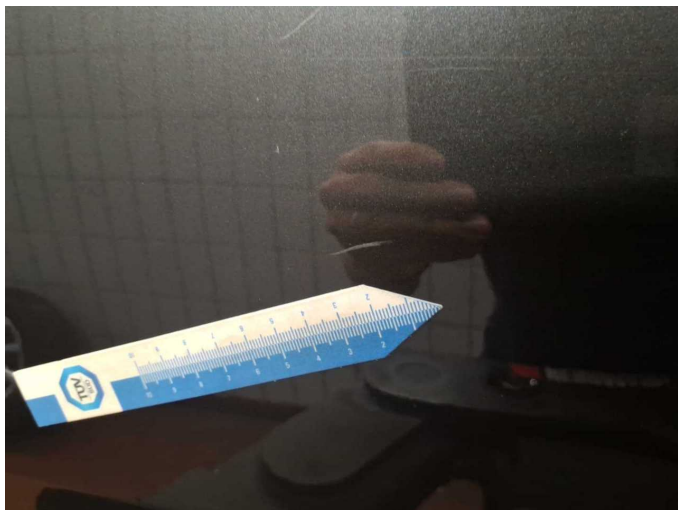

Damage 9: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint

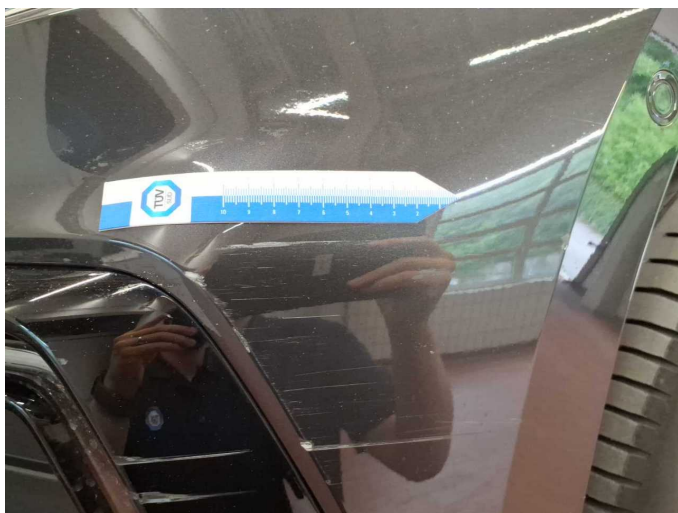

Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint

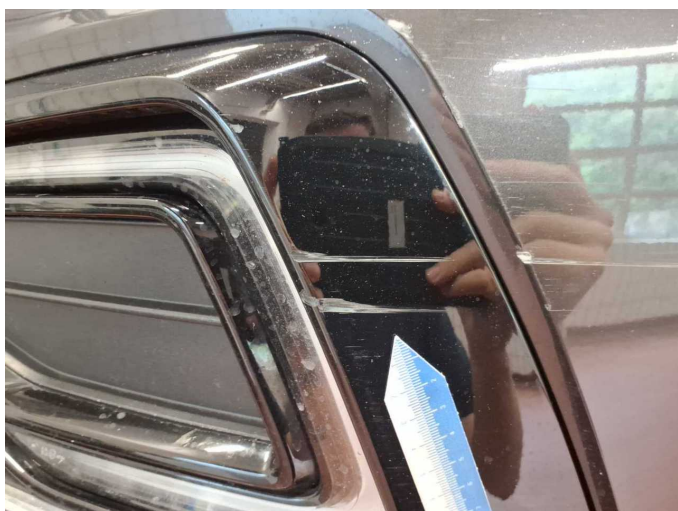

Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint




Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint



Damage 10: Front bumper: Front bumper (+ Blende Rechts+links) - Scratched - Paint

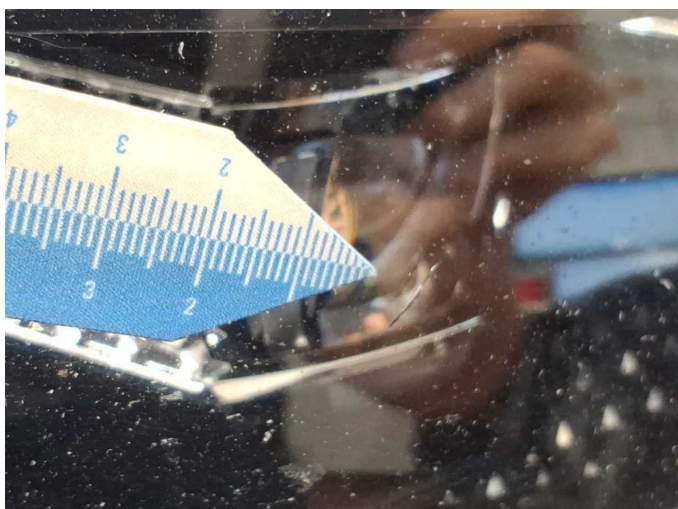

Damage 11: Headlight: Headlight - right side - Broken / torn - repair according to calculation



Damage 11: Headlight: Headlight - right side - Broken / torn - repair according to calculation



Damage 12: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace




Damage 12: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Damage 12: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace




Damage 12: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace

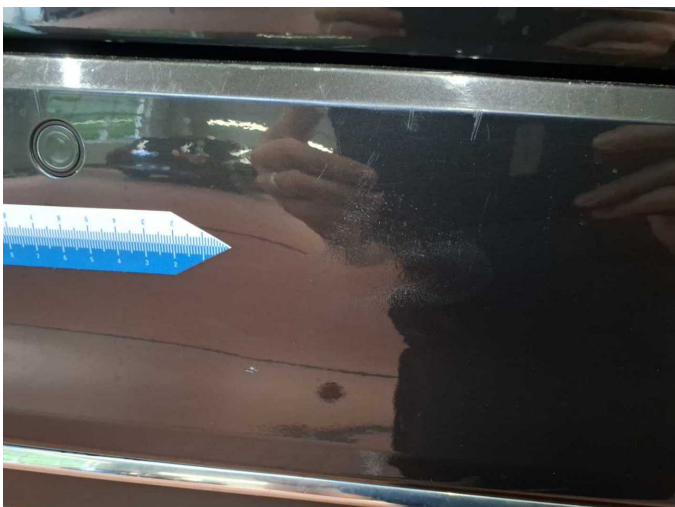

Damage 12: Rear bumper: Rear bumper - Dent / paintcoat damage - Replace



Wear and tear 1: Door - front right side: Door - Scratch(es) - No deduction

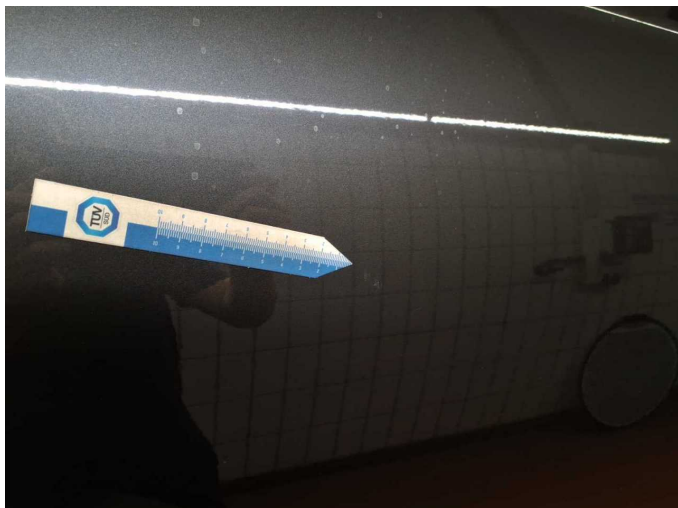


Wear and tear 1: Door - front right side: Door - Scratch(es) - No deduction



Wear and tear 3: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 3: Bonnet: Bonnet - Stone chips - No deduction

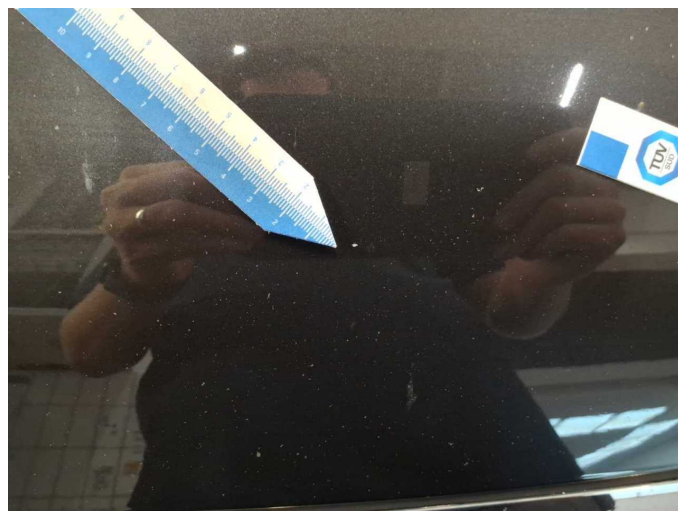

Wear and tear 3: Bonnet: Bonnet - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZ3CZME138120

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

Datum	KM-Stand	Beschreibung
01.07.2026	197.113	Reparatur Sonstiges; Systemtest/Eigendiagnose
22.05.2026	191.890	Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
16.12.2025	172.212	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
09.09.2025	158.655	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.04.2025	140.989	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.11.2024	126.095	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
01.06.2024	108.910	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
26.01.2024	94.538	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.07.2023	75.471	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.03.2023	60.044	Bremsflüssigkeit ern; Bremsscheiben + Klötze h; Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst; Zündkerzen ern
07.11.2022	45.506	Motoröl b. Wartung; Ölwechsel
09.05.2022	29.845	Motoröl b. Wartung; Regelwartungsdienst
17.12.2021	18.190	Motoröl b. Wartung; Ölwechsel