



Expertise

Protocol number: 46357385
Order No. / Reference: 26610950
Inspection date: 3 Jul 2026

Manufacturer: Skoda
VIN: TMBJR7NP5N7039528

Model: Superb Combi 2.0 TDI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG Style	
Vehicle Identification number	TMBJR7NP5N7039528
Mileage (Read)	65,082 km
First registration	9 May 2022
Number of holders	1
Next periodical technical inspection	05/2027
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey-Black
Vehicle with smoke odor	Yes (not ozone-treated)
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	24,400 km
Last service on / at	03/2026 at 59,437 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ907828
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AWB 00325		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,237 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	235/45 R18 94W	Summer tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/55 R16 91V	Summer tyres on Steel	Nexen	6 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Closed storage compartments behind the wheel arches in the trunk, including cargo elements
- Airbag, driver and switchable passenger airbag
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Exterior mirrors and door handles in body color
- Electrically folding exterior mirrors (with boarding lights - interior and exterior mirrors with automatic dimming)
- Hydraulic brake assist (HBA)
- Roof rails, anodized
- Diesel particulate filter and SCR catalyst
- Tachometer
- Dynamic Light Assistant (Masked Continuous High Beam)
- Electric tailgate opening (including boot cover and multifunction storage compartment)
- Electronic Stability Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front footwell lighting
- Cruise control system (cruise control) including speed limiter
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- Heated rear window
- ISOFIX preparation on the outer rear seats, including top tether
- Boot cover, roll-up and removable, semi-automatic
- Front and rear headrests are height-adjustable.
- Metal loading sill protector
- LED taillights in crystal glass look and animated turn signals
- Steering wheel: height and reach adjustable
- Reading lights at the front and rear of the headliner
- Matrix LED headlights (AFS - dynamic high beam assist - automatic headlight range control - headlight cleaning system - LED taillights in crystal glass look - incl. dynamic turn signals)
- Multi-collision brake
- Rear parking sensors
- Radio: Bolero infotainment system (capacitive 8" touch display in glass design - Wireless Smartlink (Apple CarPlay, Android Auto))
- Radio accessories: USB ports at the front (Type-C) and USB charging port (Type-A) in the center armrest
- Tire mobility kit (tire repair spray incl. compressor)
- Electromechanical power steering
- Seats: Heated front seats
- Seats: Adjustable lumbar support in the front seats
- Seats: Electrically adjustable front seats, driver's seat with memory function
- Seats: Electric operation of the front passenger seat from the rear
- Storage compartments (ticket holder on the windshield, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, holder for the warning vests in the front doors, glasses compartment in the headliner, storage compartments in the door panels (front and rear) with 1.5l bottle holders, cup holder in the front center console with easy-open bottle opening, storage pockets on the front seat backrests, storage compartments behind the wheel arches in the trunk including cargo elements, illuminated trunk)
- Illuminated glove compartment
- Hill start assist
- Grey headliner
- Decorative inlay Dark Brushed
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Easy Start (start-stop button instead of ignition lock)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (tunnel light, coming and leaving home function)
- Front radar assist including city emergency braking function (The front radar assist warns of impending collisions and initiates braking to reduce the force of an unavoidable impact. The front radar assist continuously monitors the distance to the vehicle ahead using a radar sensor integrated into the radiator grille.)
- Rear window wiper including windshield washer system
- Child safety lock for rear doors & windows, electric
- Air Care Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter and air-conditioned glove compartment)
- Remote release of the rear seat backrests in the trunk
- Steering wheel: 2-spoke leather steering wheel with multifunction buttons (including gearshift and handbrake levers in leather)
- Rear center armrest with cup holders and pass-through option
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- LED fog lights with integrated cornering lights
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Radio accessories: In-car communication
- Radio accessories: Voice control
- Radio accessories: Wireless SmartLink for Apple CarPlay
- Tire pressure monitoring
- Heated windshield washer nozzles
- Superb safety belts (Height-adjustable three-point front seat belts with belt tensioners - Three three-point rear seat belts - Belt fastening indicator for all seats)
- Seats: electrically adjustable driver's seat with memory function (driver's seat and exterior mirrors with memory function)
- Seats: Height-adjustable front seats



- Seats: Rear seat backrest split 60:40, foldable
- Sun visor on driver and passenger side with illuminated make-up mirror
- Start/stop system including brake energy recuperation
- 12V socket in the trunk
- 12V socket in the center console, front and rear
- Telephone: Convenient hands-free phone system with Bluetooth (without connection to an external antenna)
- Chrome-plated elements (on air vents, light switches, music or navigation systems, air conditioning)
- Immobiliser

Extra equipment

- Driving profile selection including customizable key (Normal, Eco, Sport, Individual) (incl. additional key)
- Luggage net partition
- Front rubber mat set
- Paint finish: Pearl effect
- Radio: Amundsen infotainment system
- Wheels: 16" steel spare wheel including jack (6.5J x 16 ET41, tires 205/55 R16 - wheel bolt wrench - tire mobility kit omitted)

- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Lashing eyes in the trunk
- Central locking with remote control

- Chassis: Sport chassis (15 mm lowering)
- Luggage net partition
- Rear rubber mat set
- Boot mat, plastic, Combi
- Front and rear parking sensors
- Radio: CANTON sound system
- Wheels: 18" Antares alloy wheels (8J x 18" ET 44 with 235/45 R18 tires)
- Keyless entry/start/stop system

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (2. Wartung überzogen)
2	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
3	Roof	Roof rail - left side - Dent / paintcoat damage - Smart repair
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
6	Interior	Interior (Rauch) - Odour - Ozone treatment
7	Steering system	Steering wheel sheath - Scratch(es) - Smart repair
8	Instrument panel	Air nozzle - centre (Hinten) - Broken / torn - Replace
9	Side panel - rear right side	Sill - Scratch(es) - Paint
10	Door - front right side	Door - Scratch(es) - Paint
11	Door - rear right side	Door - Scratch(es) - Paint
12	Side panel - rear right side	Side panel - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction
6	Door - rear left side	Door - Scratch(es) - No deduction
7	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
8	Door - front left side	Door edge - Scratch(es) - Smart repair

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 18 Aug 2025	1.749,94 €
2	Front, Provided by user / customer, from 1 Mar 2023	1.763,14 €
3	Rear, Provided by user / customer, from 28 Jul 2025	3.146,28 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

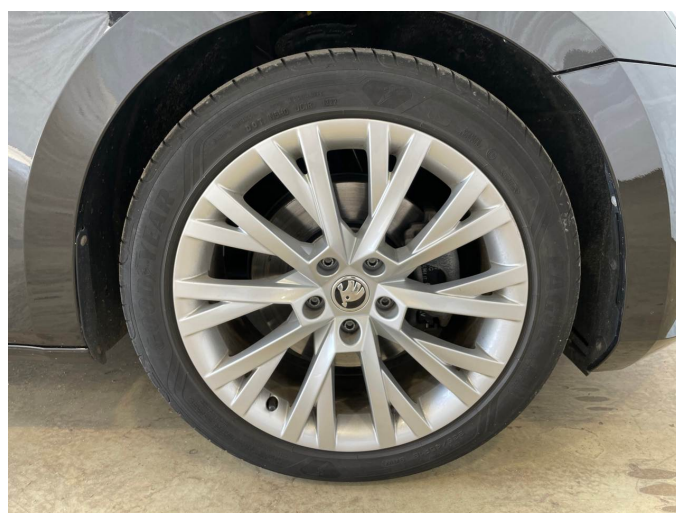


Figure 12: Mounted tyres

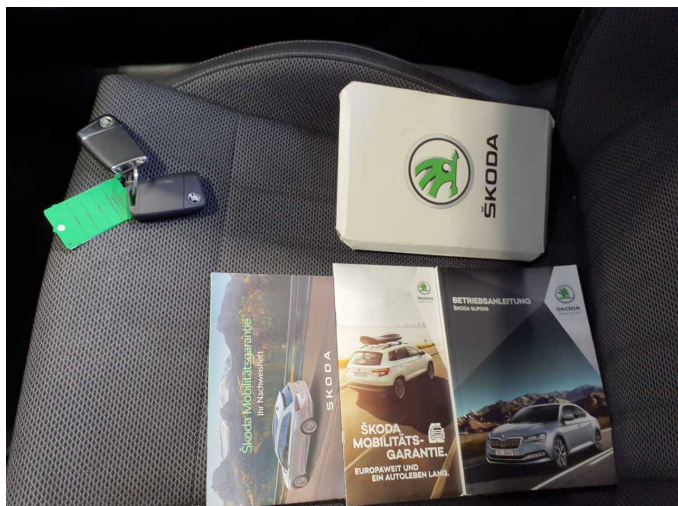


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

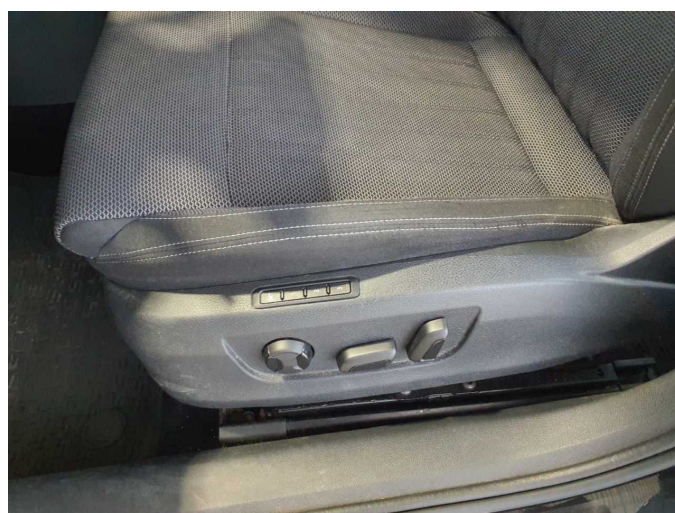


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

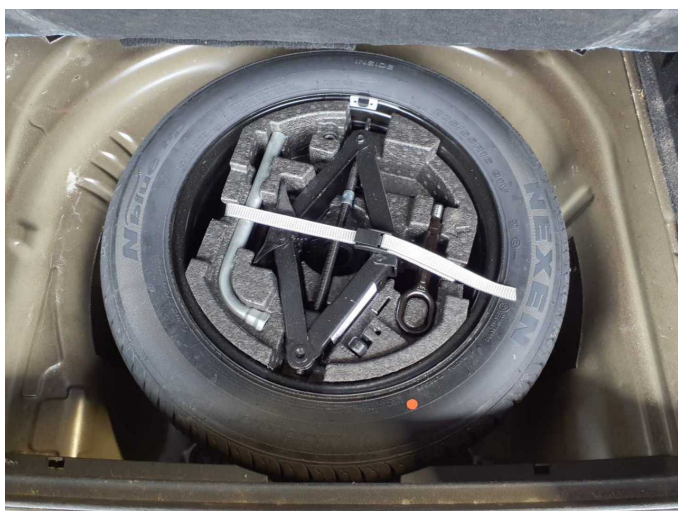


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 3: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair



Damage 3: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair




Damage 3: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair



Damage 3: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair



Damage 3: Roof: Roof rail - left side - Dent / paintcoat damage - Smart repair

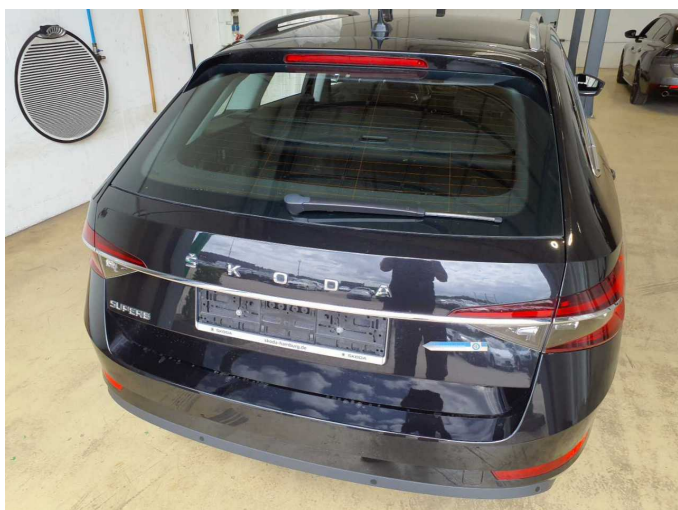


Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 5: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

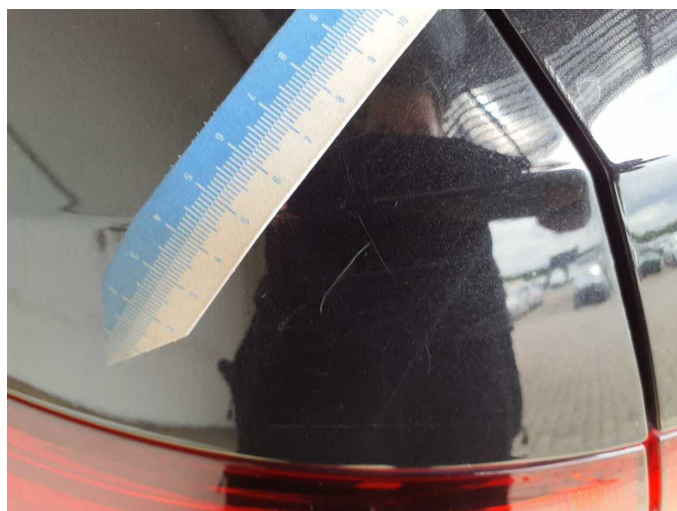

Damage 5: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 7: Steering system: Steering wheel sheath - Scratch(es) - Smart repair




Damage 7: Steering system: Steering wheel sheath - Scratch(es) - Smart repair




Damage 7: Steering system: Steering wheel sheath - Scratch(es) - Smart repair



Damage 7: Steering system: Steering wheel sheath - Scratch(es) - Smart repair

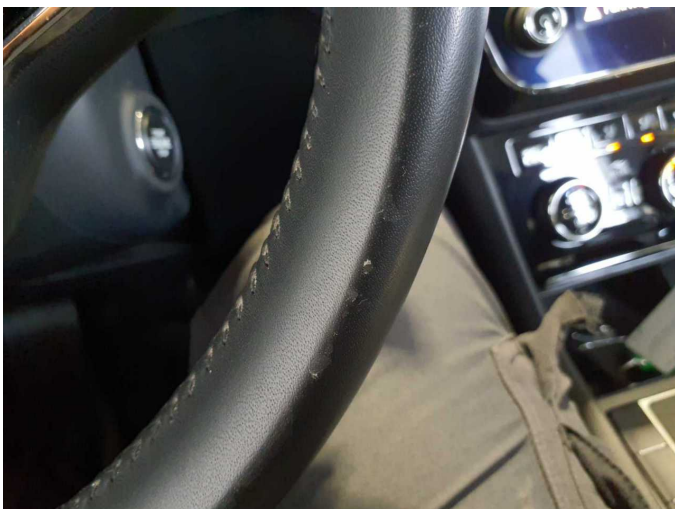


Damage 7: Steering system: Steering wheel sheath - Scratch(es) - Smart repair

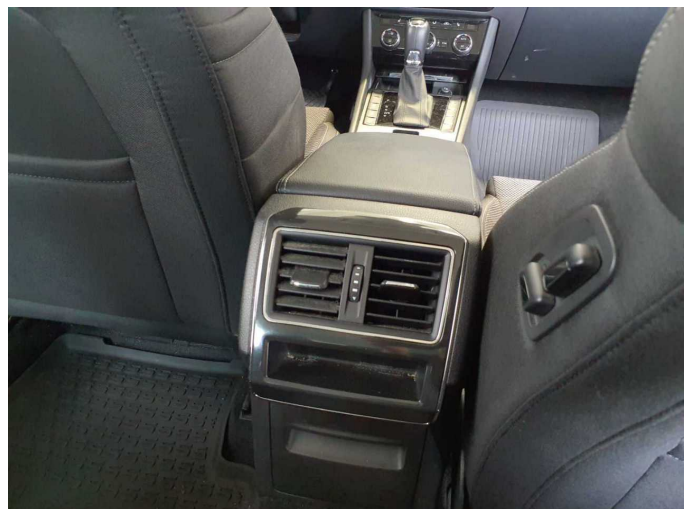

Damage 8: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace



Damage 8: Instrument panel: Air nozzle - centre (Hinten) - Broken / torn - Replace

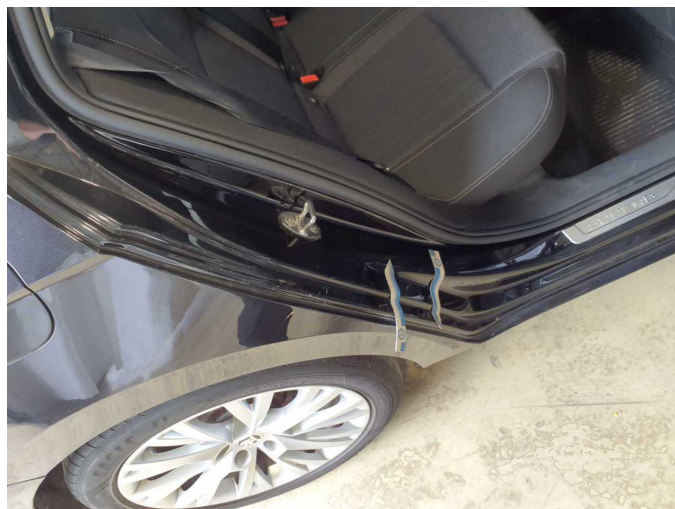


Damage 9: Side panel - rear right side: Sill - Scratch(es) - Paint



Damage 9: Side panel - rear right side: Sill - Scratch(es) - Paint



Damage 9: Side panel - rear right side: Sill - Scratch(es) - Paint

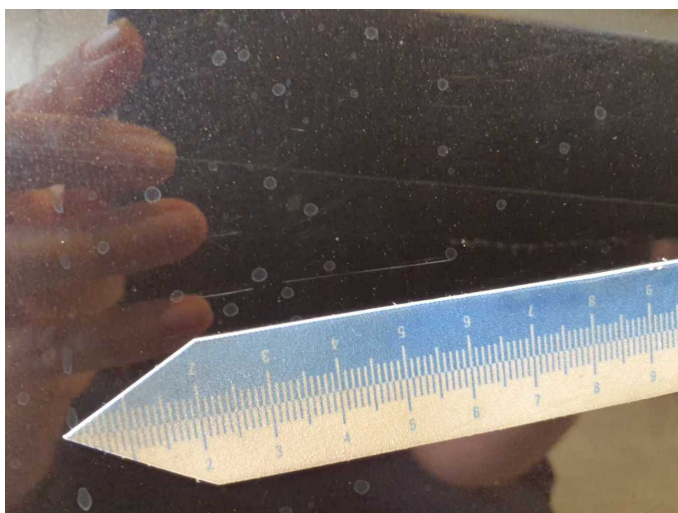

Damage 10: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Door - front right side: Door - Scratch(es) - Paint



Damage 10: Door - front right side: Door - Scratch(es) - Paint



Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 11: Door - rear right side: Door - Scratch(es) - Paint




Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 11: Door - rear right side: Door - Scratch(es) - Paint

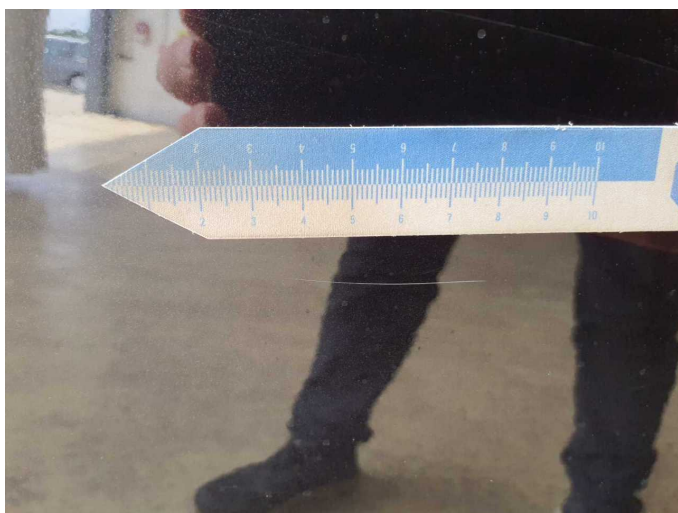

Damage 11: Door - rear right side: Door - Scratch(es) - Paint



Damage 12: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 12: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 12: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 12: Side panel - rear right side: Side panel - Scratch(es) - Paint

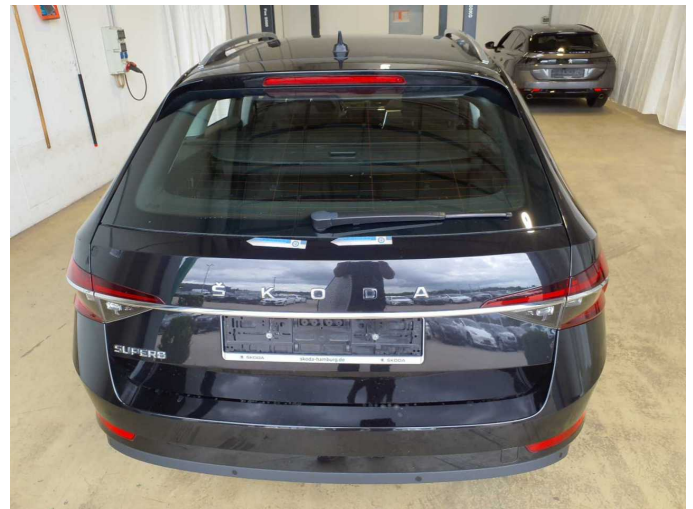

Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

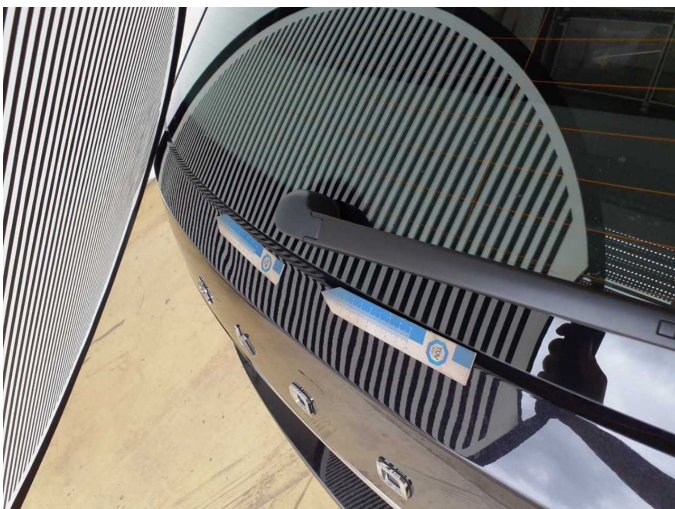

Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Wear and tear 8: Door - front left side: Door edge - Scratch(es) - Smart repair

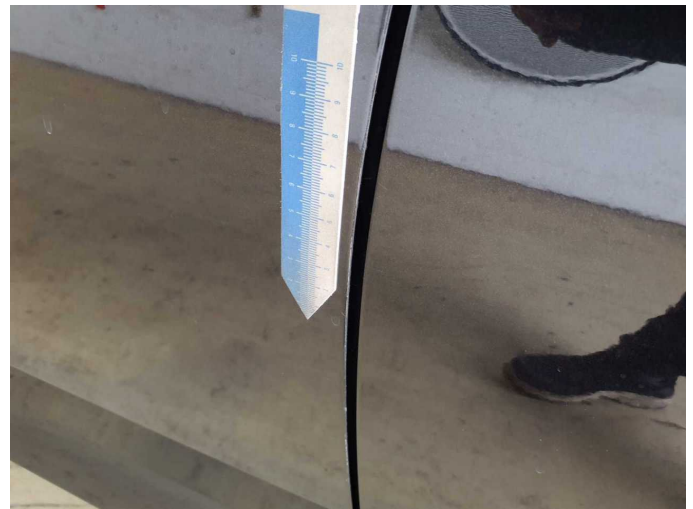

Wear and tear 8: Door - front left side: Door edge - Scratch(es) - Smart repair



Wear and tear 8: Door - front left side: Door edge - Scratch(es) - Smart repair

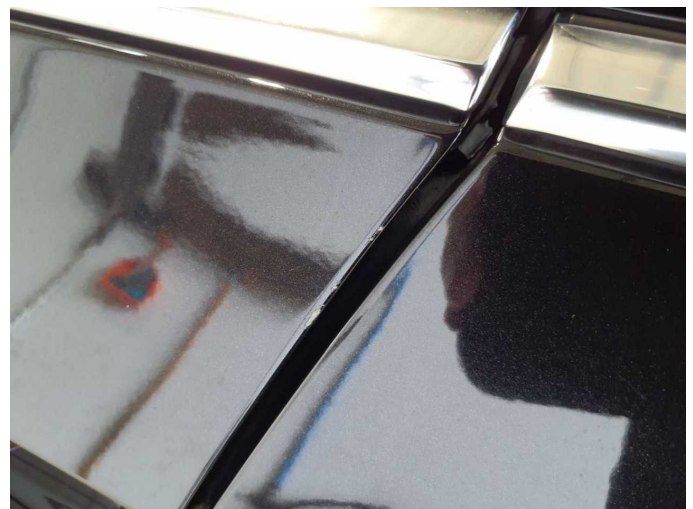

Wear and tear 8: Door - front left side: Door edge - Scratch(es) - Smart repair