DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	VXKUSHNS0 RW027999	Registration date	15/07/2024	Exterior Color	Unknown
Brand	OPEL	Licence Plate	H-DN 125	Odometer	9 899 km
Model	MOKKA 1.2 Turbo 96kW Elegance Auto				


Inspection Details

Arrival Date	14/08/2026	Inspection ID	7127224	Inspection date	25/08/2026
Assign Date	14/08/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys SLC Essen







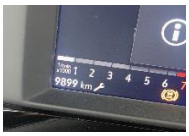





Generic equipment

Removable element

Spare wheel kit	✓
Toolkit	✓
Rear parcel shelf	✓


Technical Document

User manual	✓
Warranty booklet	✓
Log books	✓
Spare key	✓
Key	✓
Remote key	✓
Service	✓

Tyres

Goodyear 215/60/17 V All seasons 7.0 mm

Goodyear 215/60/17 V All seasons 7.0 mm

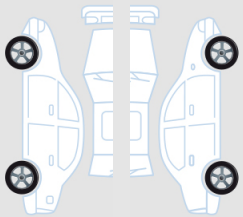

Goodyear 215/60/17 V All seasons 7.0 mm

Goodyear 215/60/17 V All seasons 7.0 mm



Exception / Damage

1



Part	Windscreen	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Stone impact	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	-

2



Part	Bumper	Repair Time	1.60	Part Cost	-
Position	Front	Repair Cost	224.00€	Gross Cost	509.00€
Damages	Scratched	Paint Time	1.90	Depreciation %	15.00%
Severity	-	Paint cost	285.00€	Depreciation	- 76.35
Repair mode	Repair	Flat Rate	-	**Net Cost**	**432.65€**

3



Part	Bonnet	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	45.00€
Damages	Chemical deposit	Paint Time	0.30	Depreciation %	-
Severity	-	Paint cost	45.00€	Depreciation	-
Repair mode	Polishing	Flat Rate	45.00€	**Net Cost**	**45.00€**

4



Part	Unpainted bumper	Repair Time	-	Part Cost	-
Position	Down front right	Repair Cost	-	Gross Cost	75.00€
Damages	Scratched	Paint Time	0.50	Depreciation %	-
Severity	-	Paint cost	75.00€	Depreciation	-
Repair mode	Polishing	Flat Rate	75.00€	**Net Cost**	**75.00€**

5



Part	Door	Repair Time	0.50	Part Cost	-
Position	Front left	Repair Cost	70.00€	Gross Cost	70.00€
Damages	Dented	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Smart Repair	Flat Rate	70.00€	**Net Cost**	**70.00€**

6



Part	Service 2	Repair Time	-	Part Cost	250.00€
Position	-	Repair Cost	-	Gross Cost	250.00€
Damages	Missing	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**250.00€**

7

Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	195.00€
Damages	-	Paint Time	1.30	Depreciation %	15.00%
Severity	-	Paint cost	195.00€	Depreciation	- 29.25
Repair mode	Paintworks	Flat Rate	-	**Net Cost**	**165.75€**

Summary Inspection

Gross Price	1,144.00€	Depreciation	-105.60€	Net Price	1,038.40€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	2.10	294.00€	11.43 %	-33.60€	260.40€
Paintwork	150.00€	2.70	405.00€	10.56 %	-42.75€	362.25€
Paint preparation	150.00€	1.30	195.00€	15.00 %	-29.25€	165.75€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	250.00€	-	-	250.00€
Flat Rate	-250.00€	-	-	-250.00€