



Expertise

Protocol number: 46716509  
Order No. / Reference: 26772539  
Inspection date: 27 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 400e 4Matic 9G-TRONIC

VIN: W1KLF5FB5SA126469



| Vehicle details                         |                                |
|-----------------------------------------|--------------------------------|
| Manufacturer / Type / Model / Equipment |                                |
| Mercedes-Benz E 400e 4Matic 9G-TRONIC   |                                |
| Vehicle Identification number           | W1KLF5FB5SA126469              |
| Mileage (Read)                          | 63,378 km                      |
| First registration                      | 19 Dec 2024                    |
| Number of holders                       | 2                              |
| Next periodical technical inspection    | 12/2027                        |
| (Report not on hand)                    |                                |
| Fuel type                               | Hybr.B/E ext.aufli             |
| Engine displacement / Cylinder          | 1,999 ccm / 4                  |
| Power                                   | 185 kW                         |
| Gearbox / Number of gears               | Automatic / 9                  |
| Type of drive                           | All-wheel drive                |
| Type of vehicle                         | Saloon car                     |
| Colour / colour code                    | OBSIDIANSCHWARZ - METALLICLACK |
| Doors / Seats                           | 4 / 5                          |
| Upholstery type                         | Leather                        |
| Colour of upholstery                    | Brown-Anthracite               |
| Vehicle with smoke odor                 | no                             |



| Vehicle details                              |                                     |                         |                                                            |
|----------------------------------------------|-------------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | digital evidence / incomplete       | Next maintenance in     | 16,333 km                                                  |
| Last service on / at                         | 04/2026 at 54,711 km                |                         |                                                            |
| Key is / should be                           | 2 / 2                               | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                                     | Letter No.              | HG341306                                                   |
| Previous damage / Accident                   | Detectable                          | Repainting              | Detectable                                                 |
| Inspection conditions                        | sufficient                          | Lifting equipment / pit | yes                                                        |
| Test drive                                   | short drive on the company premises | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 2222 / BNK 00109                    |                         |                                                            |
| Emission standard                            | EURO6                               | fine dust sticker       |                                                            |
| Permitted total weight                       | 2,830 kg                            | Empty weight            |                                                            |

## Tyres

| Mounted tyres |                 |                             |              |             |
|---------------|-----------------|-----------------------------|--------------|-------------|
| #             | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
| 1)            | 245/40 R20 99Y  | Summer tyres on Light alloy | Michelin     | 5mm / 5mm   |
| 2)            | 275/35 R20 102Y | Summer tyres on Light alloy | Michelin     | 5mm / 5mm   |
| Replacement   |                 |                             |              |             |
| Typ           | Tyre size       | Type of tyre                | Manufacturer | Tread depth |
|               | Tirefit         | Expiration date 01/2030     |              |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

## Equipment

### Standard equipment

- ABS - Anti-lock braking system with electronic brake-force distribution (EBD)
- Airbag: Automatic passenger airbag deactivation
- Airbag: Center airbag
- Airbag: Windowbag for driver, front passenger and rear passengers
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Electrically folding exterior mirrors
- Third brake light
- Driver display
- Electric windows (4-way)
- Fingerprint scanner
- Pedestrian protection
- Transmission: 9-speed automatic, 9G-TRONIC
- Interior and exterior mirrors automatically dimming
- KEYLESS-GO with flush-mounted door handles
- Paint finish: Solid
- Charging cable for wallbox and public charging station, 5m, smooth, 11kW
- Mercedes-Benz emergency call system
- Navigation: MBUX Navigation Premium
- Package: AVANTGARDE Exterior
- Package: USB
- PRE-SAFE system
- Radio accessories: Digital radio (DAB)
- Radio accessories: Pre-installation for MBUX Entertainment
- Remote Services Premium
- Wheels: 48.3 cm (19") light alloy wheels with partial cover in a 10-spoke design
- Heated seats for driver and front passenger
- Phone accessory: Android Auto
- Phone accessories: Wireless charging system for mobile devices at the front
- Blind Spot Assist
- Traffic Sign Assistant
- Pre-installation for remote and navigation services
- Electronic immobilizer
- Decorative elements, wood, ash, black, open-pore
- Adaptive Highbeam Assist
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Side airbag for driver and front passenger
- Active Distance Assist DISTRONIC
- Active Parking Assist with PARKTRONIC
- Ambient lighting plus
- Automatically dimming exterior and interior mirrors
- Tachometer
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis with selective damping system
- Rear seat belt status indicator in the instrument cluster
- Velour floor mats
- Heated rear window with timer
- Interior headliner in nevagrau fabric
- THERMATIC automatic climate control
- Charging cable for household socket, 5m, smooth
- Charging system: AC charging system 11kW
- LED High Performance Headlights
- Center console wood ash black open pore
- Package: AVANTGARDE Advanced Plus
- Package: AVANTGARDE Interior
- Upholstery: ARTICO man-made leather/Ljusdal fabric
- Radio: MBUX multimedia system Premium
- Radio accessory: Communication module (5G) for using Mercedes me connect
- Tire pressure monitoring system (TPMS)
- Remote and Charging Services Plus
- Rear view camera
- Seats: Rear seat backrests foldable
- Lane Keeping Assist, active
- Phone accessories: Apple CarPlay
- Phone accessories: Smartphone integration
- TIREFIT
- Ambient lighting with projection of the brand logo
- Pre-installation for digital key handover
- High-visibility vest for drivers
- Central display with 14.4" screen diagonal



## Extra equipment

- Black fabric headliner
- Charging system: Direct current charging system (DC charging) (For optimal charging speed with a maximum of 55 kW and therefore high convenience. Fast charging stations such as IONITY supply the direct current required for your high-voltage battery. Thus, the direct current charging system provides the best possible electric range in the shortest possible time.)
- Package: AMG Line Exterior (radiator grille with central Mercedes star, hood with power domes, AMG styling with AMG front apron in A-wing design, including large air intakes and front splitter as well as chrome trim strips at the front, chrome inserts in the side sills, AMG rear apron, including diffuser look in black and trapezoidal tailpipe trims in chrome, beltline and window line trim strip in chrome, 48.3 cm (19") AMG light alloy wheels in 5-twin-spoke design, larger brake discs at the front)
- Package: AMG Line Premium Plus (AMG Line Premium - DIGITAL LIGHT with projection function - Adaptive Highbeam Assist Plus - Illuminated radiator grille - Panoramic sliding sunroof - Head-up display - MBUX Interior Assistant - THERMOTRONIC automatic climate control - 3D driver display - ENERGIZING Package)
- Package: Leather package (leather seat covers - instrument panel and door sills in ARTICO man-made leather in Nappa look - seat climate control for driver and front passenger)
- Upholstery: Leather
- Radio accessories: Burmester surround sound system (4 exciters (body sound transducers), 2 each in the backrests of the front seats - Dolby Atmos technology, for compatible audio formats - 15 amplifier channels with a total system output of 730 watts - 17 premium speakers including speaker units in the headliner - sound personalization - seat function for sound optimization for individual seat rows - 3 sound profiles: Pure, 3D Sound, Individual - dynamic sound adjustment)
- Heat-insulating dark tinted glass
- Decorative elements in open-pore black ash wood (backlit with Mercedes-Benz pattern)
- Paint finish: Metallic
- Center console in open-pore black ash wood for EXCLUSIVE
- Package: Acoustic Comfort Package (The heat- and sound-insulating acoustic glass offers you first-class acoustic comfort. Together with additional insulation measures, the glass effectively reduces background noise and you enjoy a particularly quiet travel environment)
- Package: AMG Line Interior (Multifunction sports steering wheel in Nappa leather, flattened at the bottom - Steering wheel shift paddles in silver chrome - Sports seats, partially electric - Seat comfort package - Lumbar support - Seat covers in ARTICO man-made leather / MICROCUT microfiber, black - Instrument panel and belt edges in ARTICO man-made leather in Nappa look with decorative stitching - Trim elements in open-pore black ash wood - Center console in open-pore black ash wood - Headliner in black fabric - AMG floor mats - AMG sports pedal assembly in brushed aluminum)
- Package: Driving Assistance Package Plus (Active Speed Limit Assist, Extended Automatic Restart on Motorways, Route-Based Speed Adaptation with Traffic Jam Function, Active Steering Assist, Active Emergency Stop Assist with SOS Function, Emergency Lane Function, Active Brake Assist, Turning and Intersection Function, Traffic Jam Emergency Braking Function, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Function, Pedestrian Warning Function in Zebra Crossing Areas)
- Wheels: 50.8 cm (20") AMG multi-spoke light-alloy wheels (painted black with polished rim flange - with front axle 245/40 R20 on 8.5J x 20 ET35.5 and rear axle 275/35 R20 on 9.5J x 20 ET51)
- Seats: Seat climate control for driver and front passenger (The seat climate control ventilates the front seats, cools them, and thus also regulates humidity. In cooler weather, the seat heating quickly brings the seat surfaces and backrests to a comfortable temperature. You won't want to do without this pleasant seating climate.)

## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | A short maneuvering and shunting exercise was carried out on the company premises.                                                                                           |
| Engine function test | An engine test run was performed.                                                                                                                                            |



## Value reducing factors

| No. | Component group              | Description                                              |
|-----|------------------------------|----------------------------------------------------------|
| 1   | Side panel - rear right side | Side panel - Scratch(es) - Smart repair                  |
| 2   | Rear bumper                  | Rear bumper - Scratch(es) - Smart repair                 |
| 3   | Trim / covers                | Door trim - front left side - Scratch(es) - Smart repair |
| 4   | Wheel / tyres                | Alloy rim - front left side - Scratched - Loss in value  |
| 5   | Wheel / tyres                | Alloy rim - front right side - Scratched - Replace       |
| 6   | Wheel / tyres                | Alloy rim - rear right side - Scratched - Replace        |

## Wear and tear

| No. | Component group      | Description                         |
|-----|----------------------|-------------------------------------|
| 1   | Boot lid / rear door | Boot lid - dent(s) - No deduction   |
| 2   | Bonnet               | Bonnet - Stone chips - No deduction |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Previous damages

| No. | Previous damage                                           | Extent of damage (Net) |
|-----|-----------------------------------------------------------|------------------------|
| 1   | Side - left, Provided by user / customer, from 5 Jun 2025 | 1.599,75 €             |

## Repainting

| No. | Repainting                                                                             |
|-----|----------------------------------------------------------------------------------------|
| 1   | Roof rail - left side, Professionally carried out, Invoice of repair done Non-existent |

## Paint coat thickness measurement

|                       |        |
|-----------------------|--------|
| Roof rail - left side | 171 µm |
|-----------------------|--------|

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

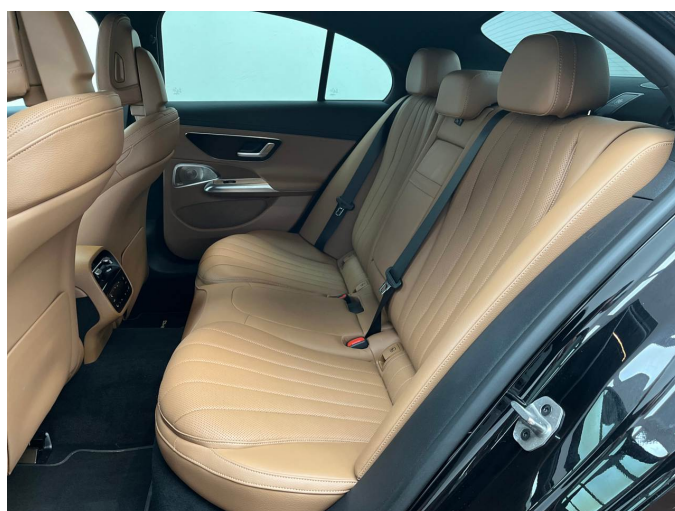


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

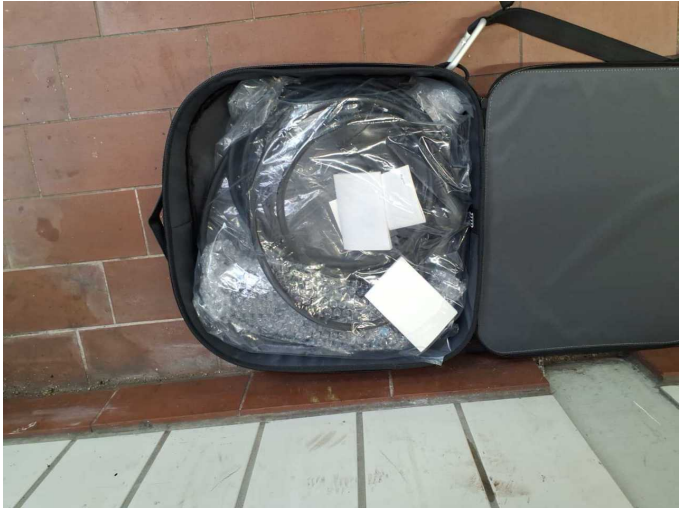


Figure 22: Misc.



Figure 23: Misc.

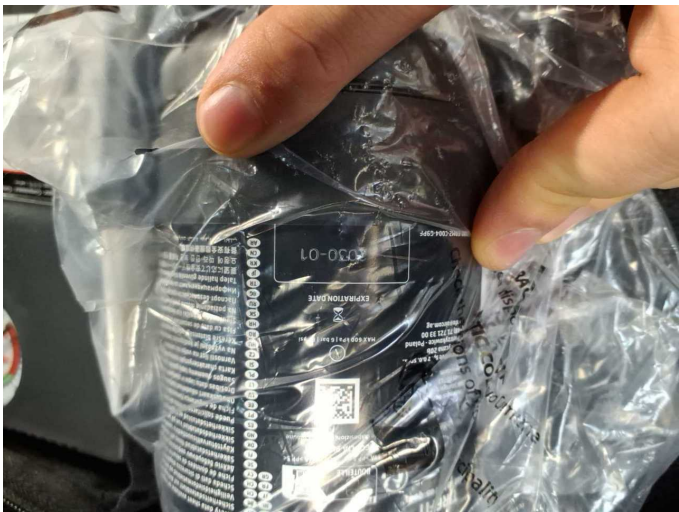


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

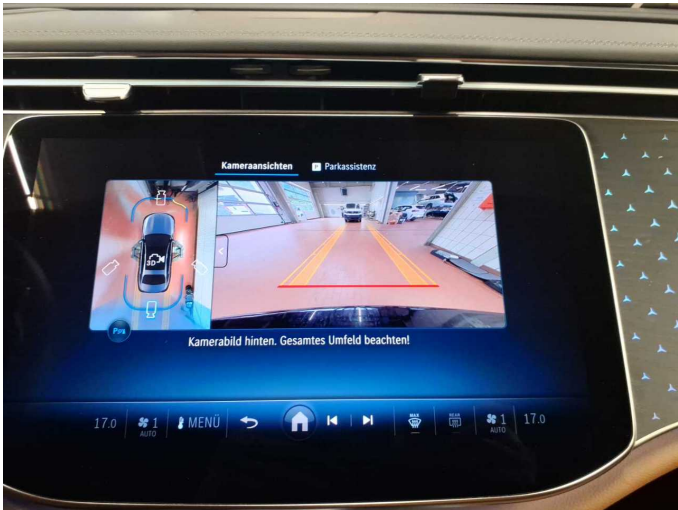


Figure 27: Misc.



Figure 28: Misc.

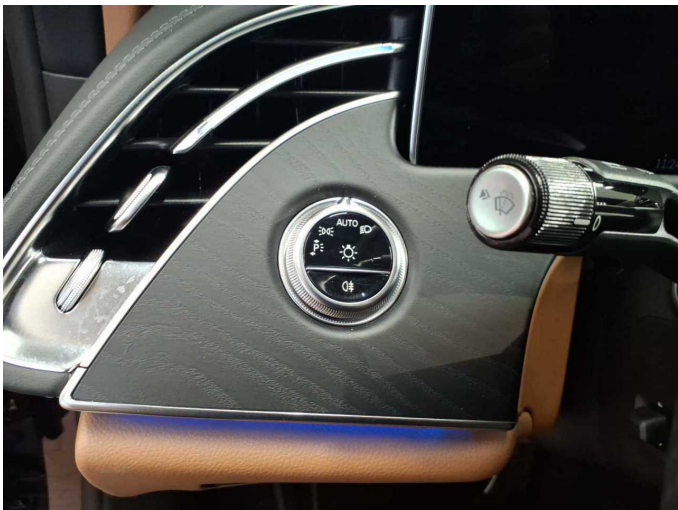


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

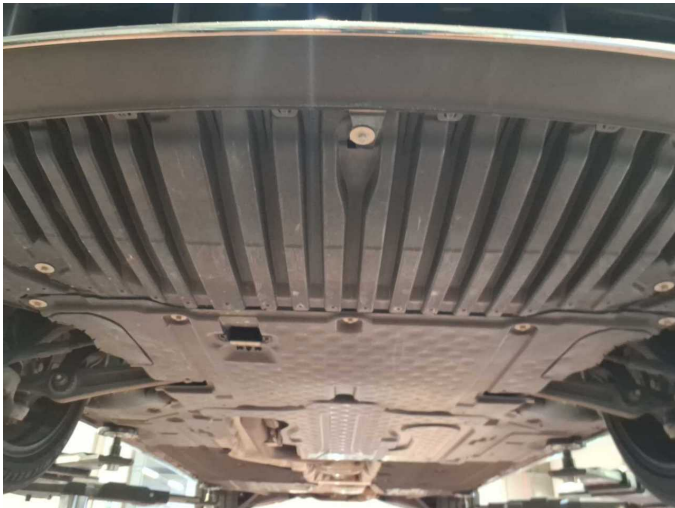


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




**Damage 1:** Side panel - rear right side: Side panel - Scratch(es) - Smart repair



**Damage 1:** Side panel - rear right side: Side panel - Scratch(es) - Smart repair



**Damage 1:** Side panel - rear right side: Side panel - Scratch(es) - Smart repair

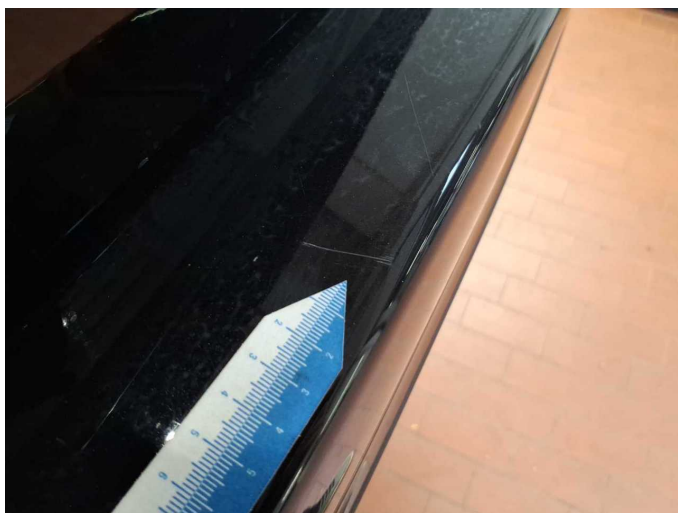

**Damage 2:** Rear bumper: Rear bumper - Scratch(es) - Smart repair



**Damage 2:** Rear bumper: Rear bumper - Scratch(es) - Smart repair



**Damage 3:** Trim / covers: Door trim - front left side - Scratch(es) - Smart repair



**Damage 3:** Trim / covers: Door trim - front left side - Scratch(es) - Smart repair



**Damage 4:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value




**Damage 4:** Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



**Damage 5:** Wheel / tyres: Alloy rim - front right side - Scratched - Replace



**Damage 5:** Wheel / tyres: Alloy rim - front right side - Scratched - Replace

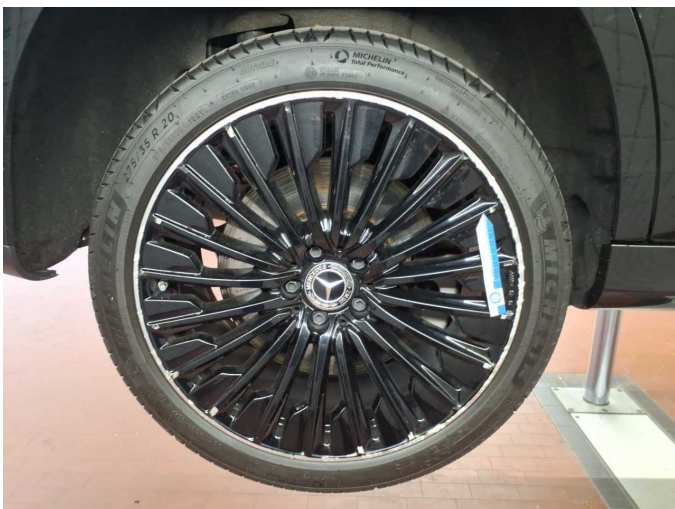

**Damage 6:** Wheel / tyres: Alloy rim - rear right side - Scratched - Replace




**Damage 6:** Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



**Damage 6:** Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction

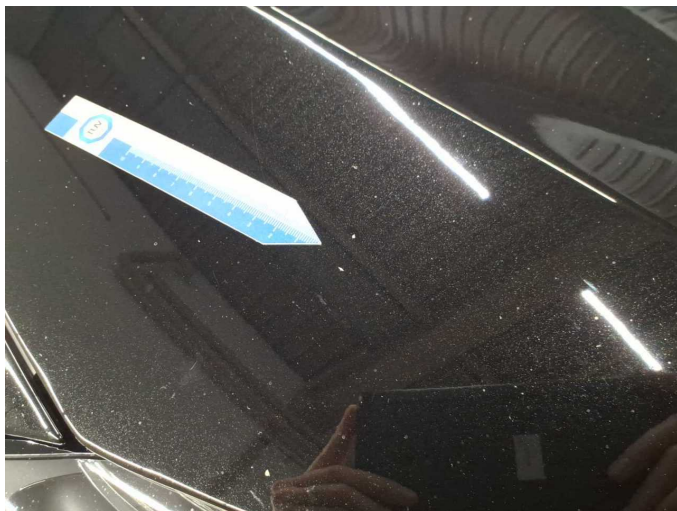

**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction




**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction



**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction



**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction

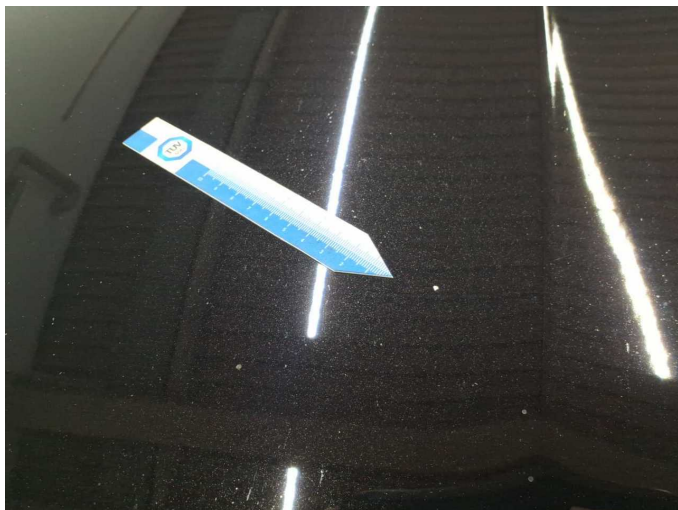

**Wear and tear 2:** Bonnet: Bonnet - Stone chips - No deduction



**Repainting 1:** Roof rail - left side



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KLF5FB5SA126469

Hersteller / Modell: MERCEDES-BENZ MB E 400e 4Matic 9G-TRONIC

| Datum      | KM-Stand | Beschreibung        |
|------------|----------|---------------------|
| 24.04.2026 | 54.711   | Regelwartungsdienst |