



Expertise

Protocol number: 46572926
Order No. / Reference: 26664035
Inspection date: 17 Jul 2026

Manufacturer: Ford

Model: Transit Custom 320 L2H1 VA Trend

VIN: WF01XXTTG1MK26671



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Custom 320 L2H1 VA Trend

Vehicle Identification number WF01XXTTG1MK26671
Mileage (Read) 55,460 km
First registration 7 Dec 2021
Number of holders 1
Next periodical technical inspection 11/2026
(Report not on hand)

Power / Engine displacement 77 kw / 1,995 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Van

Colour / colour code Frost-Weiß
Doors / Seats 5 / 9
Upholstery type Cloth
Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 km
Last service on / at	02/2026 at 51,888 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH383091
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMW 00518		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,190 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Pirelli	6mm / 6mm
2)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Winter tyres on Steel	Goodyear	5mm / 5mm
2)	215/65 R16 109T	Winter tyres on Steel	Goodyear	5mm / 5mm
3)	215/65 R16 109R	Winter tyres on Steel	Pirelli	5mm / 5mm
4)	215/65 R16 106T	Winter tyres on Steel	Hankook	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T	Summer tyres on Steel	Goodyear	6 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- On-board computer
- roof, flat
- Double-leaf rear door (with window), with 90° hinges
- Third brake light
- Windows, 2nd row: Side windows fixed, right and left
- Front electric windows
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Lockable glove compartment with lid
- Front air conditioning
- Adjustable steering column
- Particulate filter: diesel particulate filter
- Tire Pressure Monitoring System (TPMS)
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 tires
- Sliding door entry light automatically illuminates when the door is opened
- Side protection strips
- Seat belts
- Start-stop system
- Power outlet: 12-volt connection
- Doors: Sliding door on the right
- Immobiliser
- Central locking with remote control
- Second key with remote control

Extra equipment

- Washable seat covers for the 1st-3rd row of seats
- Rubber mats for the 1st-3rd row of seats
- Package: Visibility Package II (electrically adjustable and heated exterior mirrors - heated windshield - washer fluid sensor - electrically folding exterior mirrors - rain-sensing wipers - headlight assistant with day/night sensor)
- Reversing camera (reversing camera with image transmission of the rear driving path in the multifunction display and coupling aid)
- Headlight low beam: Bi-xenon headlights with LED daytime running lights (and fog lights with static cornering lights)
- Seats: Seat Package 17A (Custom Trend) (Driver's seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Integrated tray table in the double passenger seat (foldable) - Heated driver's seat - Heated passenger seat (outer seat) - Inner armrest for driver - Manual lumbar support (driver's seat) - Front head/shoulder airbags and side airbags - TREND seat cover: fabric)

- Driver and passenger side airbags
- Exterior mirrors, electrically adjustable and heated
- Rubberized floor surface throughout the entire vehicle up to the D-pillar
- Headliner in driver's cab and passenger compartment
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- Ford Easy Fuel
- Cruise control including leather steering wheel
- Transmission: 6-speed transmission
- Interior lighting front and rear with delay function
- Paint finish: Solid color paint
- Emergency brake assist including emergency brake light
- Wheel trims
- Wheels/Tires: Spare wheel, steel wheel
- Headlights: Halogen projector headlights
- Mud flaps front and rear
- Side windows fixed, second row, right and left
- Power steering
- Seats: 3 seats (single and double seats) in the 2nd and 3rd rows including height-adjustable headrests
- Front bumper painted in body color
- Lashing eyes 4
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric

- Theft alarm system
- Manual DPF regenerator
- Front and rear parking pilot system including fog lights (also with side sensors)
- Radio: Audio System 24: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+, navigation system. (Radio (FM/AM) 8" touchscreen multifunction display (20.32 cm), 6 speakers, FordPass Connect Wi-Fi hotspot, integrated control panel and audio remote control on the steering wheel, Ford SYNC 3 with touchscreen (hands-free system with voice control, SMS readout/sending function, Bluetooth, Emergency Assistance...), AppLink (advanced voice control, privacy mode, Android Auto and Apple CarPlay support, capacitive touchscreen technology,...), dynamic navigation, lane guidance, road map for Western Europe)
- Blind Spot Assist including Cross Traffic Alert (electrically adjustable and heated exterior mirrors, also electrically foldable)
- Transparent protective film for rear bumper
- Heat-insulating glazing, medium tint level of the side window(s) of the 2nd row.



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - front	Lever seat adjustment - Missing - Replace
2	Body	Identification plate - Scratch(es) - Replace
3	Sill - left side	Sill - Scratch(es) - Smart repair
4	Misc.	Inspection / maintenance - Due - Perform
5	Boot lid / rear door	Rear door - right side - Scratch(es) - Paint
6	Boot lid / rear door	Rear door - left side - Dent / paintcoat damage - Repair and paint
7	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint

Missing parts

Description

Documents - Radio / navigation user's manual
Documents - Service book

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 20 Sept 2024	3.318,88 €
2	Rear, Side right, Provided by user / customer, from 14 Oct 2024	8.082,84 €

Accident damages

No. Accident

1 Rear, Side right

Repainting

No. Repainting

1 Door - rear right side, Professionally carried out
2 Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	1,520 µm	Door - rear right side	154 µm
------------------------------	-------------	------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

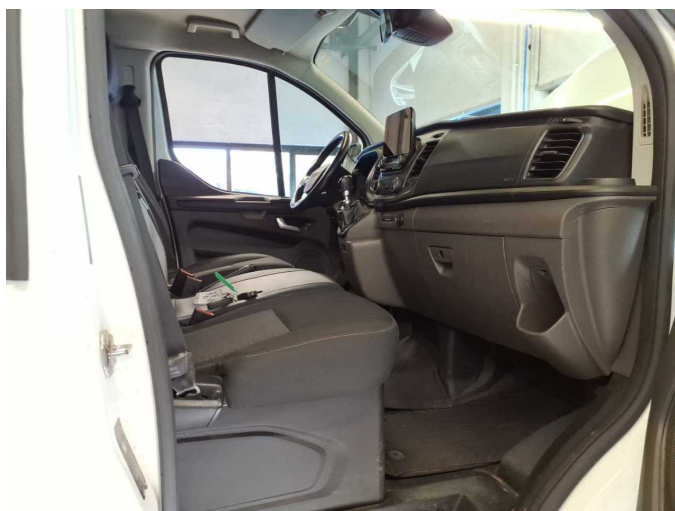


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Mounted tyres

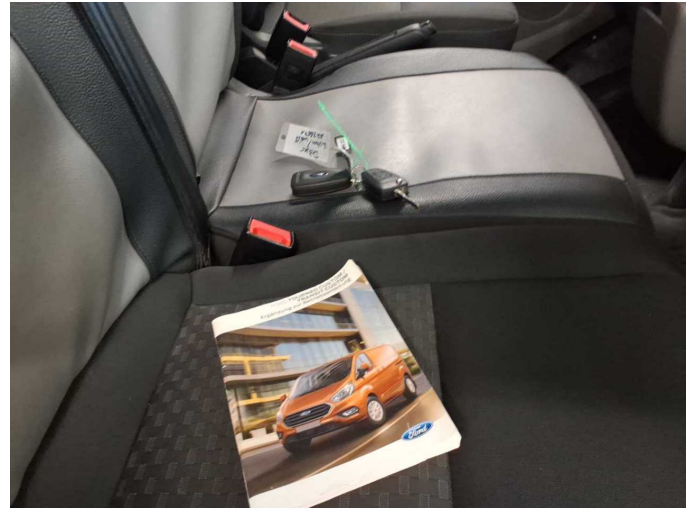


Figure 14: Documents



Figure 15: Additional tyres

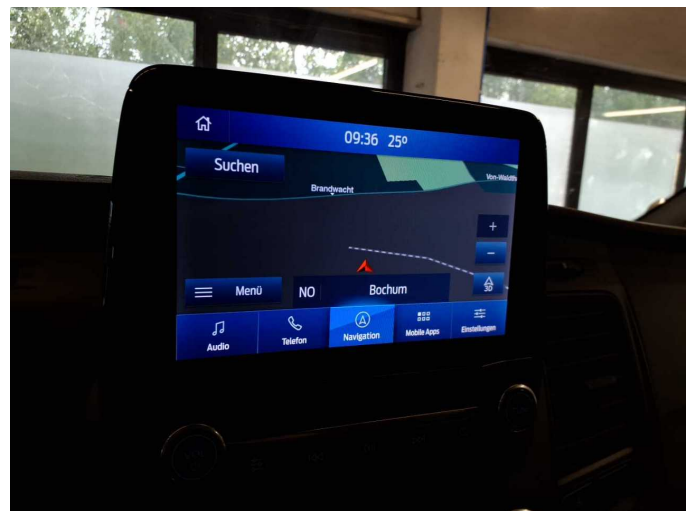


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

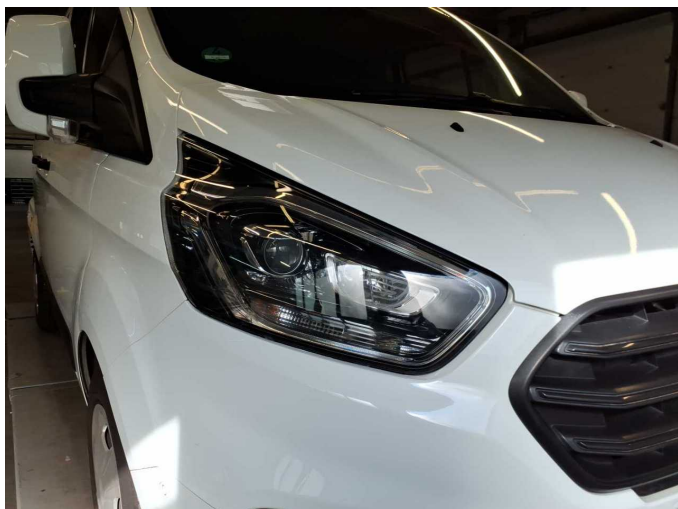


Figure 19: Misc.



Figure 20: Misc.

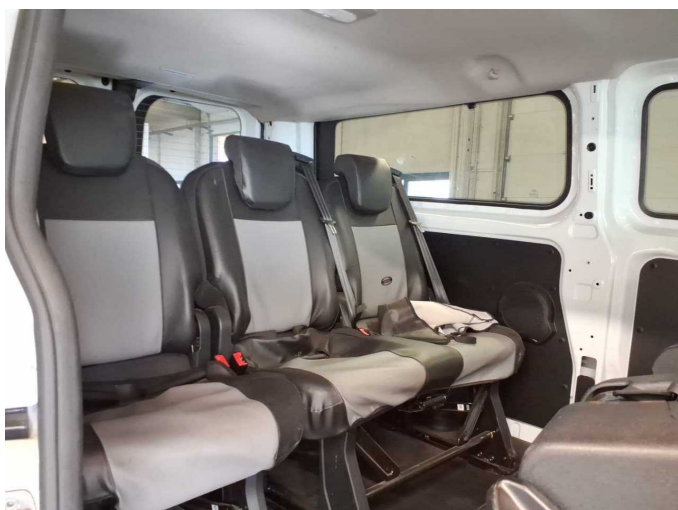


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

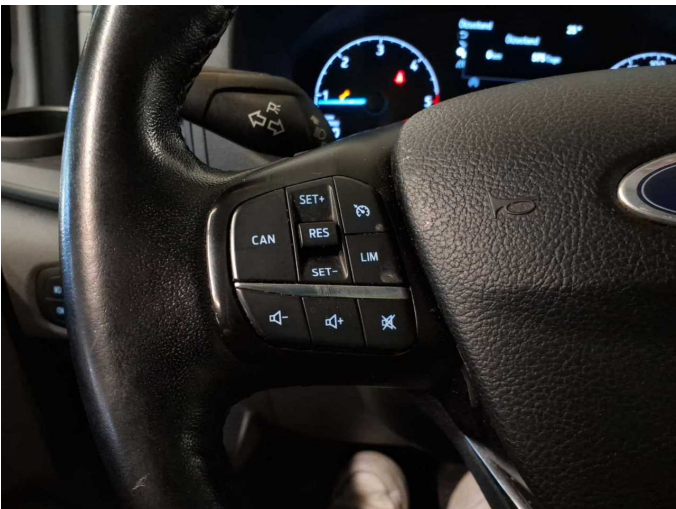


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Seat - front: Lever seat adjustment - Missing - Replace



Damage 2: Body: Identification plate - Scratch(es) - Replace



Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 4: Misc.: Inspection / maintenance - Due - Perform



Damage 5: Boot lid / rear door: Rear door - right side - Scratch(es) - Paint



Damage 5: Boot lid / rear door: Rear door - right side - Scratch(es) - Paint



Damage 5: Boot lid / rear door: Rear door - right side - Scratch(es) - Paint



Damage 6: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 6: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 6: Boot lid / rear door: Rear door - left side - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right




Accident 1: Rear, Side right




Accident 1: Rear, Side right



Accident 1: Rear, Side right

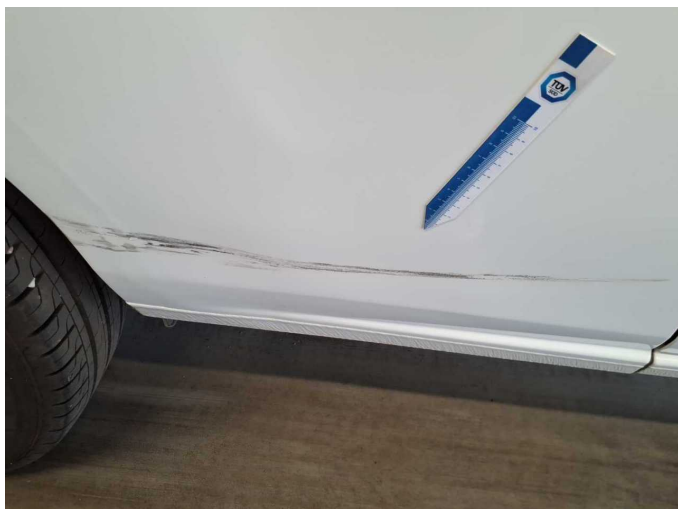


Accident 1: Rear, Side right

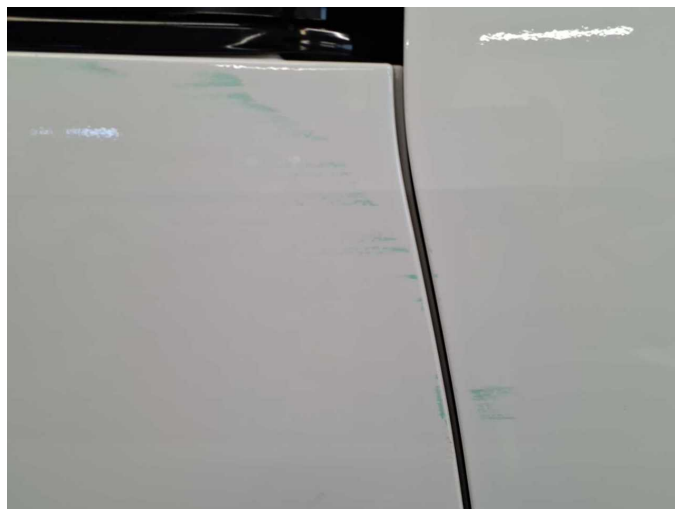

Accident 1: Rear, Side right



Accident 1: Rear, Side right

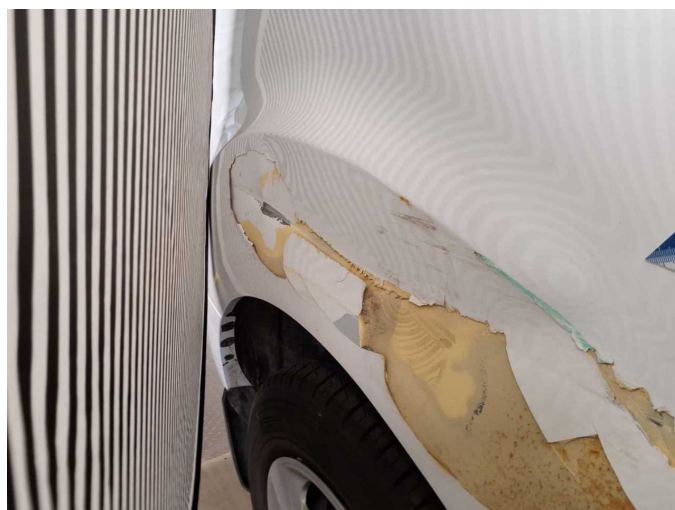

Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Accident 1: Rear, Side right



Repainting 1: Door - rear right side



Repainting 2: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF01XXTTG1MK26671

Hersteller / Modell: FORD FORD Transit Custom 320 L2H1 VA Trend

Datum	KM-Stand	Beschreibung
09.04.2026	53.274	Batterie ern; Systemtest/Eigendiagnose
10.02.2026	51.888	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
04.09.2025	47.905	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.01.2025	42.814	Reparatur Sonstiges
13.11.2024	41.778	AU; Motoröl b. Wartung; Ölwechsel; Systemtest/Eigendiagnose
11.11.2024	41.778	HU + AU
01.10.2024	41.177	Bremsflüssigkeit ern
04.09.2024	40.003	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
03.04.2024	30.565	Systemtest/Eigendiagnose
17.11.2023	30.565	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst
03.08.2023	25.792	Motoröl b. Wartung; Ölfilter ern; Ölwechsel
24.02.2023	17.476	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.11.2022	14.302	Motoröl b. Wartung; Ölwechsel
18.05.2022	4.503	Motoröl b. Wartung; Ölwechsel