



Expertise

Protocol number: 46481289
Order No. / Reference: 26657771
Inspection date: 13 Jul 2026

Manufacturer: Audi

Model: A6 Avant 40 TDI S tronic design

VIN: WAUZZZF24NN055973



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 Avant 40 TDI S tronic design	
Vehicle Identification number	WAUZZZF24NN055973
Mileage (Read)	137,097 km
First registration	9 Jun 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mythossschwarz Metallic (Y9T)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	25 Tag(e)
Last service on / at	01/2026 at 123,591 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ197859
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BSZ 02031		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,330 kg	Empty weight	

Tyres

Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Continental	3mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R17 99H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/60 R17 99H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- AdBlue tank (12 liters) (tank for AdBlue solution for reducing nitrogen oxides in the exhaust gas using an SCR system)
- Anti-lock braking system (ABS)
- Audi connect Navigation & Infotainment (Online Points of Interest, Online Traffic Information, Hazard Information, Weather Information, Access to Calendar, myAudi Navigation, WLAN Hotspot, Online News, On-Street Parking, User Profiles)
- Audi drive select (adjustment of vehicle characteristics in the available modes auto, comfort, dynamic, efficiency, allroad, offroad, individual by adjusting steering assistance, engine characteristics or shift characteristics, dynamic all-wheel steering, damper control, adaptive air suspension, sport differential, ultra technology, adaptive speed assistant, Matrix LED headlights and setting of other optional equipment.)
- Electrically adjustable and heated exterior mirrors (with integrated LED indicator lights, including heated windshield washer nozzles, aspherical mirror glass)
- Exterior mirror housings in body color
- third brake light
- Fabric headliner
- Aluminum roof rails
- Decorative inlays aluminum fragment (for dashboard, door panels and center console; including aluminum-look trim)
- Tachometer
- Electronic Stability Control (ESC)
- Remote key (locks and unlocks the doors, luggage compartment and fuel filler flap. Driving authorization is granted without actively using the key (keyless go). The driver must be in the vehicle and have the key with them. The engine is started and stopped via the engine start/stop button in the center console.)
- Electrically opening and closing tailgate (The tailgate can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the tailgate handle. To close the tailgate: simply press the button on the inside of the tailgate, the button in the driver's door, or the button on the vehicle key. A6 Avant: Opening the tailgate in low-ceiling areas is made easier by a programmable opening angle.)
- Transmission: S tronic 7-speed
- Interior lighting (front and rear roof module, including reading lights (capacitively switched), illuminated vanity mirrors for driver and front passenger, entry lights on the underside of the front doors, front/rear door controls, front storage compartment, glove compartment, front/rear footwell lighting, right/left trunk lighting)
- ISOFIX and Top Tether child seat attachment for the outer rear seats (holding device for the practical attachment of ISOFIX child seats with an additional upper attachment point (Top Tether) on the outer rear seats)
- Airbag for driver and front passenger (full-size airbag, with front passenger airbag deactivation)
- Airbag: Front side airbags and head airbag system (front side airbags integrated into the seatbacks - with additional head airbag system: deploys in front of the side window area and thus protects the front and outer rear passengers in the event of a side impact)
- Audi connect Emergency Call & Service with m.connect Remote & Control (The Audi connect Emergency Call & Service services ensure a safe feeling on every journey. - Emergency call - Online breakdown call - Audi damage service - Audi service appointment online Audi connect Remote & Control: - Vehicle status - Remote locking/unlocking - Parking position - Remote control of auxiliary heating - Push notification of anti-theft alarm system)
- Audi pre sense front (Within system limits, it can warn of impending collisions depending on the situation and speed and initiate appropriate braking. The system is active from approximately 5 km/h. Pedestrians and cyclists can be detected at speeds up to approximately 85 km/h and vehicles at speeds up to 250 km/h: If an impending frontal collision is detected, the system warns the driver visually, audibly, and haptically in a multi-stage process.)
- Diesel particulate filter (DPF) with nitrogen oxide catalyst and AdBlue tank
- Door sill trims with aluminum inlay front and rear (unlit)
- Driver information system with color display (7-inch color display; display content: speed (digital speedometer), time, mileage, outside temperature, fuel warning with remaining range, gear shift recommendation, current radio station or music track, radio and media lists, telephone menu, navigation information and driver assistance system alerts (if available), on-board computer; the integrated efficiency program supports the driver with consumption data overviews and fuel-saving tips for more economical driving, break recommendation)
- Cruise control including speed limiter (The cruise control maintains the desired speed from 20 to 250 km/h by adjusting engine power or by actively applying the brakes, provided engine and braking performance allow. It is operated via a separate steering column stalk, including a display of the set speed in the driver information system. The speed limiter helps to prevent exceeding a preset maximum speed.)
- Interior mirror dimming
- Instrument panel and door trim, two-piece, single/multi-color
- Interior elements in synthetic leather above (instrument panel and door sills in black synthetic leather). Interior elements in synthetic leather above for S line sport package or Audi design selection include: - Instrument panel and door sills in black synthetic leather with contrasting stitching in steel grey.
- Headrests (4) (front ones manually height adjustable)
- Paint finish: Solid



- 2-zone automatic climate control (separate temperature distribution for driver and front passenger side, rear compartment air conditioning via air vents in the rear center console, defroster nozzles for windshield and side windows, combined pollutant and fine dust filter)
- Steering wheel: Double-spoke leather steering wheel with multifunction and paddle shifters (paddle shifters allow manual changing of the driving modes.)
- Steering column, manually adjustable in height and axis
- Front center armrest (adjustable in tilt, movable in length)
- MMI Navigation with MMI touch response (10.1-inch color display (1,540 × 720) additional display of the navigation map or arrow display in the driver information system map update 3D map display efficiency assistant online traffic information MMI search MMI touch response for quick, intuitive operation easy operation of the infotainment system via natural language interaction detailed route information input of up to 10 waypoints selected portfolio Audi connect Navigation & Infotainment)
- Progressive steering (increases driving dynamics and driving comfort through more direct steering response (e.g. on winding country roads or when turning) and reduced steering effort (e.g. when parking and maneuvering); driving characteristics through a steering ratio dependent on the steering angle and speed-dependent steering assistance; various modes, adjustable via Audi drive select)
- Radio accessories: 8 speakers (passive) front and rear
- Rail system with fixing set (loading floor in the luggage compartment with one rail each on the left and right - with four variable lashing eyes which can be variably positioned in the rail system - with tension strap on the right for fixing objects and a net on the left - with two hooks on the right and left)
- Seat covers in Essence/mono.pur 550 fabric combination (for standard seats) (seat center panels in Essence black fabric, seat side bolsters, headrests, front center armrest and door panel inserts in mono.pur 550 black synthetic leather)
- Sun visor on driver and passenger side
- Lane Departure Warning (within system limits, helps prevent unintentional lane departures. If the system is activated and ready, and the driver has not used the turn signal, the Lane Departure Warning helps prevent crossing detected lane markings by making corrective steering interventions. Additional steering wheel vibration can be set at the driver's request. Operating range from approximately 60 to a maximum of 250 km/h)
- Glazing: Windscreen in heat-insulating glazing
- Glazing: Rear window, rear door and side windows in clear glass
- Electronic immobilizer
- Central locking
- LED headlights (The headlights have the following functions: - Daytime running lights - Low beam - High beam - Position lights - Turn signals (incandescent bulb technology) - All-weather lights (to reduce glare in poor visibility conditions) LED taillights - Turn signals, brake lights, tail lights, reversing lights and rear license plate lights (LED technology)
- Ambient lighting package (in addition to the standard interior lighting: - Ambient fabric lighting in the front/rear doors - Pre-view lighting from the front/rear door handles - Ambient lighting of the instrument panel)
- Gloss package (window channel strips in anodized aluminum - B-pillar trim exterior in high-gloss black - rear light trim in chrome)
- Non-smoking package (no ashtray in the front center console, one 12-volt socket each in the front and rear)
- Wheel: Alloy wheels, multi-spoke design (8 J x 18 with tires 225/55 R 18)
- Wheel: Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels - display in the driver information system)
- Wheel: Tire repair kit
- Radio: MMI Radio plus with MMI touch response (10.1-inch color display - driver information system with 7" TFT color display - Audi music interface; 2 USB-C ports with data and charging function - Bluetooth interface (hands-free calling and audio streaming) - separate MMI touch control unit with 8.6" color display including MMI touch response with haptic feedback; for controlling the climate control function and input field for handwriting recognition - AM/FM phase diversity - speed-dependent volume adjustment - DAB+)
- Seats: Standard front seats (with manual adjustment of seat height, seat longitudinal position, backrest angle, headrest height and distance, and seat belt height)
- Seats: Split-folding rear seat backrest Avant (distinctive outer rear seats, visually adapted to the front seats, and an additional central seating option - 3 rear L-shaped headrests, manually height-adjustable - three 3-point seat belts - rear seat backrest split 40:20:40 or fully foldable - one-piece, foldable rear center armrest with storage compartment - with remote backrest release in the boot, removable partition net, to be attached to the body or to the folded-down rear seat backrest)
- Start-stop system (helps reduce fuel consumption and CO2 emissions by switching off the engine during stationary phases, e.g. at traffic lights. For restarting, the starting process is initiated as soon as the foot brake is released. Can be deactivated at any time via a button.)
- Heat-insulating glazing on the sides and rear (green tinted, heated rear window with timer)



Extra equipment

- AdBlue tank with increased filling volume (AdBlue tank with 22 liter filling volume - for diesel vehicles with SCR technology, to reduce nitrogen oxides in the exhaust gas)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb.)
- High beam assist (within the system's limits, it automatically detects oncoming headlights, taillights of other road users, and built-up areas. Depending on the traffic situation, the high beam is automatically switched on or off.)
- Panoramic glass roof (2-piece) (extra-large, tinted glass surface for a progressive design; electric operation for tilting and opening, including an electrically operated, lightproof sunshade; convenient opening and closing from the outside via the remote key ensures a pleasant, light-flooded interior; improved interior climate through efficient ventilation; integrated wind deflector reduces wind noise when the roof is open)
- Seat covers in leather/mono.pur 550 combination (for standard front seats without seat ventilation) (center section of the front seats and the two outer rear seats as well as the driver's side entry bolster in leather; side bolsters, headrests, inner door panel, front center armrest and middle rear seat in mono.pur 550 synthetic leather)
- Telephone: Audi Phone Box (Up to two smartphones can be paired with the vehicle simultaneously via Bluetooth, allowing you to play music through the vehicle or make phone calls from either smartphone. The universal smartphone holder connects to the vehicle's antenna, improving both reception and call quality. The smartphone can also be charged wirelessly using the Qi standard or via USB.)
- Tour Assistance Package (Adaptive Driving Assistant - Adaptive Cruise Control, Speed Limiter - Efficiency Assistant supports the driver in anticipatory and therefore fuel-saving driving - Evasive Steering Assist helps the driver to steer the vehicle around an obstacle in a critical situation - Turning Assist - Emergency Assist - High Beam Assist - Camera-based Traffic Sign Recognition)
- Wheel: Alloy wheels 5-double-arm design (8 J x 18 with tires 225/55 R 18)
- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Deletion of performance/technology lettering
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Paint finish: Metallic
- Parking aid plus with surround view (acoustic and visual parking aid front, side and rear to assist with parking and maneuvering by measuring with 12 ultrasonic sensors. A selective visual display shows the distance to detected objects in the upper display, depending on the current steering angle and the direction of travel. Optionally, activation occurs automatically as soon as the vehicle approaches a detected obstacle at a speed of less than 10 km/h).
- Reversing camera (The reversing camera displays the area behind the vehicle on the upper display. Dynamic display elements such as a steering angle-dependent lane calculation assist with parking or maneuvering.)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Steering wheel: Double-spoke leather steering wheel with multifunction, paddle shifters and steering wheel heating (paddle shifters allow manual gear changes. The steering wheel rim is also heated).
- Swiveling towbar with electric release (with swiveling ball head, trailer stabilization via electronic stability control (ESC), release via button in the luggage compartment, the integrated swiveling system socket allows continuous operation of electrical devices in the trailer or caravan while driving)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Interior	Interior - Soiled - Clean
3	Side panel - rear right side	Sill - Scratch(es) - Smart repair
4	Door - rear left side	Door - Scratch(es) - Smart repair
5	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
6	Side panel - rear left side	Elbow (+ Delle Gebrauchspur) - Scratch(es) - Smart repair
7	Door - front right side	Door - Scratch(es) - Smart repair
8	Engine	Engine - Leaking - Perform diagnosis
9	Wheel / tyres	Tyre - rear left side (nicht fahrbereit) - Broken / torn - Replace
10	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
11	Door - rear right side	Door - Scratch(es) - Smart repair
12	Door - front right side	Door handle - outside - Scratched - Paint
13	Cab	Door rubber seal - left side (Tür vorn links) - Broken / torn - Replace
14	Seat - rear	Seat cover - 3 seater bench (+ Druckstelle Reifen) - Scratch(es) - Replace
15	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
16	Bonnet	Bonnet - Scratch(es) - Paint
17	Vehicle glazing	Windscreen - Broken / torn - repair according to calculation

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Side panel - rear right side	Side panel - dent(s) - No deduction
3	Tail light	Tail lamp - left side - Scratch(es) - No deduction
4	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
5	Side panel - rear left side	Sill - Scratch(es) - No deduction
6	Instrument panel	Centre console - front - Scratch(es) - No deduction
7	Side panel - rear left side	Side panel - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 26 Dec 2023	1.514,29 €
2	Front, Provided by user / customer, from 7 Sept 2024	9.148,87 €



Accident damages

No. Accident

1 Side right

Repainting

No. Repainting

1 Mudguard - left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side

308 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

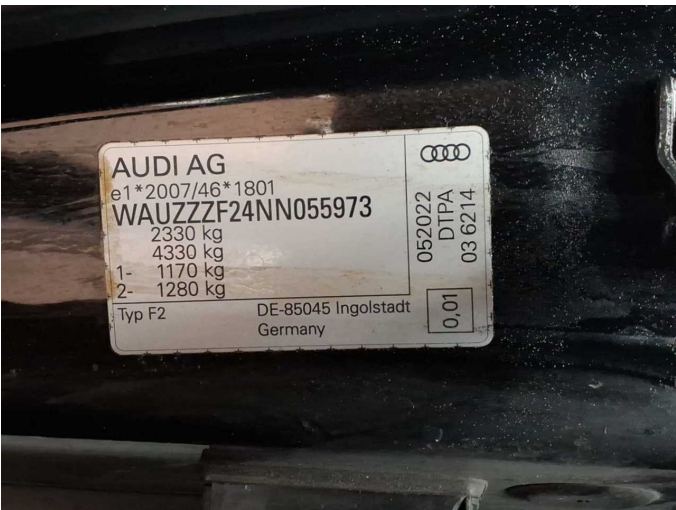


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

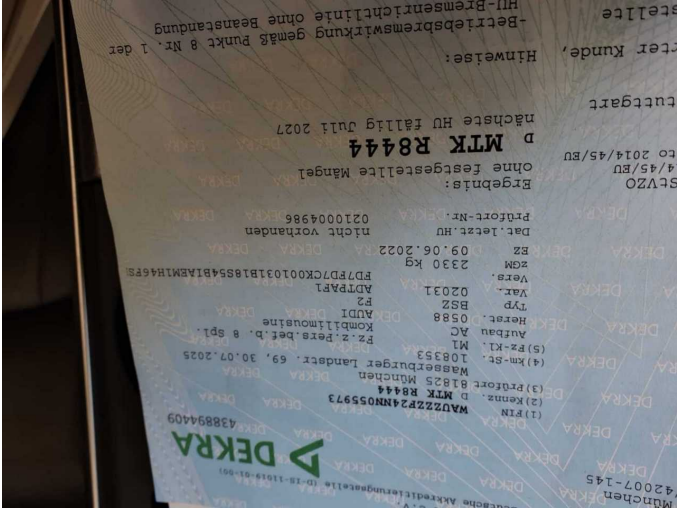


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

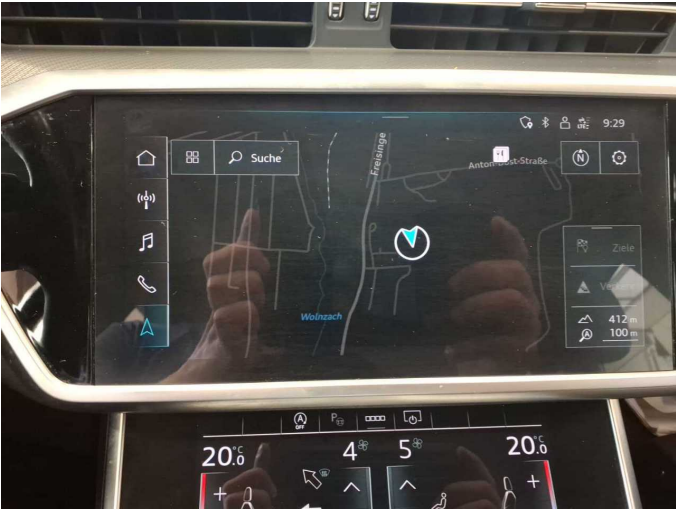


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

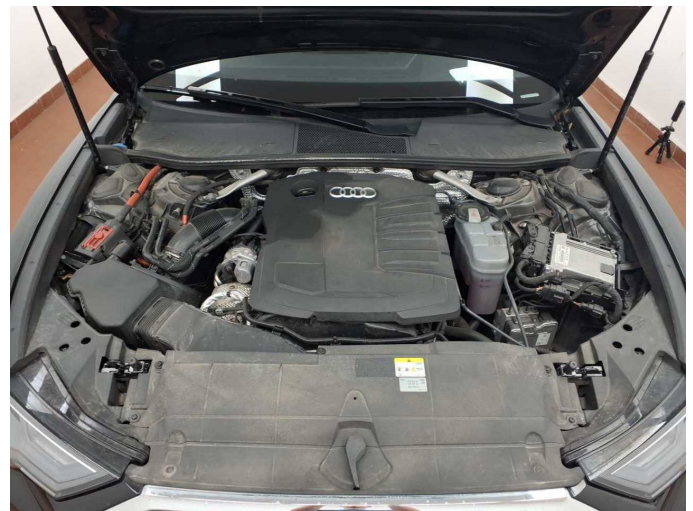


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair

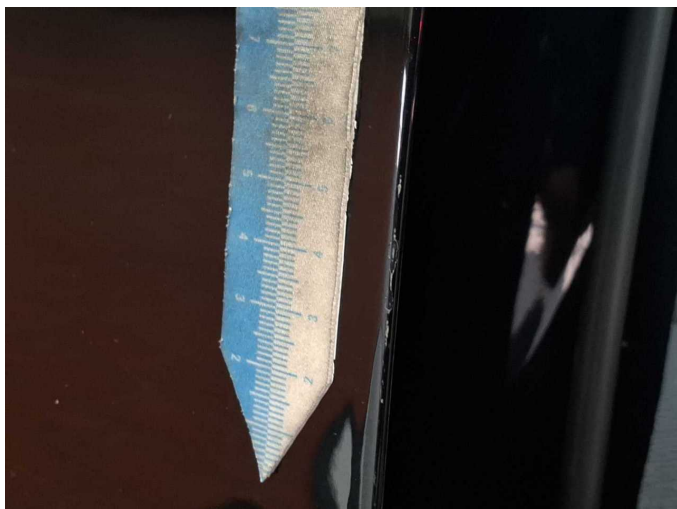

Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean




Damage 2: Interior: Interior - Soiled - Clean




Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean

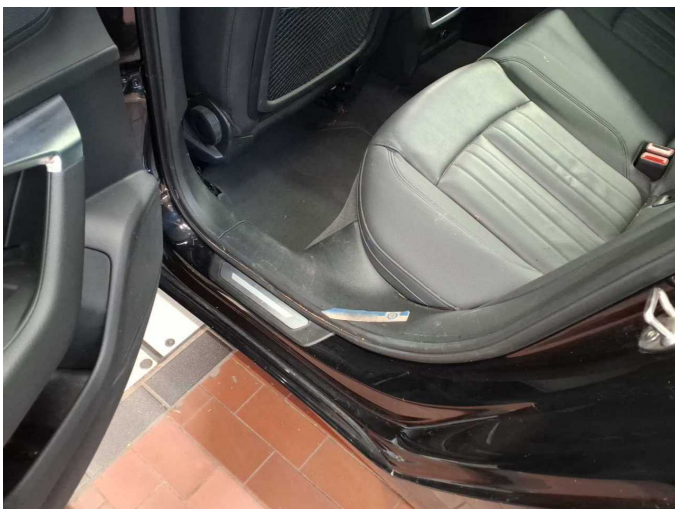

Damage 2: Interior: Interior - Soiled - Clean

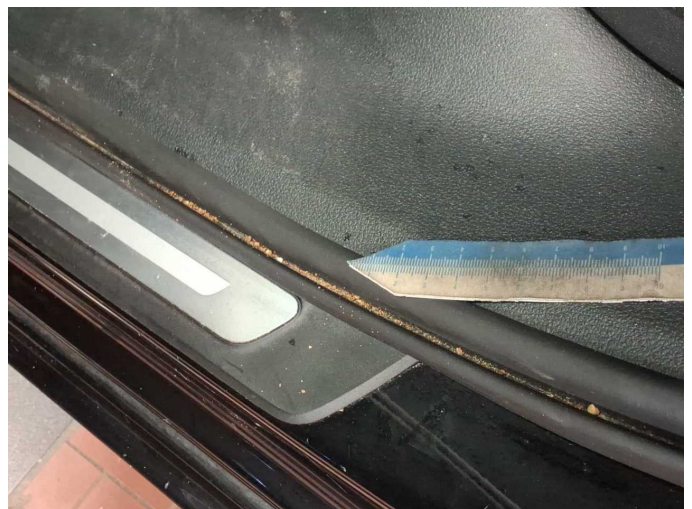

Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Door - rear left side: Door - Scratch(es) - Smart repair

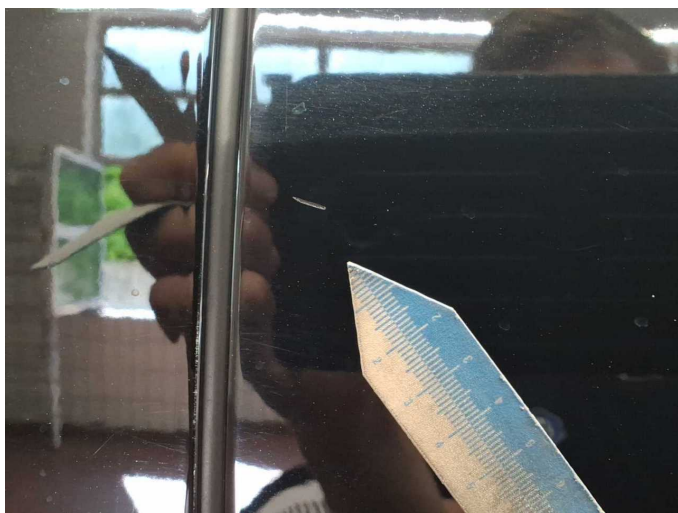

Damage 4: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 6: Side panel - rear left side: Elbow (+ Delle Gebrauchspur) - Scratch(es) - Smart repair




Damage 6: Side panel - rear left side: Elbow (+ Delle Gebrauchspur) - Scratch(es) - Smart repair



Damage 6: Side panel - rear left side: Elbow (+ Delle Gebrauchspur) - Scratch(es) - Smart repair




Damage 7: Door - front right side: Door - Scratch(es) - Smart repair

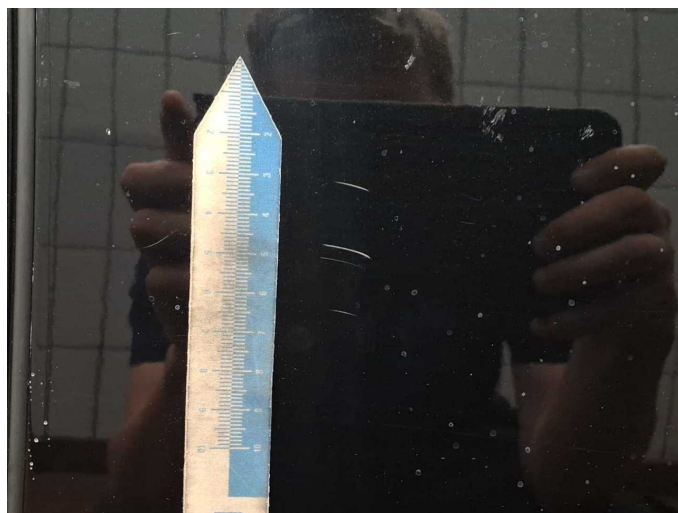

Damage 7: Door - front right side: Door - Scratch(es) - Smart repair



Damage 8: Engine: Engine - Leaking - Perform diagnosis

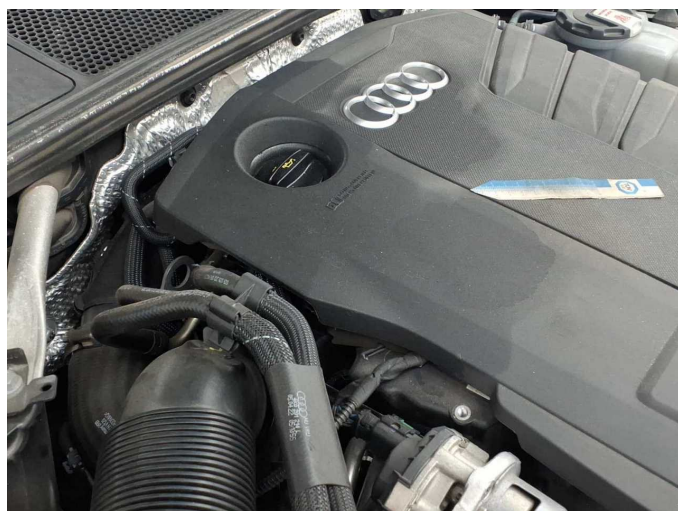

Damage 8: Engine: Engine - Leaking - Perform diagnosis



Damage 9: Wheel / tyres: Tyre - rear left side (nicht fahrbereit) - Broken / torn - Replace



Damage 9: Wheel / tyres: Tyre - rear left side (nicht fahrbereit) - Broken / torn - Replace



Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 10: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 11: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 11: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 11: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 12: Door - front right side: Door handle - outside - Scratched - Paint



Damage 12: Door - front right side: Door handle - outside - Scratched - Paint




Damage 12: Door - front right side: Door handle - outside - Scratched - Paint



Damage 13: Cab: Door rubber seal - left side (Tür vorn links) - Broken / torn - Replace




Damage 13: Cab: Door rubber seal - left side (Tür vorn links) - Broken / torn - Replace

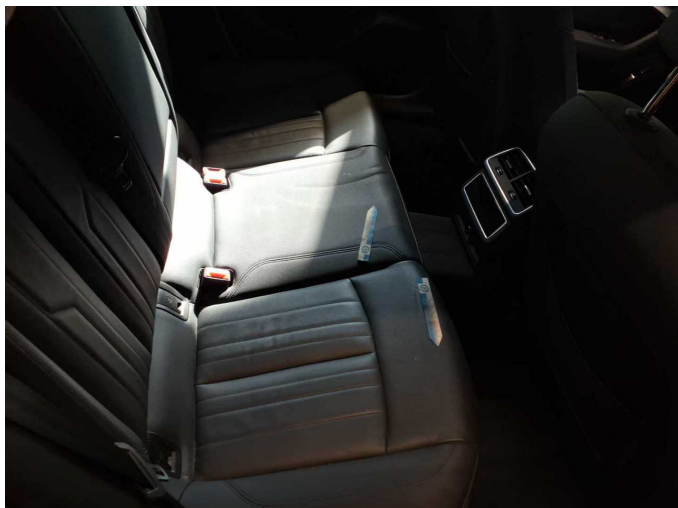

Damage 14: Seat - rear: Seat cover - 3 seater bench (+ Druckstelle Reifen) - Scratch(es) - Replace



Damage 14: Seat - rear: Seat cover - 3 seater bench (+ Druckstelle Reifen) - Scratch(es) - Replace

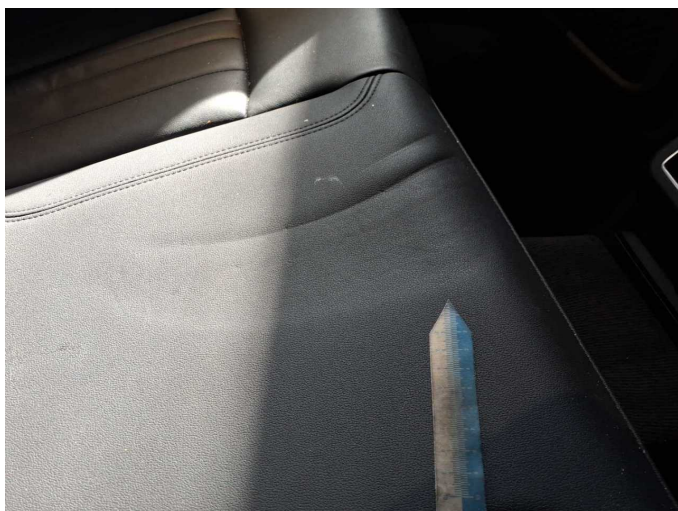

Damage 14: Seat - rear: Seat cover - 3 seater bench (+ Druckstelle Reifen) - Scratch(es) - Replace



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

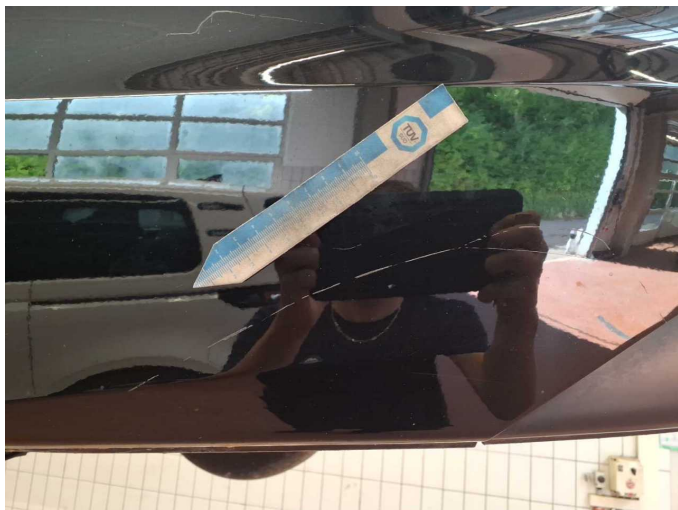


Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 15: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 16: Bonnet: Bonnet - Scratch(es) - Paint

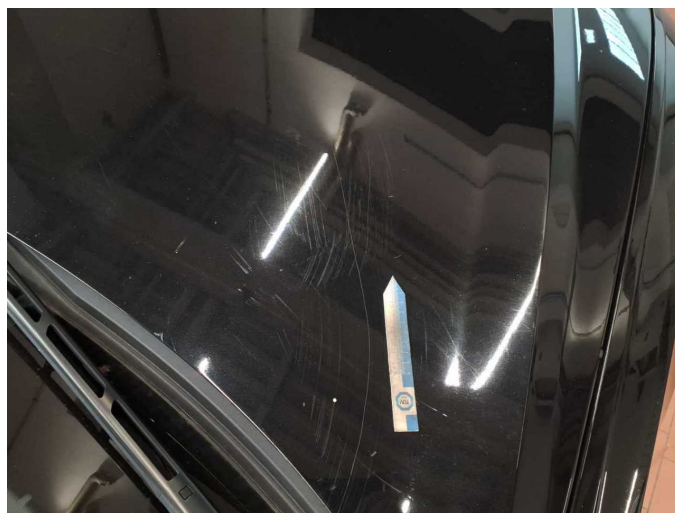

Damage 16: Bonnet: Bonnet - Scratch(es) - Paint



Damage 16: Bonnet: Bonnet - Scratch(es) - Paint



Damage 17: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation




Damage 17: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Damage 17: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation




Wear and tear 6: Instrument panel: Centre console - front - Scratch(es) - No deduction

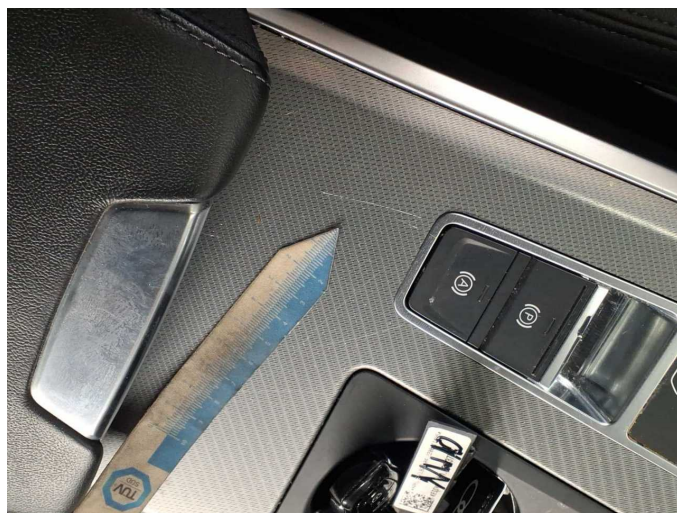

Wear and tear 6: Instrument panel: Centre console - front - Scratch(es) - No deduction



Wear and tear 7: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

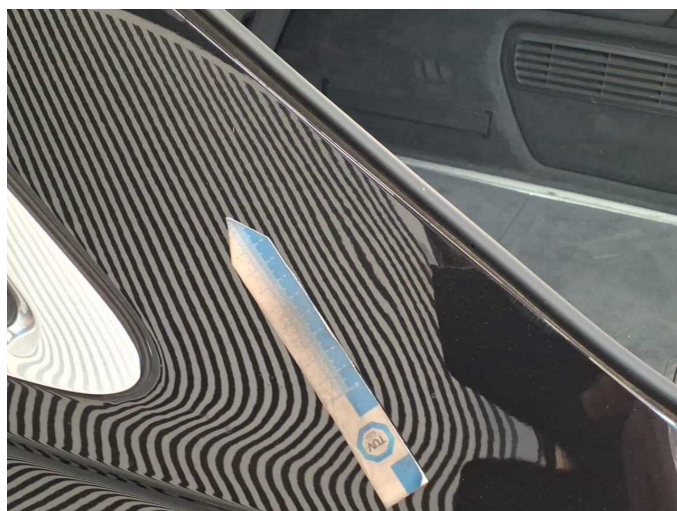

Wear and tear 7: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Repainting 1: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF24NN055973
Hersteller / Modell: AUDI AUDI A6 Avant 40 TDI S tronic design

Datum	KM-Stand	Beschreibung
09.01.2026	123.591	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
31.07.2025	108.352	AU
17.04.2025	97.249	Bremsbelagfühler ern; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
14.08.2024	76.919	Bremsflüssigkeit; Bremsflüssigkeit ern
10.05.2024	61.538	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
27.11.2023	46.076	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
13.07.2023	31.006	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges