



Expertise

Protocol number: 46740690
Order No. / Reference: 26750873
Inspection date: 17 Jul 2026

Manufacturer: Volkswagen
VIN: WVGZZAAZND008565

Model: up!



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen up!	
Vehicle Identification number	WVGZZAAZND008565
Mileage (Read)	63,350 km
First registration	6 Oct 2021
Number of holders	1
Next periodical technical inspection	11/2026
(Report not on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	999 ccm / 3
Power	48 kW
Gearbox / Number of gears	Manual / 5
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Pure White
Doors / Seats	5 / 4
Upholstery type	Cloth
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,600 km
Last service on / at	02/2026 at 57,916 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF296905
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CMX 00021		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,330 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	175/65 R14 82T	Summer tyres on Steel rim with wheel cover	Dunlop	5mm / 5mm
2)	175/65 R14 82T	Summer tyres on Steel rim with wheel cover	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	165/70 R14 81T	Winter tyres on Steel rim with wheel cover	Dunlop	8mm / 8mm
2)	165/70 R14 81T	Winter tyres on Steel rim with wheel cover	Dunlop	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 05/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger (with passenger airbag deactivation)
- Version with 4 doors including front passenger seat backrest that folds down completely (rear side windows can be opened - front passenger seat backrest folds down completely)
- third brake light
- Dash pad "black cube"
- Chrome trim around the left and right air vents (as well as the controls for the radio and air conditioning)
- Electric front windows
- Luggage compartment lighting
- Transmission: 5-speed manual transmission
- Handbrake lever handle in plastic
- Heated rear window
- Air conditioning (dust and pollen filter)
- Front headrests (integrated into the seat)
- Steering column with height adjustment
- Multifunction display "Plus" (with display of, among other things: - Outside temperature - Speed warning - Average consumption - Comfort - Average speed - Current consumption - Trip distance - Range - Driving time - Service - Gear recommendation (applies to vehicles with manual transmission and dual-clutch transmission DSG) - Time - Digital speedometer - Language - Digital oil temperature display - Auxiliary heater - Lights & visibility - Winter tires)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Rear bench seat, undivided, 2-seater, backrest asymmetrically split and foldable
- Seats: Driver's seat with height adjustment
- Start-stop system (with brake energy recuperation)
- Telephone interface
- USB interface
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- We Connect Go
- Green heat-insulating glazing (sides and rear)
- Airbag, head airbag system including front side airbags (for front and rear passengers)
- Exterior mirrors adjustable from inside
- Exterior mirror housings and door handles in body color
- Turn signals integrated into the side exterior mirrors
- Vehicle tool kit
- Headliner in light grey
- Tachometer
- Electronic Stability Program (including hill start assist, ABS with brake assist, ASR, EBV and MSR)
- luggage compartment cover
- Luggage compartment floor adjustable to 2 heights and removable
- Glove compartment with flap
- rear window wiper
- Rear headrests (2) (lowerable)
- LED daytime running lights
- Makeup mirror in the passenger-side sun visor
- Upholstery: Cloth
- Radio "Composition Phone" (screen diagonal 12.7 cm - FM radio reception - MP3 - AUX-IN multimedia jack - Apple compatibility for USB interface - telephone interface - Bluetooth audio - hands-free system)
- Radio accessories: 2 speakers
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system (passive)
- Wheels: 4 steel wheels 5 J x 14 (wheel covers with Volkswagen logo in aluminum - tires 175/65 R 14 optimized for rolling resistance)
- electromechanical power steering
- Seats: Easy-Entry entry aid (on driver's side with memory function)
- 12V socket
- Phone accessory: maps + more dock (The flexible 3-arm holder for smartphones up to 14 cm (5.5 inches) in size is attached to the instrument panel above the radio via a clip and can be removed. A USB interface for charging and data transfer is integrated into the "maps + more dock")
- Electronic immobilizer
- Central locking (without safe locking with remote control, 2 remote keys)

Extra equipment

- Lettering & Wrapping
- Package: Driver assistance package (Parking aid - Acoustic warning signals for obstacles in the rear area - Cruise control - Rear view camera)
- Paint finish: Special paint finish, solid color
- Wheels: Winter wheels (additional) steel, 5 J x 14 (4 steel wheels 5 J x 14 - on-board tools and jack - winter tires 165/70 R 14 T)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Vehicle (Beklebt/foliert) - Glued / labelled - De-glue / neutralise
2	Front bumper	Front bumper - Scratch(es) - Paint
3	Door - front right side	Door - Deformed - Repair and paint
4	Rear bumper	Rear bumper - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Wheel cover set - complete - Scratch(es) - No deduction
2	2nd wheel set	Wheel cover set - complete - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No. Accident

1 Side - left

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster

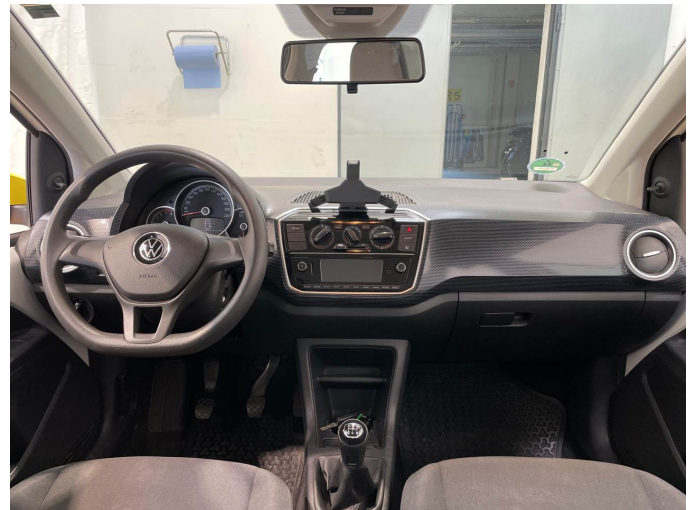


Figure 8: Instrument panel

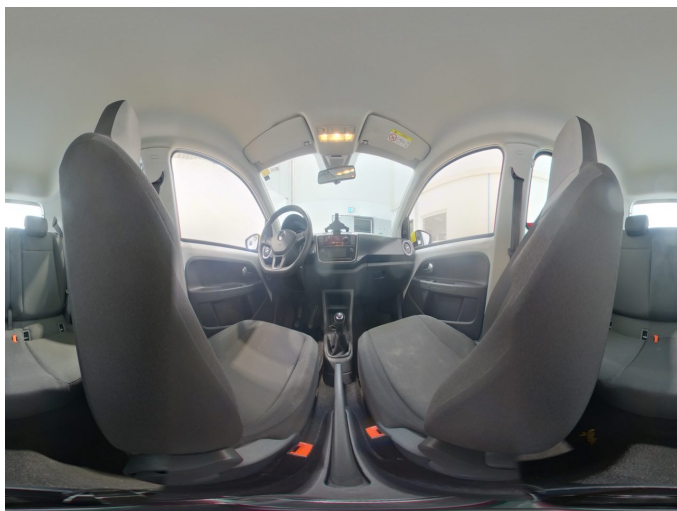


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

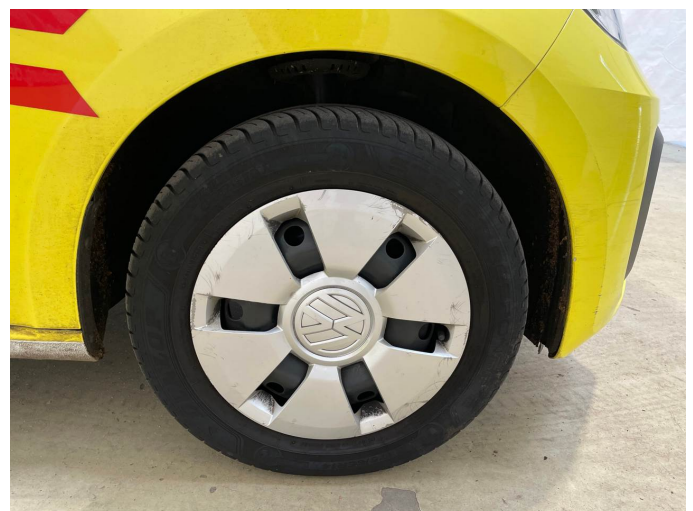


Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

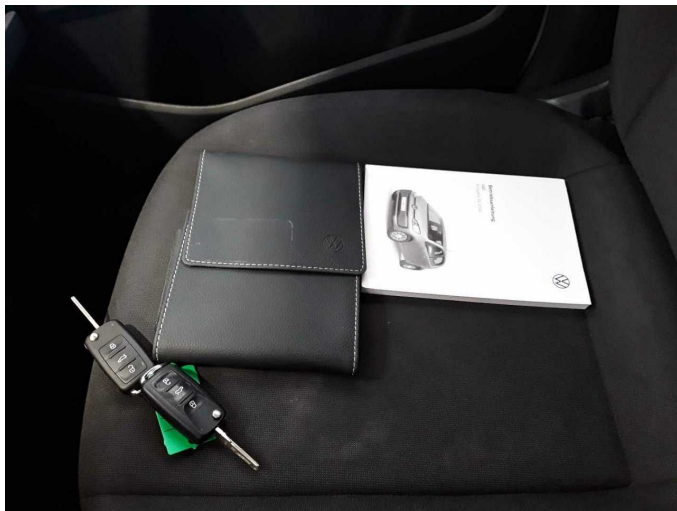


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

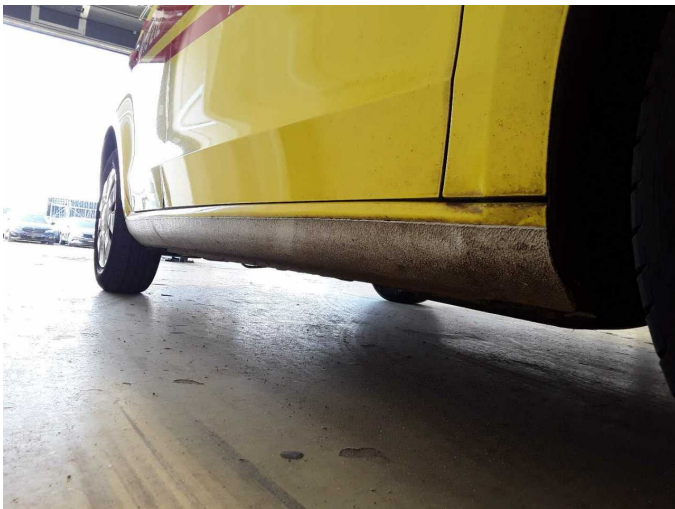


Figure 21: Misc.

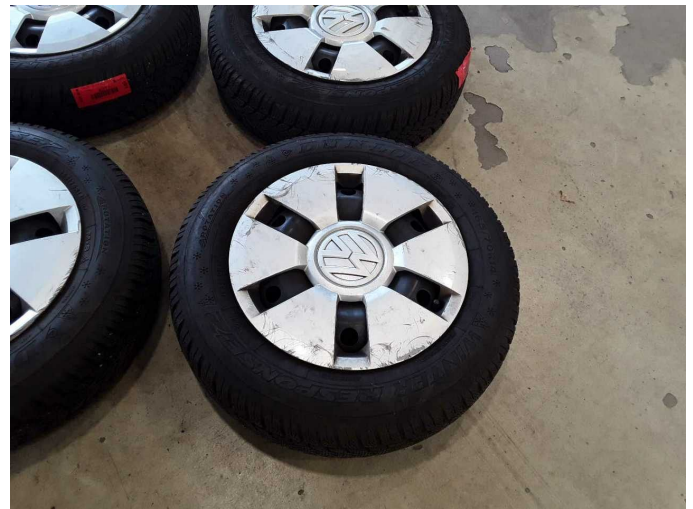


Figure 22: Misc.



Figure 23: Misc.



Damage 1: Misc.: Vehicle (Beklebt/foliert) - Glued / labelled - De-glue / neutralise



Damage 1: Misc.: Vehicle (Beklebt/foliert) - Glued / labelled - De-glue / neutralise



Damage 1: Misc.: Vehicle (Beklebt/foliert) - Glued / labelled - De-glue / neutralise



Damage 1: Misc.: Vehicle (Beklebt/foliert) - Glued / labelled - De-glue / neutralise



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint



Damage 2: Front bumper: Front bumper - Scratch(es) - Paint




Damage 3: Door - front right side: Door - Deformed - Repair and paint



Damage 3: Door - front right side: Door - Deformed - Repair and paint



Damage 3: Door - front right side: Door - Deformed - Repair and paint

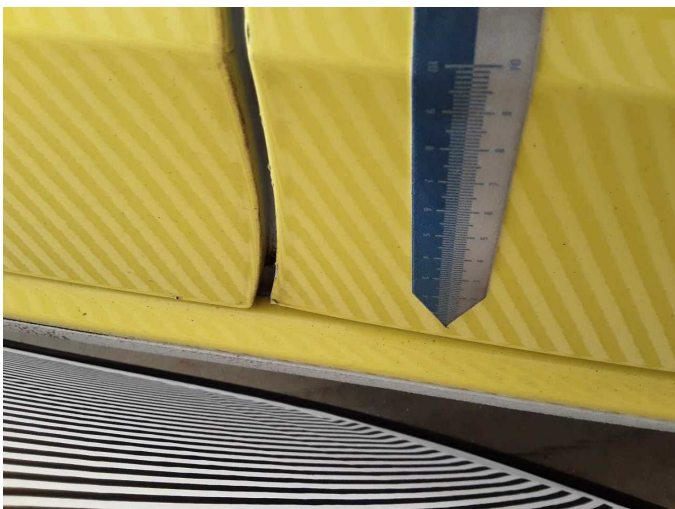

Damage 3: Door - front right side: Door - Deformed - Repair and paint



Damage 3: Door - front right side: Door - Deformed - Repair and paint



Damage 4: Rear bumper: Rear bumper - Broken / torn - Replace



Damage 4: Rear bumper: Rear bumper - Broken / torn - Replace



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZAAZND008565
Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN up!

Datum	KM-Stand	Beschreibung
06.02.2026	57.916	Batterie ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges; Zündkerzen ern
20.02.2025	44.650	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.11.2024	40.828	HU + AU
18.10.2023	29.088	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.10.2022	15.771	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges