



MERCEDES-BENZ GLC: FV-368-DW

Vinnumber:	W1N2539131V274939	Versionname:	MERCEDES-BENZ GLC GLC 200 d Business Line VP
First Registrationdate:	17/11/2020	Fiscalpower:	[5P] bva 9-163CH-9cv (SUV)
Expertise Mileage:	109001	Power Kw:	120
Bodytype:	Off-road	Body colour:	Grey
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Other
			Lining Leather

Tyres

	235/60/18/107 W			
Summer tyres:	Fr.L.	Goodyear: 50%	Fr.R.	Goodyear: 60%
	Re.L.	Continental: 95%	Re.R.	Continental: 95%
Tyre profile depth FL				5.0
Tyre profile depth FR				4.3
Tyre profile depth RL				1.7
Tyre profile depth RR				1.7
Tyre size FL				235/60 R 18 107 W
Tyre size FR				235/60 R 18 107 W
Tyre size RL				235/60 R 18 107 W
Tyre size RR				235/60 R 18 107 W
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Jack	No
Armrest F M, Tear, Replace	



Inner door sill RL, Dent(s), Repair and paint (complete)



Interior, Stain, Cleaning




Tyre RL, Out of tolerance, Replace



Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Tyre RR, Out of tolerance, Replace

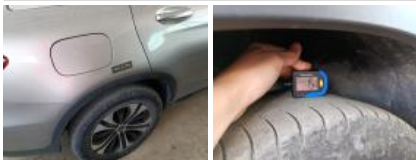

Door RL, Scratch(es), Paint



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Wing RL, Dent(s), Repair and paint (complete)



Bumper F, Scratch(es), Paint



Door RR, Scratch(es), Paint



Door FR, Scratch(es), Acceptable



Wing RR, Dent(s), Repair and paint (complete)



Bumper R, Scratch(es), Paint



Tailgate / Boot, Dent(s), Repair and paint (complete)



Jack, Missing, Repair/replace (lump sum)



Historique Maintenance

Immatriculation: FV-368-DW Date de 1ère immatriculation: 17/11/2020

Modèle: Mercedes GLC GLC 200 d Business Line VP [5P] bva 9-163CH-9cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
04/01/2025	79.231	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS ETE
21/12/2024	78.849	SOCIETE DE DISTRIBUTION ET DE REPARATION AUTOMOBILE	REVISION ET CLIM
	0		RECYCLAGE
	0		ADBLUE
	0		LIQUIDE DE FREIN
21/12/2023	59.396	SOCIETE DE DISTRIBUTION ET DE REPARATION AUTOMOBILE	REVISION
	0		FILTRE A AIR RPLT
	0		BALAIS ESSUIE GLACE AV
	0		REVISION
	0		ADBLUE
	0		RECYCLAGE
17/08/2023	50.451	SOCIETE DE DISTRIBUTION ET DE REPARATION AUTOMOBILE	PLAQUETTES AR RPLT
	0		RECYCLAGE
16/08/2023	50.123	CONTITRADE FRANCE	REMPLACEMENT PNEUS ETE
06/12/2022	37.075	SOCIETE DE DISTRIBUTION ET DE REPARATION AUTOMOBILE	REVISION ET CLIM
	0		BALAIS ESSUIE GLACE AV
	0		RECYCLAGE
	0		LIQUIDE DE FREIN
30/11/2021	16.363	SOCIETE DE DISTRIBUTION ET DE REPARATION AUTOMOBILE	RECYCLAGE
	0		REVISION
	0		ADBLUE