

Expertise

Protocol number: 46905287
Order No. / Reference: 26759908
Inspection date: 5 Aug 2026

Manufacturer: Mercedes-Benz	Model: EQA 250+
VIN: W1N9N0CB8TJ182785	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQA 250+	
Vehicle Identification number	W1N9N0CB8TJ182785
Mileage (Read)	7,580 km
First registration	22 Aug 2025
Number of holders	1
Fuel type	Electric
Power	95 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Kosmossschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	33 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HQ376501
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BEE 00022		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,475 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104T	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	235/55 R18 104T	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R18 102T	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	215/60 R18 102T	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag: Driver and passenger side
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Acoustic environmental protection
- Rear armrest
- Double cup holder
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis with lowered suspension
- Pedestrian protection with active hood
- Luggage net on driver and passenger seatbacks
- Transmission: Direct drive
- Rear window wiper/washer system
- Climate: THERMATIC automatic climate control
- Adjustable headrests (5)
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW
- LED light strip (function: tail light and rear fog light) between the LED tail lights
- MBUX multimedia system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Cargo space
- Package: Progressive
- Package: Seating comfort
- Upholstery: ARTICO leatherette/fabric
- Radio accessories: Digital radio
- Radio accessories: Pre-installation for digital radio
- Tire pressure monitoring system
- Wheels: 45.7 cm (18") alloy wheels, 4-spoke design
- Rear view camera
- Seat belts: Rear seat belt status indicator in the instrument display
- Seats: Comfort seats
- Heated seats for driver and front passenger
- 12V power outlet in center console
- TIREFIT
- High-visibility vest for drivers
- Removal of emblem on the front fenders
- Central locking with remote control
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Ambient lighting
- Automatic passenger airbag deactivation
- Third brake light in LED technology
- EASY-PACK tailgate
- Elimination of roof rails
- Electric windows (4-way)
- Velour floor mats
- Speed Limit Assistant
- Rear window heated
- Black fabric headliner
- Communication module (LTE) for the use of Mercedes me connect services
- Chrome-look loading sill protector
- Charging system: Direct current charging system (DC charging)
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in leather
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: MBUX Navigation Premium
- Package: Light and Visibility Package
- Package: Progressive Line
- Passive attendance reminder
- Radio accessories: CENTRAL MEDIA DISPLAY
- Radio accessories: GPS antenna
- Radio accessories: Additional USB ports
- Remote and Charging Services Premium
- Wheels: Tires optimized for rolling resistance
- Windscreen wipers with rain sensor
- Seats: 4-way lumbar support for driver
- Seats: i-Size child seat attachment in the rear
- Seats: Rear seat backrests foldable
- Sun visor with illuminated makeup mirror
- Power outlet: 12V socket in the luggage compartment
- Pre-installation for DISTRONIC
- Immobiliser
- heat pump
- Decorative elements Star Pattern



Extra equipment

- Active Distance Assist DISTRONIC (radar sensor in the radiator grille - automatically acting assistance system - active up to a speed of 160 km/h - visual and acoustic warning if you as the driver need to intervene - depending on the driving program, the vehicle accelerates faster or slower to the desired speed - detected speed limits can be conveniently adopted by pressing a button on the steering wheel (only in conjunction with Traffic Sign Assist or Speed Limit Assist))
- Package: Progressive Advanced (Advanced package - Fully digital instrument display with 10.25" screen diagonal - Parking package with reversing camera - Blind spot assist - Individualization package - Mirror package - Illuminated door sill trims with model-specific lettering and interchangeable cover)
- Phone accessories: Smartphone integration (Smartphone integration connects your mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto. This gives you convenient access to your smartphone's most important applications. You can also use third-party apps such as Spotify quickly and easily.)
- Towbar with ESP trailer stabilization (Foldable towbar - operating button with LED light in the boot or tailgate - ESP trailer stabilization)
- Roof rails in polished aluminum
- Paint finish: Metallic
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 1.8 kW (230 V, 1-phase, 8 A) and fits sockets of type E/F CEE 7/7.)
- Package: Winter Package (heated seats for driver and front passenger, selectable in three stages and with automatic shut-off - heated steering wheel - heated windscreen washer system)
- Siemens volume model
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Dark tinted heat-insulating glass (rear side windows and rear window)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Sill - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Soiled - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - Wheel cover set - complete

Accident damages

No. Accident

1 Rear, Side - left



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

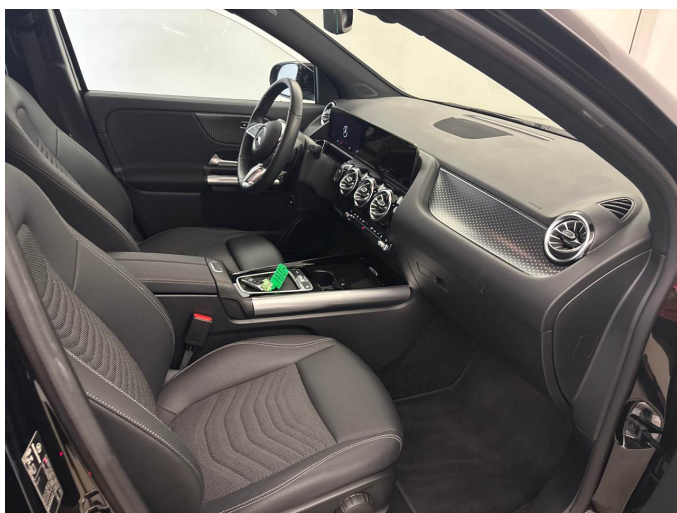


Figure 5: Interior - front

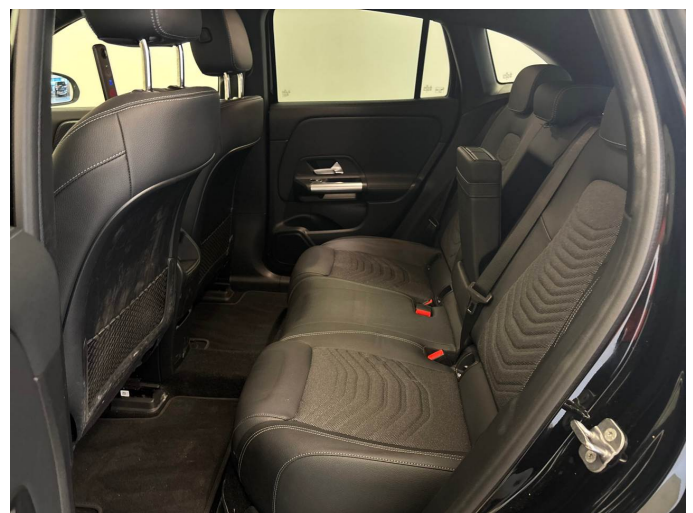


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

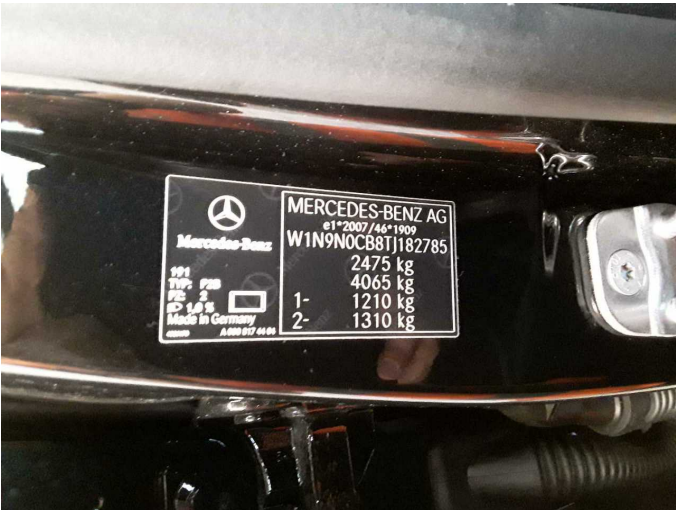


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.




Damage 1: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 1: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Wear and tear 1: Mudguard - right side: Mudguard - right side - Soiled - No deduction

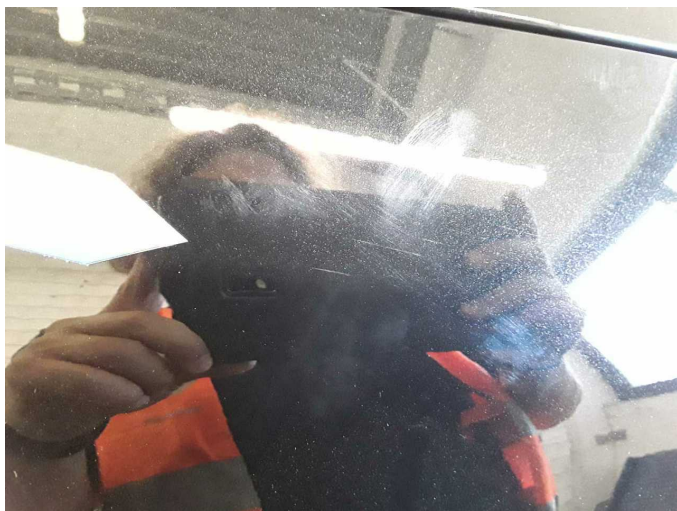

Wear and tear 1: Mudguard - right side: Mudguard - right side - Soiled - No deduction




Missing part 1: 2nd wheel set: Wheel cover set - complete - Missing - Replace



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left

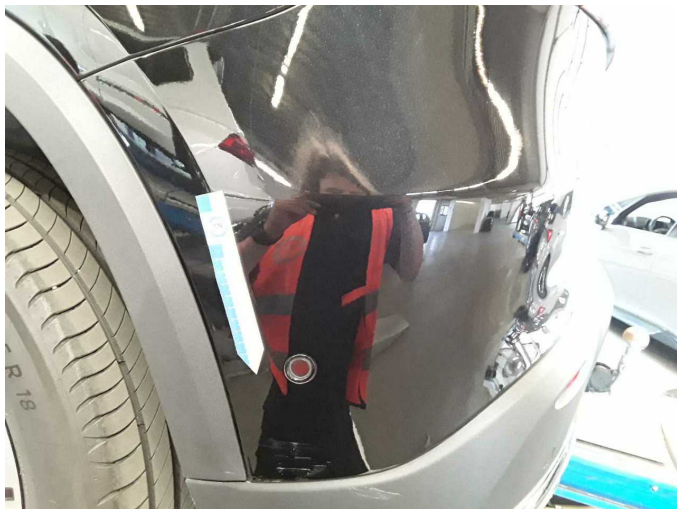


Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left

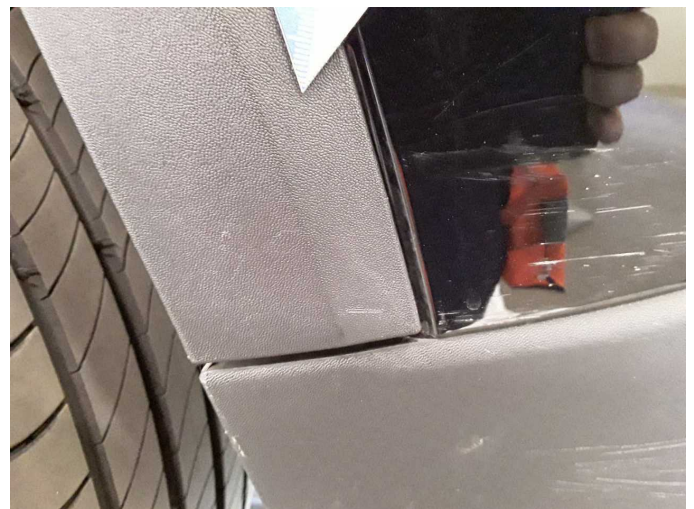

Accident 1: Rear, Side - left