



Expertise

Protocol number: 46365890
Order No. / Reference: 26617106
Inspection date: 3 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1KAF0DB0PR119886

Model: C 200 d 9G-TRONIC



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 200 d 9G-TRONIC	
Vehicle Identification number	W1KAF0DB0PR119886
Mileage (Read)	145,624 km
First registration	23 May 2023
Number of holders	1
Power / Engine displacement	120 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Schwarz
Doors / Seats	4 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	263 Tag(e)
Last service on / at	03/2026 at 133,730 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV671712
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / BDA 00241		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/50 R17 98Y	Summer tyres on Light alloy	Continental	4mm / 4mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag (Additional airbag for increased front occupant protection in the event of a side impact)
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Airbag: Windowbag for driver and front passenger
- Left and right exterior mirrors are heated and electrically adjustable
- Brake assist, active
- Diesel particulate filter
- Double cup holder at the front
- ECO start/stop function
- Electronic Stability Program (ESP) (including Anti-lock Braking System (ABS) and Traction Control System (ASR))
- Electric windows (4-way)
- Velour floor mats
- Speed Limit Assistant (The Speed Limit Assistant detects and displays speed limits.)
- Rear bumper with diffuser-look insert, black grained (rear bumper painted in body color with diffuser-look insert, black grained and invisibly integrated exhaust tailpipes)
- Mechanical child safety lock for the rear doors
- Rear headrests (3)
- Front headrests
- Paint finish: Solid
- LED High Performance headlights (The elements of the LED High Performance headlights: - Torch and trifunctional light guide for daytime running lights, position lights and turn signals - Multi-chamber reflector system with 4 individual reflectors each) for low beam and high beam. The elements of the rear lights in LED technology: - All light functions in full LED technology - Tail light - Brake light and parking light - Rear fog light (only on the left side) - Turn signals - Reversing light - 3rd brake light)
- Mercedes-Benz Emergency Call System (can provide a crucial time advantage in an emergency. A communication module with its own SIM card automatically triggers an emergency call upon detection of an accident, which can shorten the time until emergency services arrive. The emergency call can also be triggered manually to organize assistance.)
- Package: Interior lighting package (Illuminated glove compartment - Lighting for wireless mobile interface or mobile phone storage - Lighting for the storage compartment in the center console or the double cupholder - Lighting for the storage compartment under the armrest of the center console - Two makeup lights in front - Two reading lights in the overhead control unit - Two reading lights and interior light function in the grab handles in the rear - Lighting for the trunk or cargo area)
- Radio: MBUX (fully digital instrument display with 26 cm (10.25") color LCD display and a resolution of 1440 x 540 pixels - Bluetooth telephony / audio - WLAN hotspot)
- Radio accessories: Digital radio (DAB)
- Airbag: Automatic passenger airbag deactivation (The system automatically deactivates the passenger airbag as soon as it detects a rear-facing child seat or registers that the passenger seat is unoccupied. A transponder in the child seat is not necessary. If it detects that an adult is taking the seat, the airbag is automatically activated, reducing the risk of incorrect operation.)
- Basic services (breakdown management, maintenance management, accident management, telediagnosis, remote vehicle diagnostics)
- DYNAMIC SELECT (consisting of driving programs: Comfort, Sport, Eco mode)
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Front bumper painted in body color (with centrally positioned trim panel (wing) in silver and diamond-patterned air intakes in black grained)
- Transmission: 9-speed automatic, 9G-TRONIC
- Interior headliner fabric crystal grey
- ISOFIX child seat attachment with top tether in the rear
- KEYLESS-GO start function
- THERMATIC automatic climate control with 1 climate zone (controlled via the central display or the climate control unit in the center console) - Sensor system for detecting, for example, interior/ exterior temperature, solar radiation, humidity and dew point - Ventilation system consisting of: 3 center vents in the center area and 2 side vents, 2 ventilation openings each in the footwell for driver and front passenger - Fine dust filter for filtering dust, soot and pollen - Dew point sensor, continuous defroster vent under the windshield and 2 fixed defroster vents)
- Steering wheel: Multifunction sports steering wheel in leather (sporty steering wheel in 3-spoke design - leather finish - black grained shift paddles - control via touch panels: left: driver display, cruise control and limiter or active distance assist DISTRONIC; right: MBUX multimedia system (e.g. audio volume and track selection, telephony and navigation), touch sensitivity adjustable via central display)
- Center console in high-gloss black
- Package: Storage (luggage net on the left side panel in the trunk or cargo area - folding box under the load floor (not available for plug-in hybrid vehicles) - double cup holder in the center console for 2 x 750 ml - map pockets on the back of the front seats)
- Upholstery: Fabric Tandel
- Radio: Extended MBUX functions (personalization (profiles) and prediction functions - MBUX voice assistant "LINGUATRONIC" with natural language understanding - activation via Hey Mercedes - learning function of the MBUX voice assistant through connection with a cloud-based online dictionary, Mercedes me connect service free of charge for 3 years from activation - Wi-Fi hotspot - internet radio)



- Radio accessory: Communication module (LTE) for using Mercedes me connect services (The communication module with a vehicle-integrated, LTE-enabled SIM card offers you added comfort and safety. It continuously connects you to your vehicle – and the vehicle to infrastructure such as the Mercedes-Benz server or the internet. This allows you to use services such as Mercedes me connect Live Traffic Information.)
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Lane Keeping Assist, active
- Cruise control
- High-visibility vest for drivers
- Electronic immobilizer
- Central locking with remote control
- Radio accessories: Central display (High-resolution central display, slightly inclined towards the driver with a 24 cm (9.5") screen diagonal, with MBUX multimedia system - touch display with LCD technology)
- Tire pressure monitoring system (TPMS)
- Remote Services Plus (Communication module - Mercedes me services: remote vehicle status query, programming of auxiliary heating/ventilation, remote door locking and unlocking, sunroof/windows with remote locking and opening including ventilation remote control, personalization, vehicle location, vehicle tracking, geographic vehicle monitoring, parking service monitoring, finder function (Remote Vehicle Finder), notification when exceeding the driving speed, Send2Car function)
- Decorative elements, base foil, instrument panel

Extra equipment

- Package: AVANTGARDE Exterior (radiator grille with integrated Mercedes star and a chrome-plated louvre, radiator grille frame in chrome - 43.2 cm (17") 5-spoke alloy wheels, high-gloss black paint and gloss coating, 225/50 R 17 on 7 J x 17 ET 44.5 - Dynamic front bumper with centrally positioned trim strip in high-gloss chrome and diamond-pattern air intakes in black. - AGILITY CONTROL suspension with 15 mm lowering and selective damping system. - Strip on the rear side windows in high-gloss black.)
- Package: Business (Avant. or AMG Line Ext)
- Wheels: 43.2 cm (17") light alloy wheels in 5-spoke design (black painted and polished with 225/50 R 17 on 7 J x 17 ET 44.5)
- TIREFIT with tire inflation compressor

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Trim / covers	Floor mats - Broken / torn - Replace
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
4	Side panel - rear right side	Sill - Scratch(es) - Smart repair
5	Door - front right side	Door - Scratch(es) - Smart repair
6	Sill - right side	Trim - Scratch(es) - Smart repair
7	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace
8	Door - front left side	Door seal - Broken / torn - Replace
9	Sill - left side	Sill - Dent / paintcoat damage - Smart repair
10	Side panel - rear right side	Side panel - Dent / paintcoat damage - Smart repair
11	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
12	Trim / covers	Door trim - rear right side - Scratch(es) - Replace
13	Door - front left side	Door - Scratch(es) - Paint
14	Roof	Roof - Scratch(es) - Paint
15	Front bumper	Front bumper (Inklusive anbauteile) - Scratched - Paint
16	Vehicle glazing	Windscreen - Broken / torn - repair according to calculation

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Sill - Scratch(es) - No deduction
2	Bonnet	Bonnet - Dent / paintcoat damage - No deduction
3	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - No deduction
5	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 23 Sept 2024	1.067,53 €
2	Rear, Provided by user / customer, from 1 Aug 2025	1.675,02 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

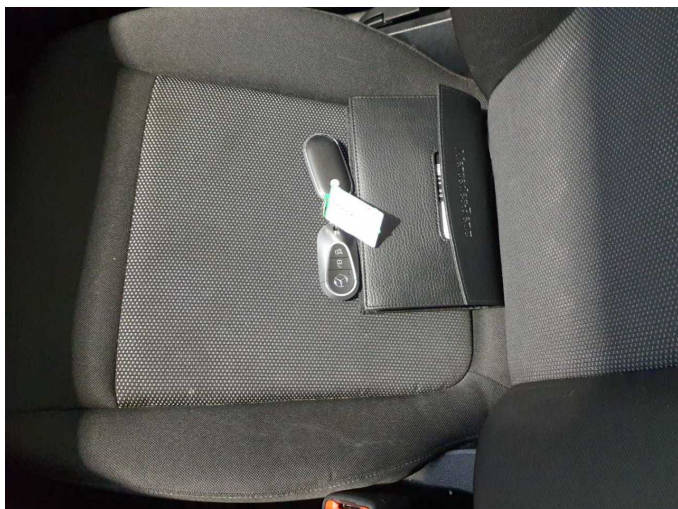


Figure 13: Documents

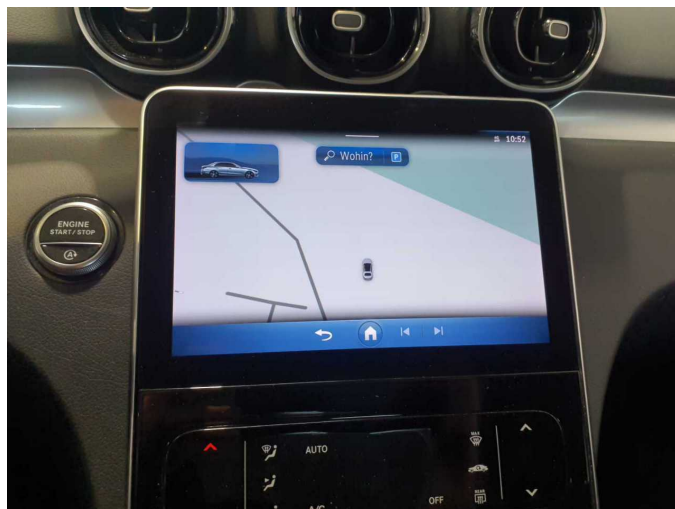


Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

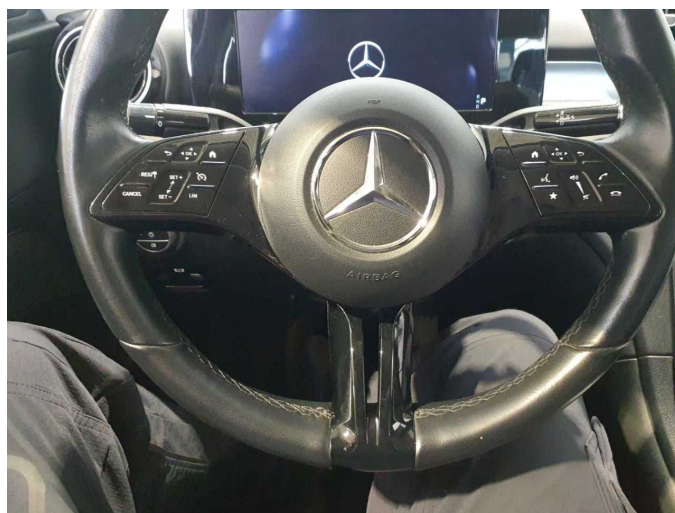


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

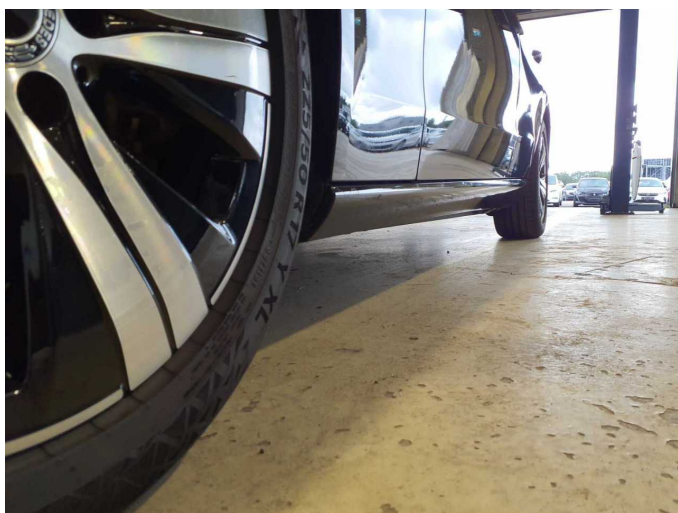


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.


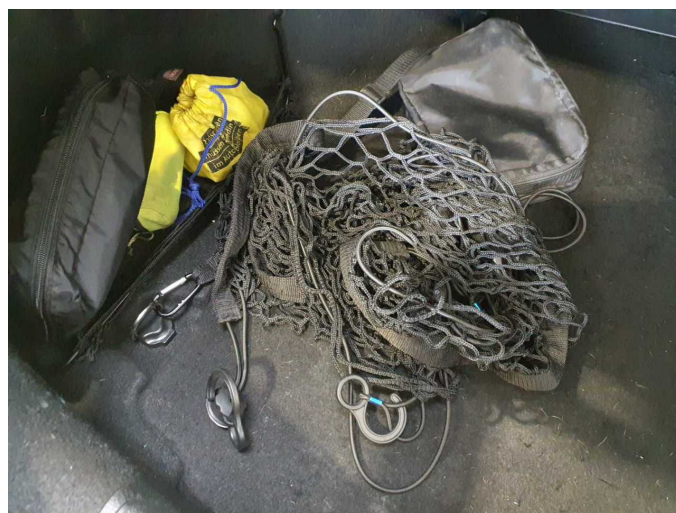


Figure 24: Misc.




Figure 25: Misc.

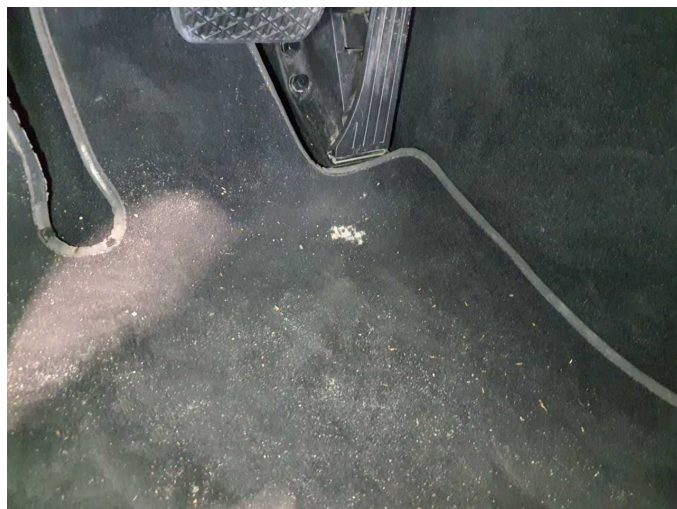


Damage 2: Trim / covers: Floor mats - Broken / torn - Replace



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

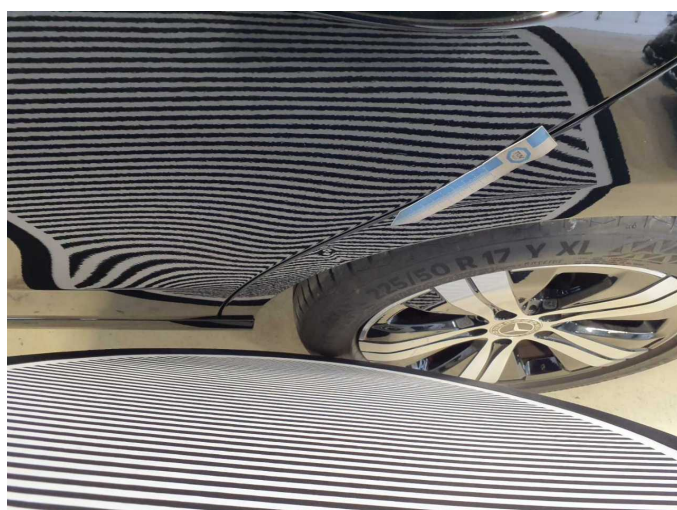


Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

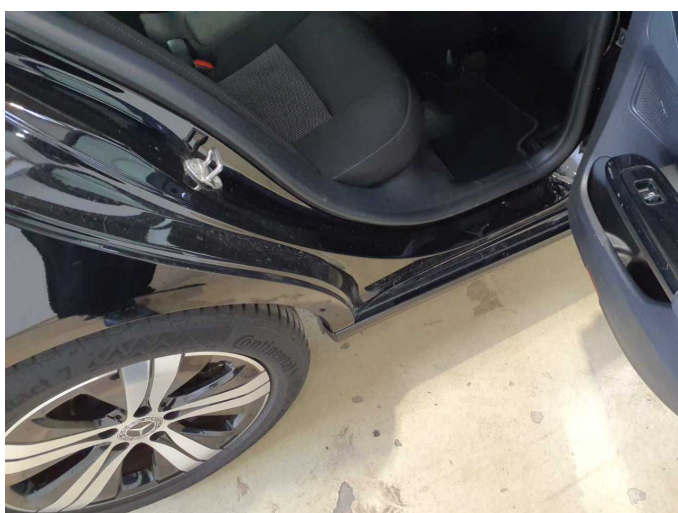

Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair

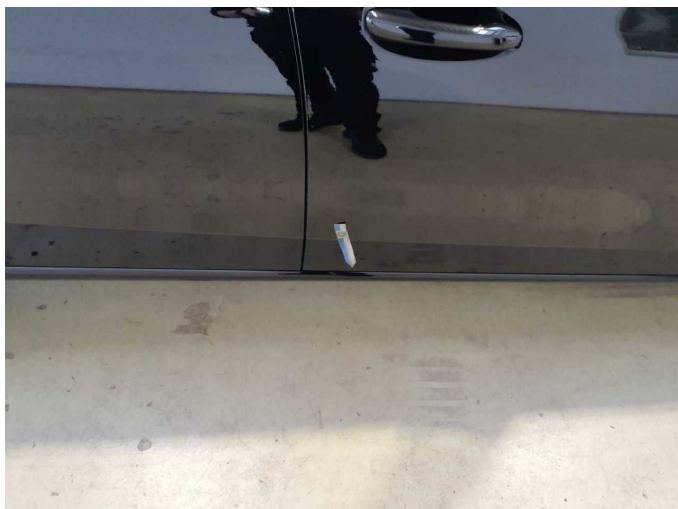

Damage 5: Door - front right side: Door - Scratch(es) - Smart repair



Damage 5: Door - front right side: Door - Scratch(es) - Smart repair



Damage 6: Sill - right side: Trim - Scratch(es) - Smart repair




Damage 6: Sill - right side: Trim - Scratch(es) - Smart repair



Damage 7: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace




Damage 7: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Broken / torn - Replace

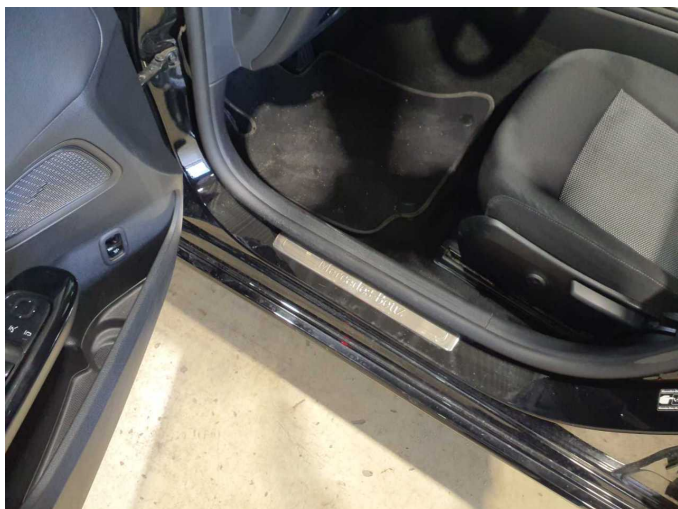

Damage 8: Door - front left side: Door seal - Broken / torn - Replace



Damage 8: Door - front left side: Door seal - Broken / torn - Replace

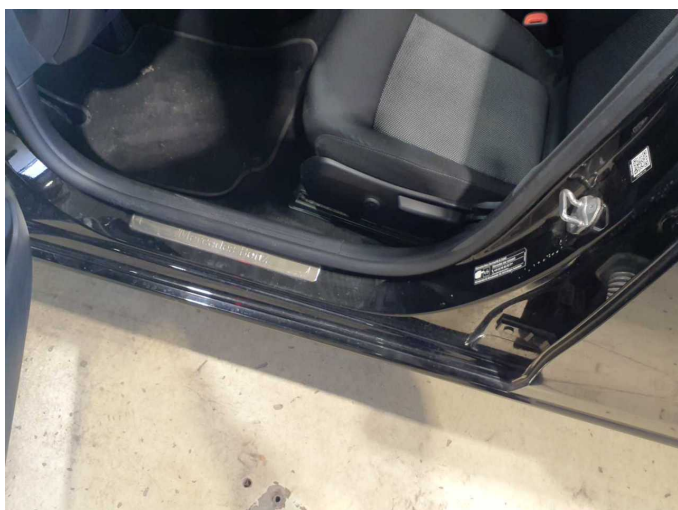

Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 9: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 10: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 11: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 11: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value




Damage 12: Trim / covers: Door trim - rear right side - Scratch(es) - Replace




Damage 12: Trim / covers: Door trim - rear right side - Scratch(es) - Replace



Damage 12: Trim / covers: Door trim - rear right side - Scratch(es) - Replace

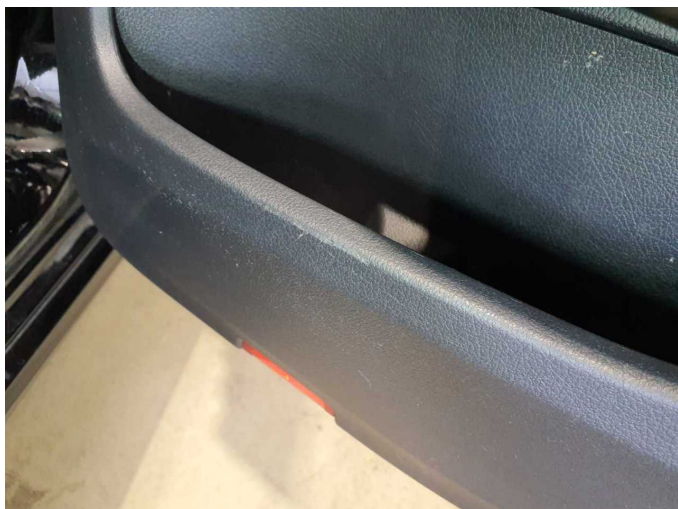

Damage 12: Trim / covers: Door trim - rear right side - Scratch(es) - Replace

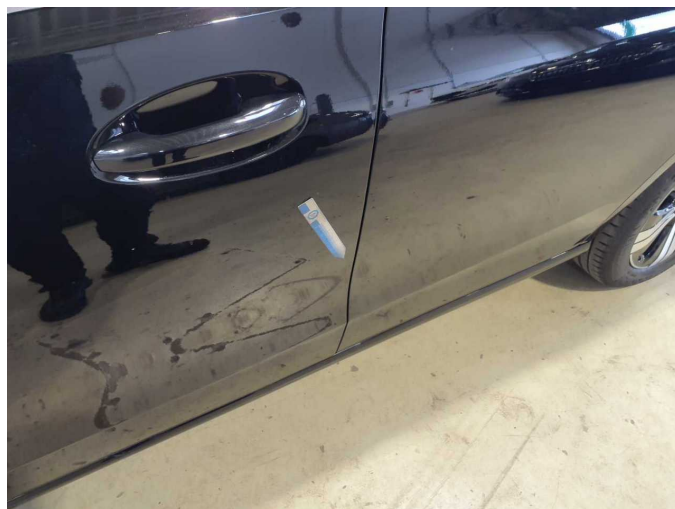

Damage 13: Door - front left side: Door - Scratch(es) - Paint




Damage 13: Door - front left side: Door - Scratch(es) - Paint



Damage 13: Door - front left side: Door - Scratch(es) - Paint




Damage 14: Roof: Roof - Scratch(es) - Paint

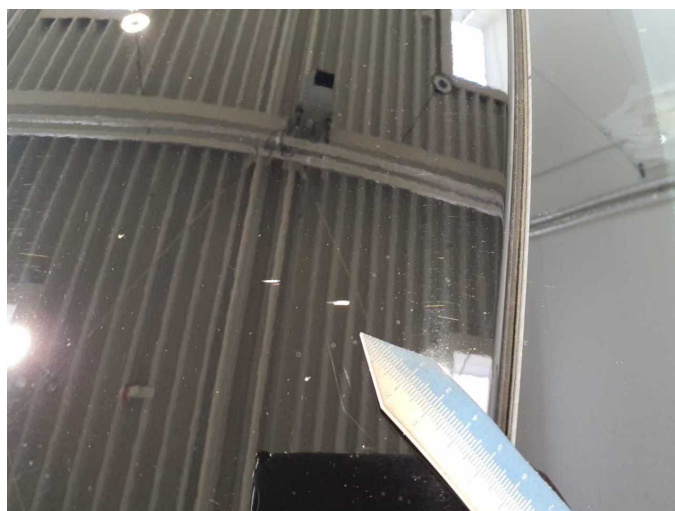

Damage 14: Roof: Roof - Scratch(es) - Paint



Damage 14: Roof: Roof - Scratch(es) - Paint

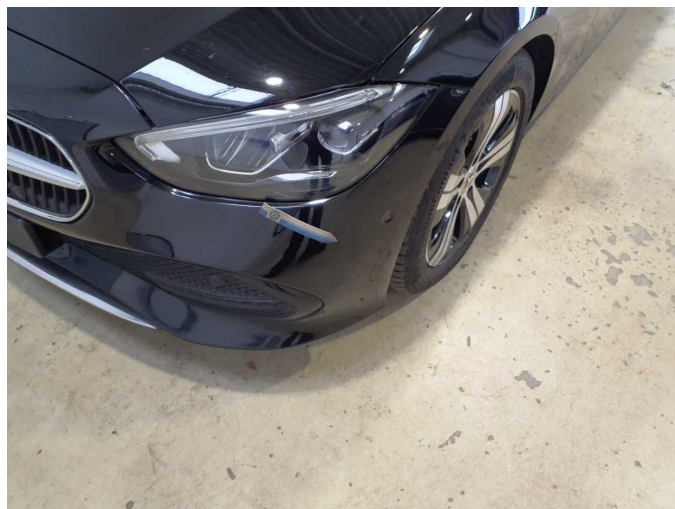

Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint



Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint

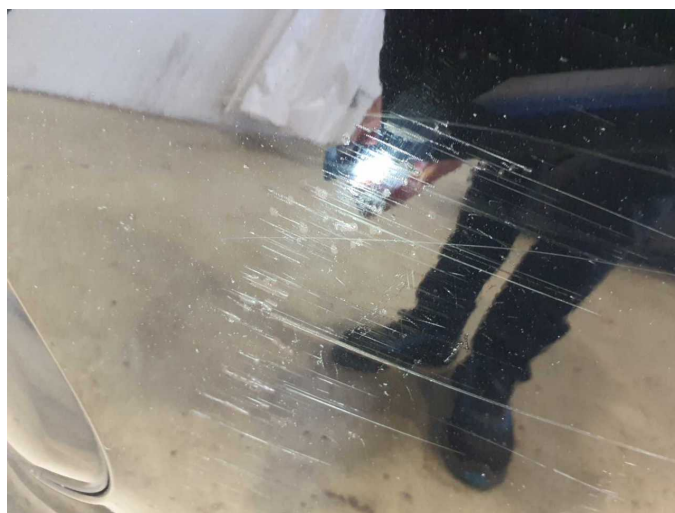


Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint

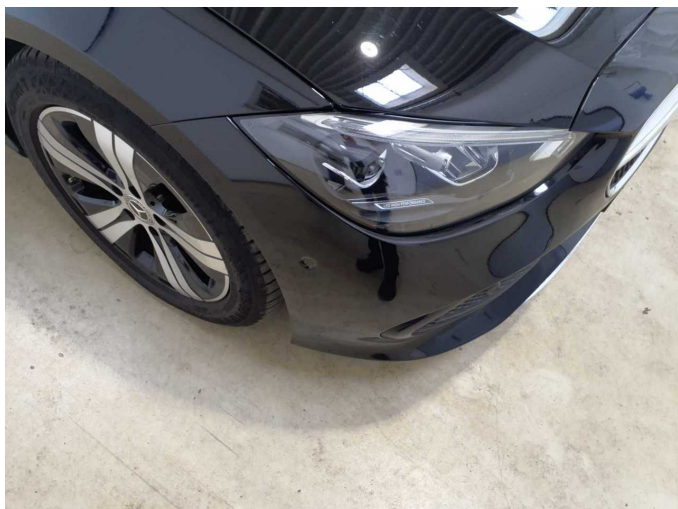


Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint



Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratched - Paint

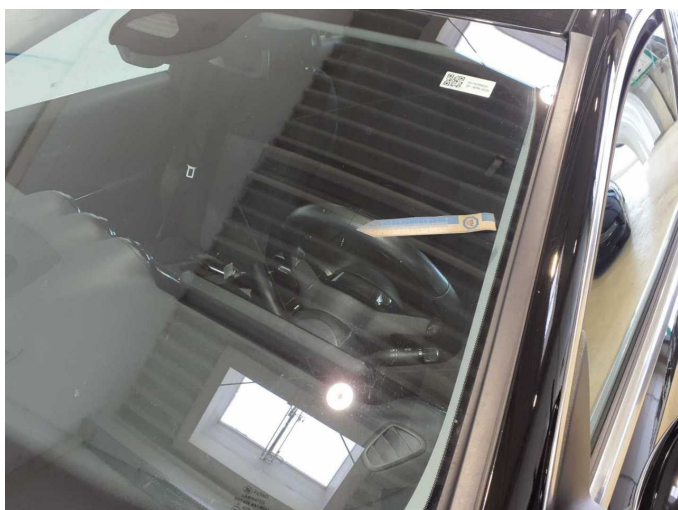

Damage 16: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation

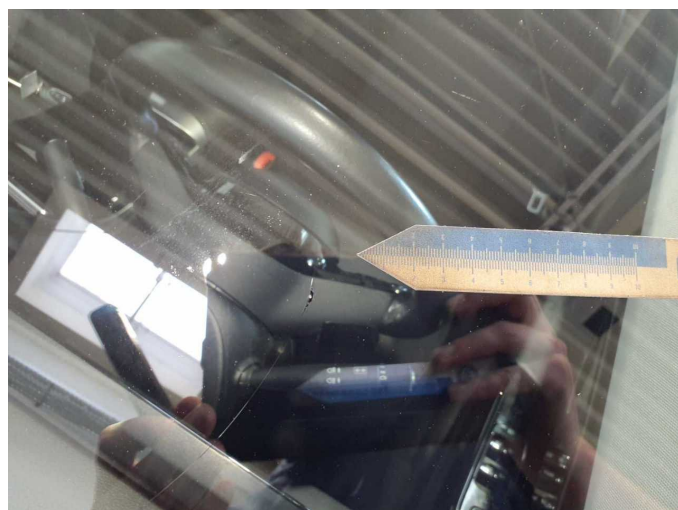

Damage 16: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation



Damage 16: Vehicle glazing: Windscreen - Broken / torn - repair according to calculation