

Vehicle details

VIN	LRW3E7FS1 PC765711	Brand	TESLA	Maintenance date	-
Licence Plate		Model	Model 3 RWD 4d	Maintenance mileage	-
Registration date	17/04/2023	Year	2023	Exterior Color	Black Metallic
Odometer	277 561 km	Engine size	-	Interior Color	Black
Fuel	Electric	Body Type	Saloon / Hatchback	Next technical inspection	-
Seats	-	Transmission	Automatic	CO2	-
Doors	4	Gears	-		

Inspection Details

Inspection date	13/07/2026	Inspection loc.			
					
					
					
					
					

Generic equipment

Automated air-conditioning	✓
Cruise control	✓
Leather	✓
GPS system	✓
Panoramic roof	✓
Alloy wheel rims	✓
Automatic Gearbox	✓
Heating seats	✓
Electric seats	✓
Metallic paint	✓
Central locking	✓
Electric windows	✓
Park Distance Control	✓
Audio System	✓
Led lighting	✓

Removable element


Wireless charger	✓
------------------	---

Technical Document

Spare key	✗
Card Key	✓
Sat Nav CD ROM Software	✓

Tyres

Pirelli 235/40/19 Summer 5.0 mm

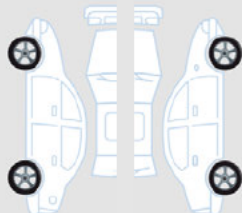

Pirelli 235/40/19 Summer 4.0 mm



Hankook 235/40/19 Summer 6.0 mm

Hankook 235/40/19 Summer 6.0 mm

Exterior

2



Part	Alloy wheel 19"
Position	Front left
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

3



Part	Door
Position	Front left
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Smart Repair

4




Part	Step plate
Position	Front left
Damages	Scratched
Severity	-
Repair mode	For info

5



Part	Sill
Position	Left
Damages	Scratched
Severity	-
Repair mode	Repair

6

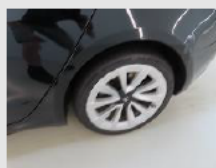

Part	Alloy wheel 19"
Position	Back left
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

7



Part	Wing
Position	Back left
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Smart Repair

8



Part	Bumper
Position	Back
Damages	Scratched
Severity	-
Repair mode	Repair

10



Part	Alloy wheel 19"
Position	Back right
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

11



Part	Roof post A/B/C
Position	Right
Damages	Scratched
Severity	-
Repair mode	Repair

12



Part	Alloy wheel 19"
Position	Front right
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

13



Part	Sill
Position	Right
Damages	Scratched
Severity	-
Repair mode	Repair

14



Part	Bumper
Position	Front
Damages	Broken
Severity	-
Repair mode	Replace

16



Part	Windscreen
Position	-
Damages	Stone impact
Severity	-
Repair mode	For info

Interior damage

1



Part	Spare key
Position	-
Damages	Missing
Severity	-
Repair mode	Replace

9



Part	Interior tailgate lining
Position	-
Damages	Scratched
Severity	-
Repair mode	For info

Others

15



Part	Damage appraisal
Position	Front
Damages	Stone impact
Severity	-
Repair mode	For info