



Expertise

Protocol number: 46762585
Order No. / Reference: 25867418
Inspection date: 23 Jul 2026

Manufacturer: Land Rover
VIN: SALCA2BN4NH908810

Model: Discovery Sport D200 R-Dynamic S



Vehicle details	
Manufacturer / Type / Model / Equipment	
Land Rover Discovery Sport D200 R-Dynamic S	
Vehicle Identification number	SALCA2BN4NH908810
Mileage (Read)	130,570 km
First registration	20 Jan 2022
Number of holders	1
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,997 ccm / 4
Power	150 kW
Gearbox / Number of gears	Automatic /
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Carpathian Grey Premium Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	31,600 km
Last service on / at	02/2026 at 128,173 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF930829
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1590 / AKN 00052		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,590 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/55 R19 105V	Winter tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	235/55 R19 105W	Summer tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the center console
- Towing eyes front and rear
- Airbag: Driver and front passenger side (front passenger airbag can be deactivated)
- Airbag: Windowbags (head airbags) for the 1st and 2nd row of seats
- Permanent all-wheel drive with Efficient Driveline
- Analog round instruments with 7" TFT on-board computer
- Animated flashing lights, rear
- Autonomous Emergency Brake Assist (AEB)
- Hill Descent Control (HDC)
- Hill start assist
- third brake light
- "Morzine" headliner (fabric) - Ebony
- Diesel particulate filter
- Dynamic Stability Control (DSC)
- Front door sill trims made of aluminum, with R-Dynamic lettering
- Electric window regulator (with one-touch function and anti-pinch protection)
- Adaptive Cruise Control (ACC) with Stop & Go
- electric tailgate
- rear window wiper
- ISOFIX child seat attachment - front passenger seat
- Child safety lock, electric
- Collision warning system monitor
- Rear headrests (3)
- Cornering Brake Control (CBC)
- LED headlights with daytime running lights
- Steering column manually adjustable
- Center console with armrest
- Emergency Brake Assist (EBA)
- Package: Black Pack (The Black Pack includes the following changes in Narvik Black: - Exterior mirror caps - Tailgate trim strip (only for R-Dynamic) - Radiator grille - Badges on hood and tailgate - Lower front and rear bumpers)
- Electric parking brake (EPB)
- Radio: Digital radio (DAB+)
- Radio accessories: 10" touchscreen
- Radio accessories: 1x USB port
- Tire repair system (Land Rover tire repair system)
- Rear view camera
- Secure Tracker (12 month subscription)
- Seats: Rear bench seat, split 60:40 (not adjustable)
- Sporty stainless steel pedals
- Start-Stop System (Intelligent Stop-Start System)
- 12-volt sockets in the cargo area
- Phone: Android Auto
- Telephone: Bluetooth-enabled telephone system with audio streaming
- Traffic sign recognition with adaptive speed limiter
- Lashing eyes in the cargo area
- ABS including electronic traction control (ETC) (including brake force distribution (EBD))
- Airbag: Knee airbag for driver
- Airbag: Side airbags for driver and front passenger
- Perimetric alarm system
- All Terrain Progress Control (ATPC)
- Ambient interior lighting
- Trailer Stability Assist (TSA)
- Attention assistant
- Exterior mirrors, electrically folding and heated, with automatic dimming on the driver's side (and ambient lighting).
- Roof in car color
- Decor: Shadow Aluminum
- Tachometer
- Rear and front parking assist
- Electromechanical power steering (EPAS), speed-dependent
- Pedestrian protection system (airbag on the outside, below the windshield)
- Transmission: 9-speed automatic transmission
- Back window, heater
- Interior rearview mirror with automatic dimming function
- ISOFIX mounting points in the rear (outer seats)
- Automatic climate control (2-zone) with air vents (in the 2nd row of seats)
- Front headrests
- Cargo area cover
- Steering wheel: Multifunction leather steering wheel
- Headlight range no..aiVm LED.o.Anh.oAd.D
- Navigation: Pivi Pro with navigation (including Navigation Pro Connected)
- Package: Online Pack with data plan (includes up to 20 GB of monthly data usage for all selected online functions. If this limit is exceeded, the speed will be throttled to approximately 200 kbps. Valid for one year from activation. Optional paid renewal available.)
- Upholstery: Leather, grained
- Radio: Land Rover sound system (180 W) (with 6 speakers)
- Tire pressure monitoring system (TPMS)
- Remote
- Steering wheel paddle shifters in matte chrome
- Sensor-controlled driving light system
- Sun visors, two-piece with illuminated makeup mirrors
- Lane departure warning system
- Start/stop button for switching the engine on/off.
- 12V power outlet on the back of the center console
- Phone: Apple CarPlay
- Terrain Response 2 Automatic
- Torque vectoring (The torque vectoring system uses the vehicle's braking system to optimally distribute drive torque to all four wheels in corners. This improves grip and steering response and reduces the tendency to understeer.)



- Roll Stability Control (RSC)
- Immobiliser
- Central locking with remote control (for all doors, fuel filler cap and tailgate)

Extra equipment

- Detachable towbar
- Paint finish: Premium metallic without roof in contrasting color
- Seats: Driver's seat 14-way adjustable (12-way electric), heated (Passenger seat: 12-way adjustable (10-way electric, 2-way manual), heated - forward/backward - seat height - seat cushion tilt (driver's seat only) - backrest tilt - lumbar support, 4-way electric adjustable - headrest height, manually adjustable - front seats heated)
- Floor mats
- Wheels: 19" alloy wheels, Style 1039 Gloss Sparkle Silver All Terrain summer tires (8J x 19 with tires 235/55 R19)
- WiFi hotspot with data plan (data usage of up to 20 GB per month. If this limit is exceeded, the speed will be throttled to approximately 200 kbps. 1-year term from activation. Paid extension possible.)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Trim / covers	Door trim - rear left side - Scratch(es) - Loss in value
3	Wing mirror - right side	Cap - Scratch(es) - Smart repair
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Side panel - rear left side	Sill - Scratch(es) - Smart repair
6	Trim / covers	Roof lining - Scratch(es) - Smart repair
7	Door - rear right side	Door - Scratch(es) - Smart repair
8	Door - front left side	Door handle - outside (Kappe) - Missing - Replace
9	Boot lid / rear door	Boot lid (unterer Teil) - Scratch(es) - Paint
10	Vehicle glazing	Windscreen - Broken / torn - Replace
11	Side panel - rear right side	Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Tail light	Tail lamp - left side - Scratch(es) - No deduction
3	Front bumper	Front bumper - dent(s) - No deduction
4	Wheel / tyres	Alloy rim - front left side (Kein Teil der Ausstattung) - Scratch(es) - No deduction
5	Wheel / tyres	Alloy rim - front right side (Kein Teil der Ausstattung) - Scratch(es) - No deduction
6	Trim / covers	Floor mats (VL) - Holes - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

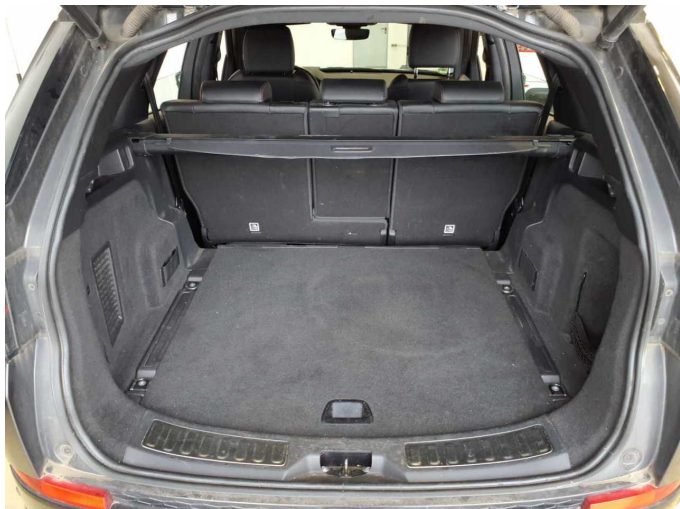


Figure 10: Cargo area

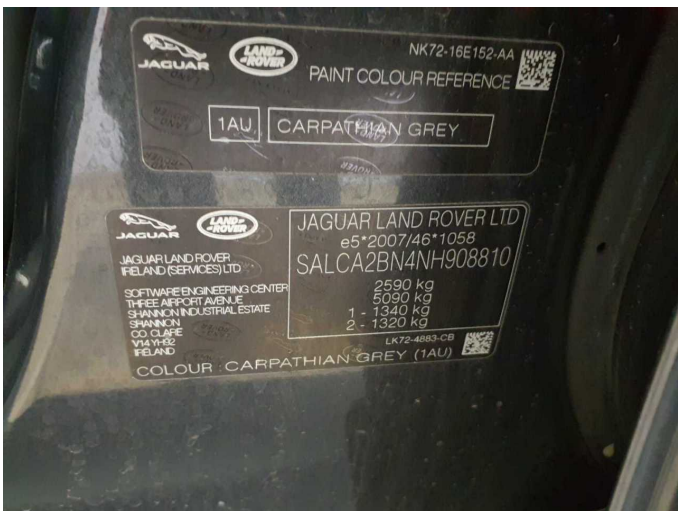


Figure 11: VIN

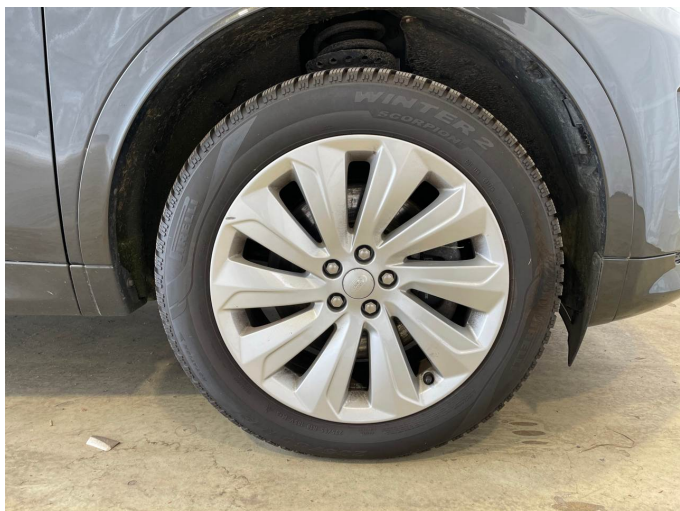


Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres

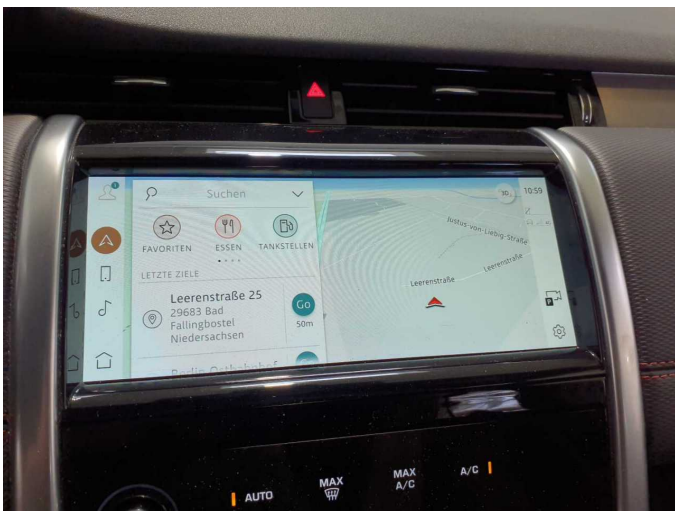


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

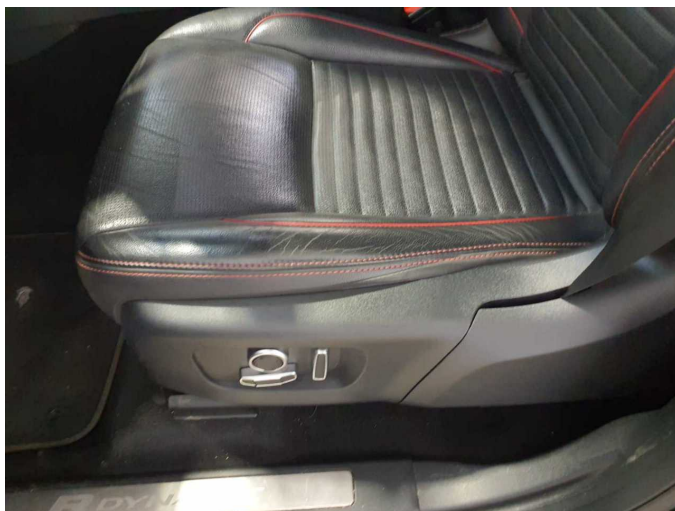


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Trim / covers: Door trim - rear left side - Scratch(es) - Loss in value



Damage 2: Trim / covers: Door trim - rear left side - Scratch(es) - Loss in value

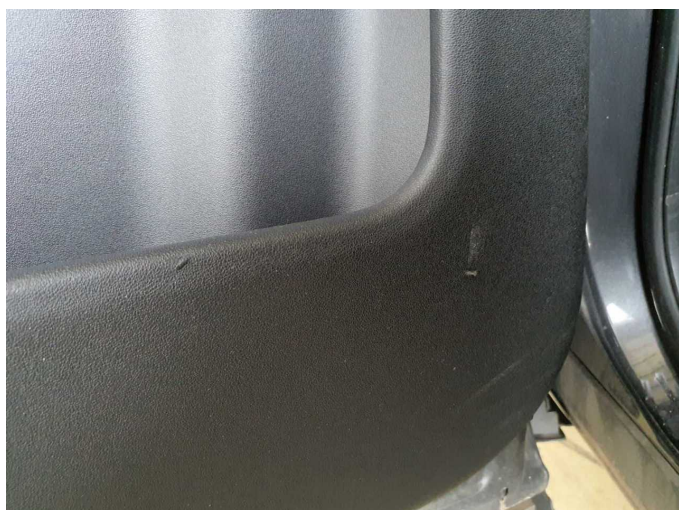


Damage 2: Trim / covers: Door trim - rear left side - Scratch(es) - Loss in value



Damage 3: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 3: Wing mirror - right side: Cap - Scratch(es) - Smart repair

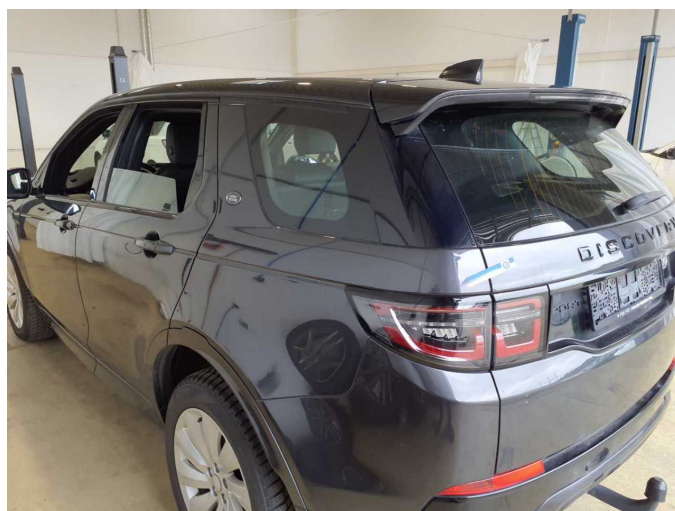


Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair

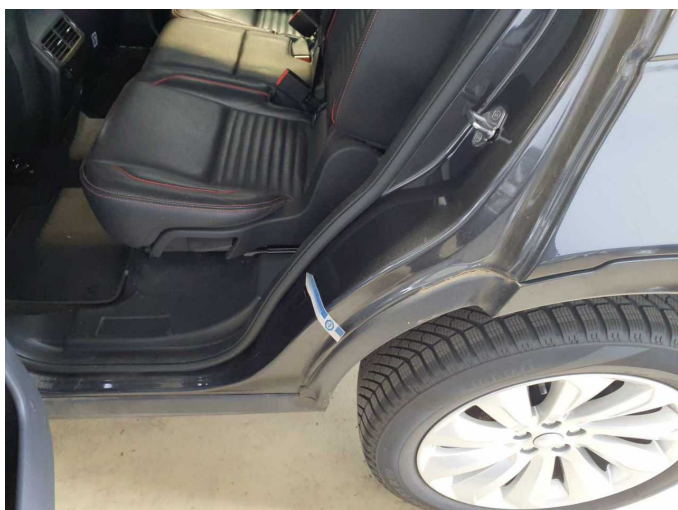


Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 6: Trim / covers: Roof lining - Scratch(es) - Smart repair




Damage 6: Trim / covers: Roof lining - Scratch(es) - Smart repair

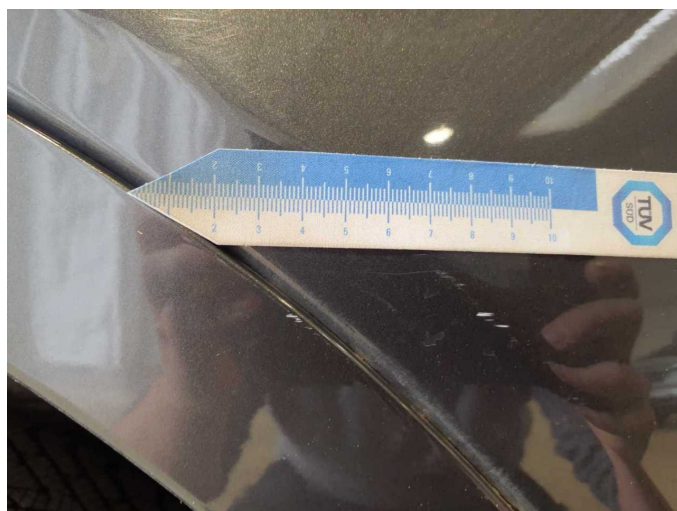


Damage 7: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 7: Door - rear right side: Door - Scratch(es) - Smart repair

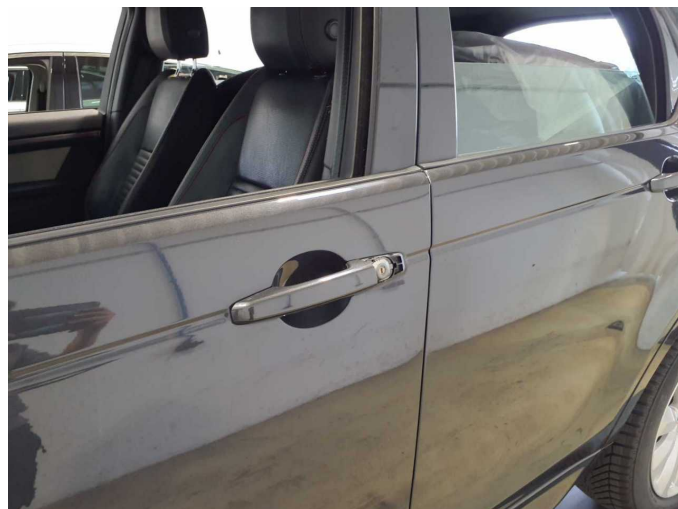

Damage 8: Door - front left side: Door handle - outside (Kappe) - Missing - Replace

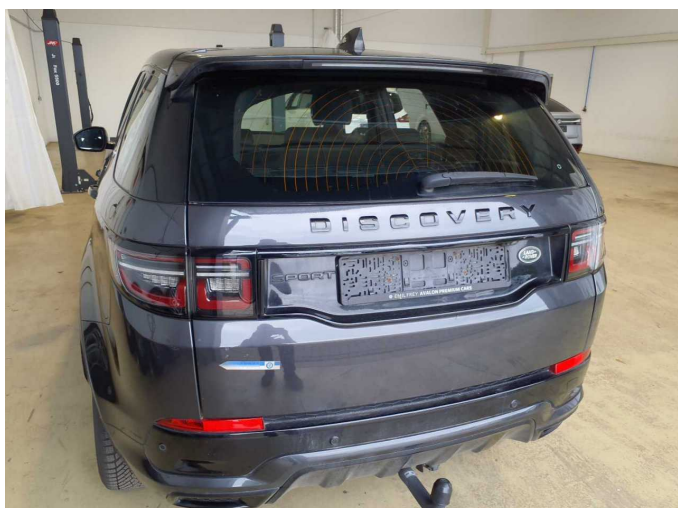

Damage 9: Boot lid / rear door: Boot lid (unterer Teil) - Scratch(es) - Paint



Damage 9: Boot lid / rear door: Boot lid (unterer Teil) - Scratch(es) - Paint



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 10: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Damage 11: Side panel - rear right side: Side panel (+ Radhausverbreiterung lackieren) - Dent / paintcoat damage - Paint



Wear and tear 5: Wheel / tyres: Alloy rim - front right side (Kein Teil der Ausstattung) - Scratch(es) - No deduction



Wear and tear 5: Wheel / tyres: Alloy rim - front right side (Kein Teil der Ausstattung) - Scratch(es) - No deduction



Wear and tear 6: Trim / covers: Floor mats (VL) - Holes - No deduction



Wear and tear 6: Trim / covers: Floor mats (VL) - Holes - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: SALCA2BN4NH908810

Hersteller / Modell: LAND ROVER LAND ROVER Discovery Sport D200 R-Dynamic S

Datum	KM-Stand	Beschreibung
05.02.2026	128.173	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
08.09.2025	109.556	Bremsbelagfühler ern; Bremsklötze vorne
29.04.2025	92.826	Bremsflüssigkeit ern; Keilriemen ern; Motoröl b. Wartung; Regelwartungsdienst
27.02.2025	88.243	AU; Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
29.02.2024	57.627	Bremsbelagfühler ern; Bremsklötze hinten; Bremsscheiben + Klötze v; Kraftstofffilter ern; Motoröl b. Wartung; Regelwartungsdienst
31.03.2023	32.131	Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst