



Expertise

Protocol number: 46606902
Order No. / Reference: 26692301
Inspection date: 14 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ7NEXL0144318

Model: Octavia Combi 2.0 TDI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG Style	
Vehicle Identification number	TMBJJ7NEXL0144318
Mileage (Read)	165,795 km
First registration	11 May 2020
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Quarz-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	29,700 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FU070063
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / ANL 00703		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,984 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R18 92Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/40 R18 92Y	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93V	Winter tyres on Light alloy	Michelin	3mm / 3mm
2)	205/50 R17 93V	Winter tyres on Light alloy	Michelin	2mm / 2mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment with cargo element on the left in the trunk and luggage hooks in the trunk
- Storage compartments (storage compartments in the front door panels with 1.0l bottle holders - storage compartments in the rear door panels with 0.5l bottle holders - cup holders in the front center console)
- Airbag, front side airbags
- Traction control (ASR)
- Electrically folding and dimming exterior mirrors
- Electrically adjustable and heated exterior mirrors with integrated turn signals
- Illuminated glove compartment
- On-board computer with 4.2" screen (black/white) (with, among other functions: - Time - Outside temperature - Current fuel consumption - Average fuel consumption - Trip distance - Trip time - Average speed - Fuel range - Service interval indicator - Door and trunk lid warning - Display of information from radio, navigation system and telephone (if available))
- Electronic transverse differential lock (XDS+)
- Electric rear windows (including child safety lock and anti-pinch protection)
- Front and rear footwell lighting
- Cruise control system
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Hydraulic brake assist
- CLIMATRONIC air conditioning (fully automatic - separately adjustable for driver and front passenger - including air-conditioned glove compartment - activated carbon filter - humidity sensor in the interior mirror)
- Steering wheel: height and reach adjustable
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters (including radio controls)
- Rear center armrest with cup holders and pass-through option
- Engine drag torque control (MSR)
- Fog lights with integrated cornering lights
- Upholstery: Leather-fabric interior style (combined with high-quality materials)
- Radio accessories: 8 speakers
- Radio accessories: SmartLink+ for pairing selected smartphone types (MirrorLink, Apple CarPlay, Android Auto, SmartGate)
- Tire pressure monitoring
- Gearshift and handbrake levers with leather elements
- Electromechanical power steering
- Seat: Driver and passenger seats height adjustable including lumbar support
- Seats: Heated front seats
- Storage compartment with cargo elements on the right side of the trunk
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Automatic interior mirror dimming, driving light assistant, rain sensor
- Exterior mirrors and door handles in body color
- Electrically folding exterior mirrors
- Hill start assist
- third brake light
- Roof rails, black
- Dark Waves decorative trim
- Diesel particulate filter and SCR catalyst
- Tachometer
- Ice scraper in the fuel filler flap
- Electromechanical power steering
- Electronic Stability Control (ESC)
- Electric front windows including anti-pinch protection
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Rear lights with LED brake and tail lights (including rear fog light)
- Rear window wiper including windshield washer system
- ISOFIX preparation on the outer rear seats, including top tether
- Front and rear headrests are height-adjustable.
- LED daytime running lights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel (gear knob and handbrake lever with leather elements)
- Two reading lights at the front (including reading lights at the rear - trunk lighting)
- Front center armrest, including storage compartment
- Multi-collision brake
- Rear parking sensors
- Radio: Bolero music system (with capacitive 8" color display)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: USB port and SD card slot
- Umbrella compartment including umbrella under the passenger seat
- Rear seat backrest split 60:40, foldable
- Heated windshield washer nozzles
- Octavia seat belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Belt fastening indicator on the front and rear outer seats)
- Sun visor on driver and passenger side with make-up mirror (on the driver's side with insert tab)
- 12V socket in the trunk
- 12V socket in the front center console
- Telephone: Bluetooth hands-free phone system without voice control



- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Immobiliser

Extra equipment

- Entry sill set, black
- Rubber floor mat set
- Keyless entry system and anti-theft alarm system including safe system (interior monitoring and tilt sensor)
- Fatigue detection
- Package: Light & Design (Full LED headlights with dynamic range control - Crystal glass-look taillights - LED license plate lighting - Headlight cleaning system - Chrome trim strips on the exterior side windows - Ambient lighting in the interior - Dark-brushed decorative inserts - Anodized roof rails)
- Package: Parking & Maneuvering (DSG) (Parking Assist incl. front parking sensors - Trailer Maneuvering Assist - Reversing Camera - Trailer Hitch)
- Radio accessories: SKODA Media Command (control of navigation, music via tablet or smartphone)
- Wheels: Steel spare wheel 18" (incl. jack, wheel wrench, tire mobility kit not included)
- Auxiliary heater with radio remote control
- Variable loading floor in the boot and multifunctional storage compartment under the boot cover (elimination of cargo elements in the boot)

- Lashing eyes in the trunk
- Preparation for attaching the warning triangle (and first aid kit in the trunk)
- Central locking including remote control
- High beam assist
- Rear protection strip silver
- Comfort opening for electric tailgate operation
- Paint finish: Metallic
- Package: Business Columbus (Dynamic navigation system Columbus 9, 2" capacitive color display - DVD drive - SmartLink+ MirrorLink, Apple CarPlay, Android Auto - DAB+ - European maps - 2 SD card slots - Wi-Fi hotspot - color Maxi-Dot display - Premium hands-free phone system rSAP - voice control - Phonebox with inductive charging function, connection via external antenna - SIM card slot (LTE support) - Infotainment Online (3-year subscription) - Sunset - luggage net partition and electric tailgate operation)
- roof rack
- Wheels: 18" alloy wheels Alaris, silver (7.5Jx18, tire size 225/40 R18)
- Lane Assist and Blind Spot Detect (including Rear Traffic Alert)
- Warning triangle

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Body	Wheel well - front right side - Broken / torn - Replace
3	Trim / covers	Boot sill cover - Loose - Replace
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
6	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
7	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
8	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
9	Wheel / tyres	Tyre - rear left side - Broken / torn - Replace
10	Door - front left side	Door - Scratch(es) - Paint
11	Side panel - rear right side	Side panel - Corrosion - Repair and paint
12	Bonnet	Bonnet (+ Steinschläge) - Dent / paintcoat damage - Paint
13	Front bumper	Front bumper - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Gearbox	Selector lever - Scratch(es) - No deduction
2	Steering system	Steering wheel - Scratch(es) - No deduction
3	2nd wheel set	Tyres - complete set - Worn - No deduction
4	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
5	Door - front right side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book (Digitaler Ausdruck)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 15 Nov 2023	5.807,68 €

Repainting

No. Repainting

1	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	202 µm	Door - rear left side	167 µm
-----------------------------	--------	-----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

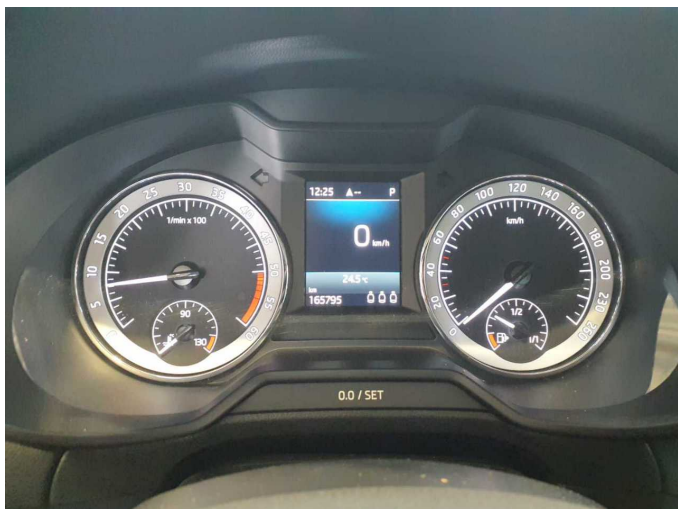


Figure 7: Instrument cluster



Figure 8: Instrument panel

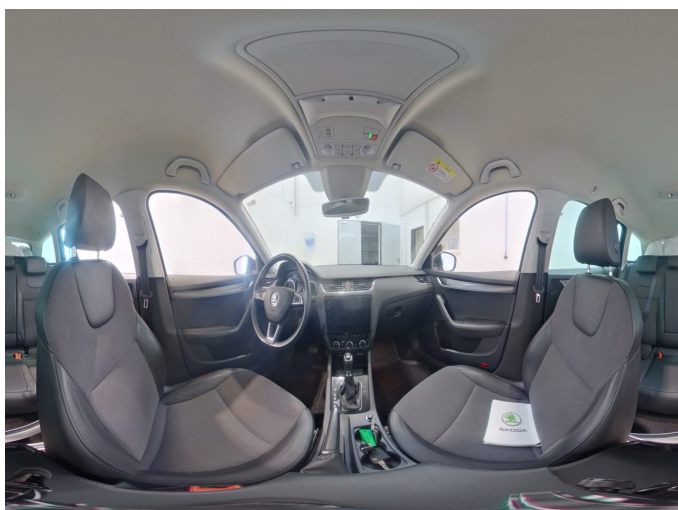


Figure 9: Interior 360° view



Figure 10: Cargo area

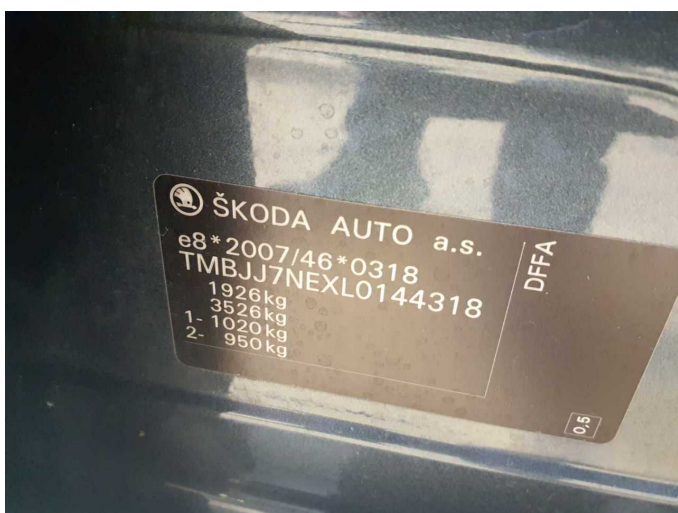


Figure 11: VIN



Figure 12: Mounted tyres

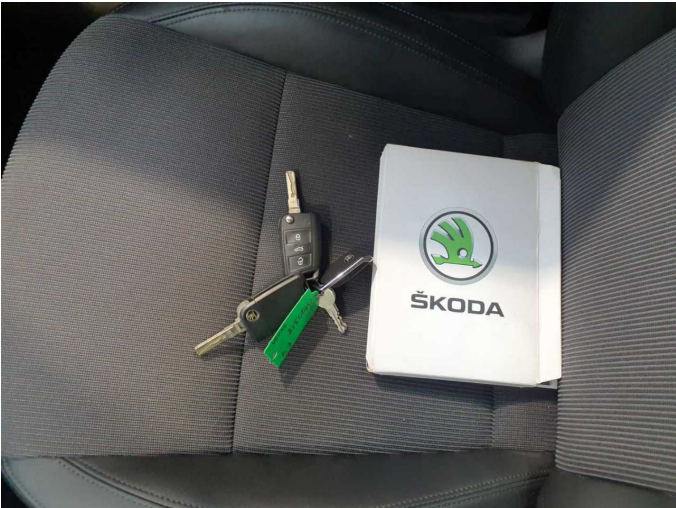


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

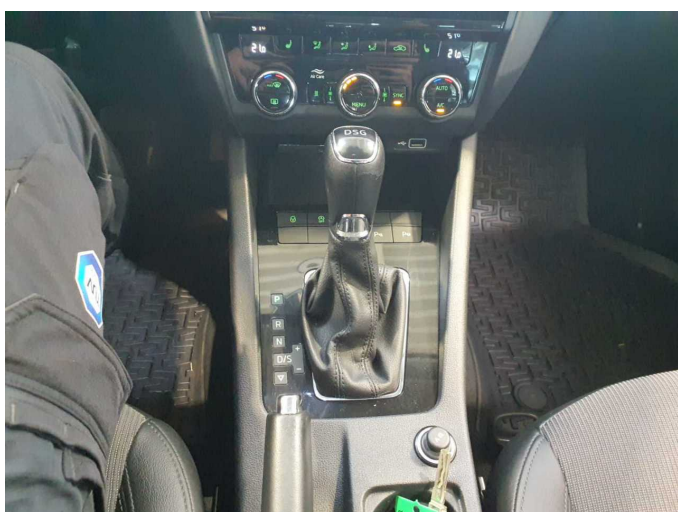


Figure 21: Misc.

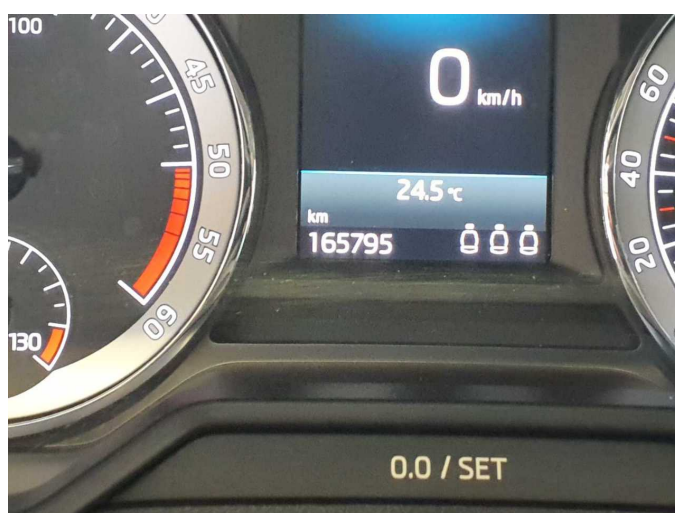


Figure 22: Misc.

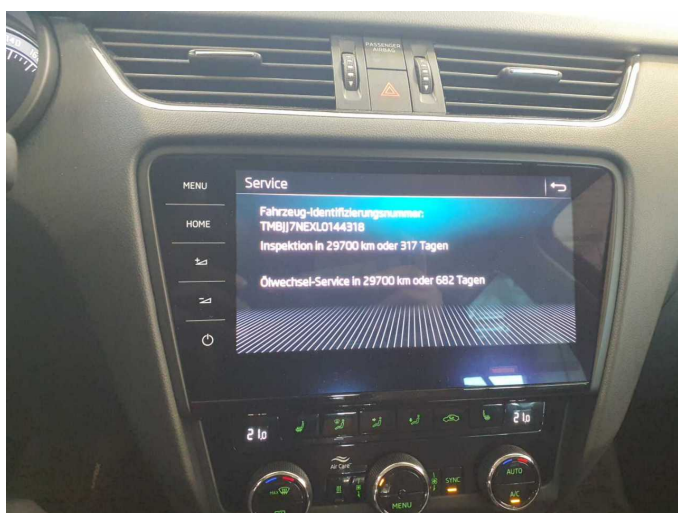


Figure 23: Misc.

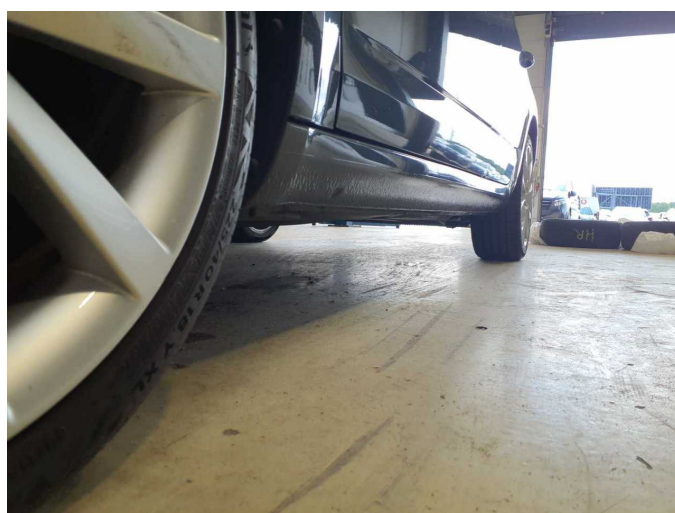


Figure 24: Misc.

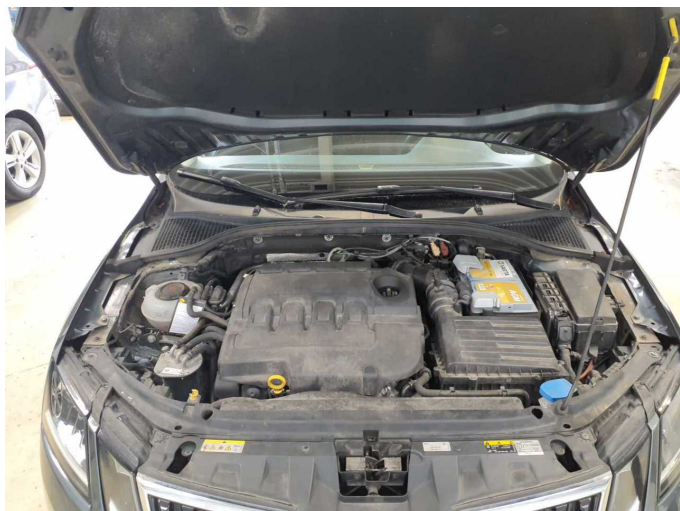


Figure 25: Misc.

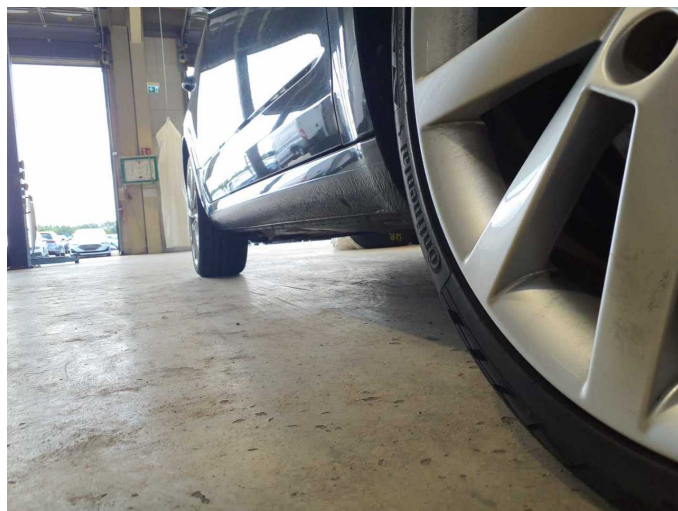


Figure 26: Misc.

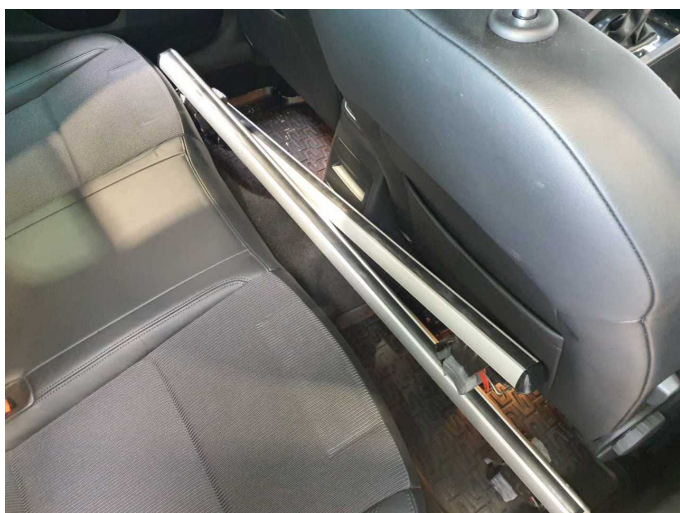


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


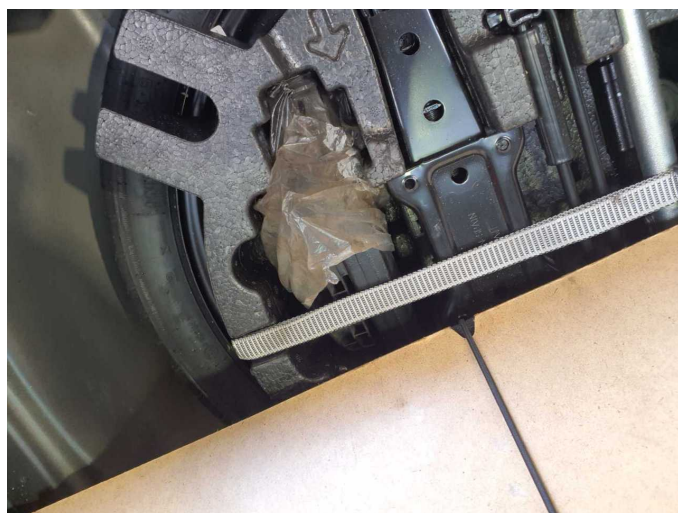


Figure 30: Misc.



Damage 2: Body: Wheel well - front right side - Broken / torn - Replace

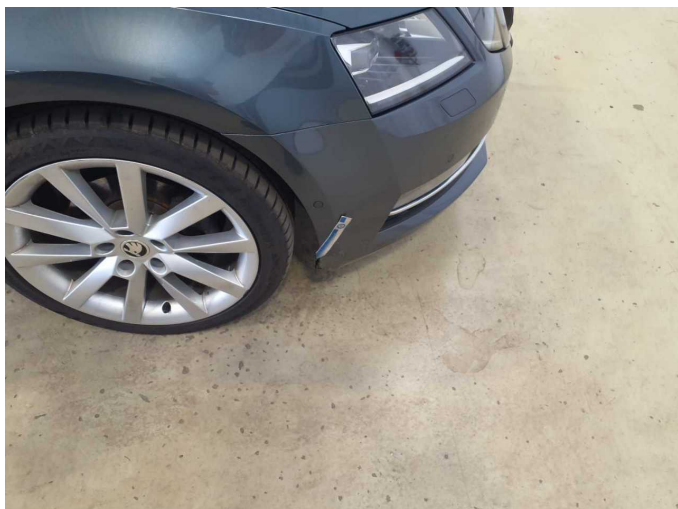


Damage 2: Body: Wheel well - front right side - Broken / torn - Replace



Damage 3: Trim / covers: Boot sill cover - Loose - Replace



Damage 3: Trim / covers: Boot sill cover - Loose - Replace

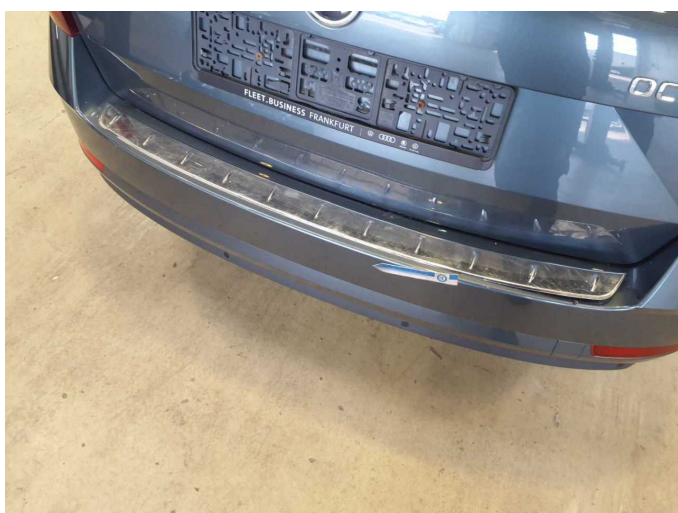

Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 5: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

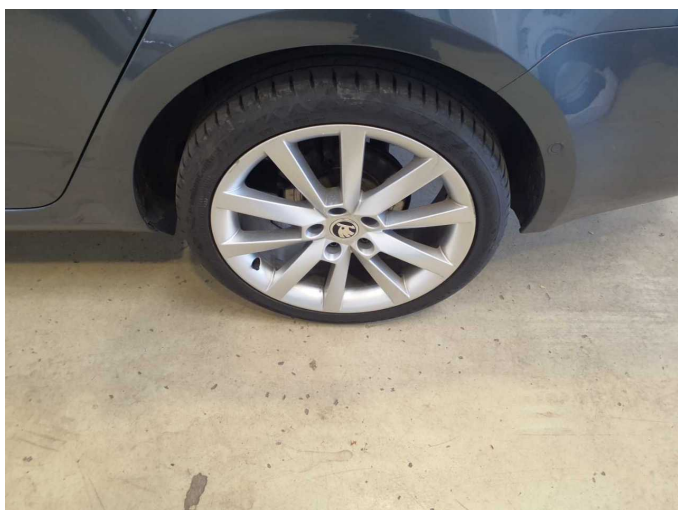


Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value

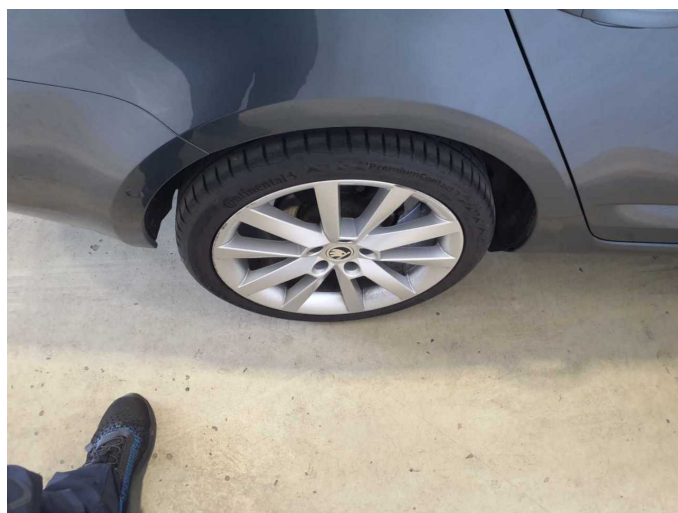

Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace



Damage 9: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace



Damage 10: Door - front left side: Door - Scratch(es) - Paint



Damage 10: Door - front left side: Door - Scratch(es) - Paint




Damage 11: Side panel - rear right side: Side panel - Corrosion - Repair and paint



Damage 11: Side panel - rear right side: Side panel - Corrosion - Repair and paint




Damage 11: Side panel - rear right side: Side panel - Corrosion - Repair and paint

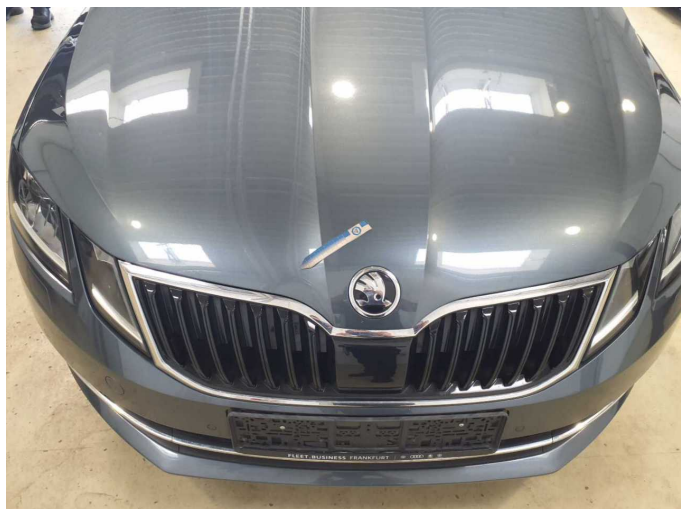


Damage 12: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage - Paint




Damage 12: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage - Paint

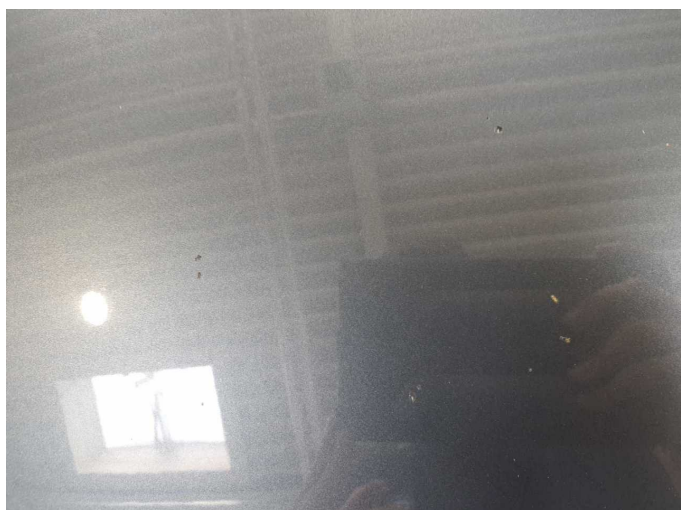


Damage 12: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage - Paint

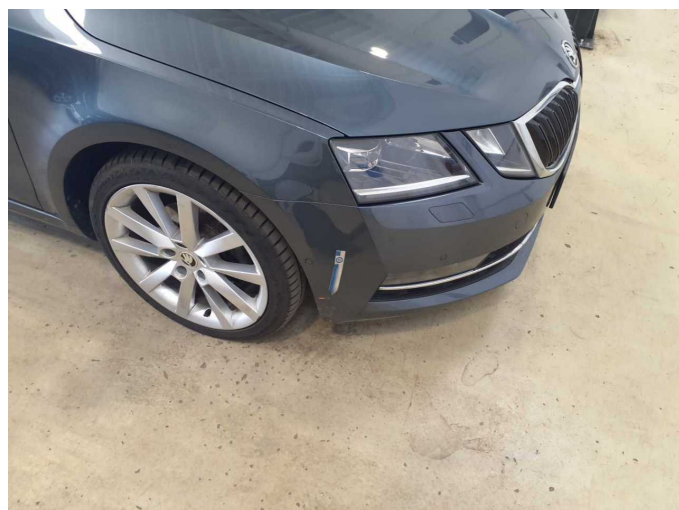

Damage 13: Front bumper: Front bumper - Broken / torn - Replace

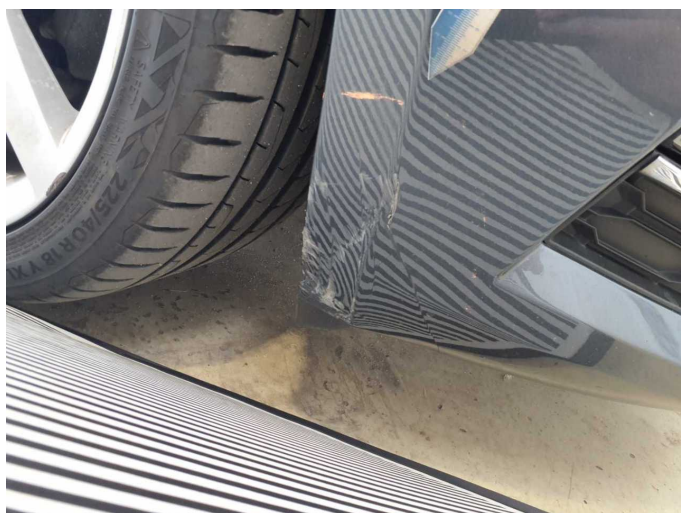

Damage 13: Front bumper: Front bumper - Broken / torn - Replace

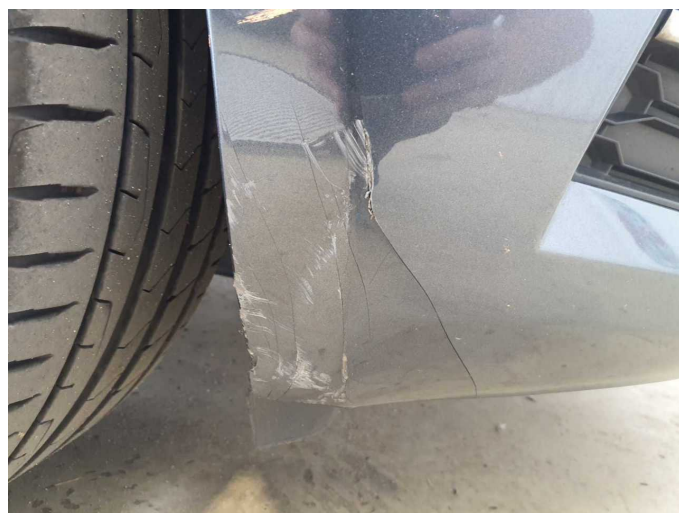

Damage 13: Front bumper: Front bumper - Broken / torn - Replace



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 2: Door - rear left side



Repainting 2: Door - rear left side